

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/III19000451/KEA3Q2

Date: 27/04/2020

REFERENCE

Handling Insurer:	India International Insurance Pte Ltd	Policy No:	D18MPC0000051
Claimant Vehicle No :	SKR2414B	Insured Vehicle No :	SDP6373C
Date of Loss:	21/12/2018	Nature of Claim:	TP
		Claim No:	MPC2018D0000285

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKR2414B	Engine No:	1ZRX484971
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 CVT (A)	Chassis No:	MR053REH104525659
Reg. Date:	28/01/2015 (Man. Year: 2015)	Odometer:	45382 km
Colour:	Metallic Brown		
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/45Z R17	Rear Tyre Size:	215/45Z R17
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	632.70	632.70	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	790.00	690.00	100.00	12.66
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	1,422.70	1,322.70	100.00	7.03
+ GST 7.00/7.00% (S\$)	99.59	92.59	7.00	7.03
Nett Amount (S\$)	1,522.29	1,415.29	107.00	7.03
+ Car Rental (3.0 x S\$100.00/day) (S\$)		300.00		
+ Doc/Search Fee (S\$)		7.49		
Nett Liability (S\$)		1,722.78		
Global Sum Settlement (S\$)		1,700.00		

INSPECTION

Date of Assignment:	07/01/2019	
Date Inspected:	08/01/2019	Inspected At:
		Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming) 160 Sin Ming Drive #04-01, Sin Ming AutoCity Singapore 575722
Estimated Period of Repair:	3.0 days	

Adjuster: KENNETH KONG**Manager:** Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 27 Apr 2020)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKR2414B)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Buckled	482.00 FL	*482.00 FL
2	1		*REAR BUMPER REINFORCEMENT	Dented	361.60 FL	*361.60 FL
					Sub Total (\$\$)	843.60
					- List Item Discount on L Items 25.00/25.00% (\$\$)	210.90
					Total Parts (\$\$)	632.70

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO TRANSFER REVERSING SENSOR	New	40.00	40.00
2	TO KNOCK DENTS ON REAR END PANEL AND RENEW OF PARTS	New	350.00	300.00
3	TO SPRAY PAINT	New	400.00	350.00
Gross Labour Cost (S\$)			790.00	690.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >