

Yew Tee Automobile Tech Pte Ltd (Co.Reg.No.200311009C)

Block 6 Woodlands Road 399F, Yew Tee Industrial Estate
Singapore 678006

Tel: 67653373 Fax: 67604895 Email: YTHQ

INSURER : **AXA**

PARTICULARS OF CLAIM

Claim Type:	TP	Ref. No:	YTHQ/TP/1902/008
Policy No:	5055012073-05	Date of Loss:	18/11/2018
Vehicle Reg. No.:	SKF1892Z	Driveable?	yes
Driver Age:	30/07/1957	Third Party Vehicle No.:	SMD490T/SJF5274T
Any Injuries?	no	Contact No:	98164229
Insured/Claimant:	YEO THIAN KEE	Driver:	YEO THIAN KEE

Make/Model:	Kia, Cerato Forte 1.6sx - KNAFW41	Vehicle Reg. Date:	26/02/2010
Vehicle Colour:	BLACK	Engine Number:	G4FC9H356235
Chassis No:	KNAFW411MA5191963	Odometer:	
Total Loss?	NO	Est. Duration of Repair(Day)	

Description of Accident/loss CHAIN COLLISION
Remarks:
Present Location: Yew Tee Automobile Tech Pte Ltd (HQ)-YTHQ

COST OF CLAIMS

	Amount
Parts	5,670.50
Miscellaneous Items	1,003.00
Labour	2,410.00
Paintwork Labour	1,385.00
Towing	0.00
Gross Total(S\$):	10,468.50
GST 7.00%(S\$):	732.79
Nett Amount(S\$):	11,201.29

This claim is handled by: Vinnie Lim M H

REPAIR DETAILS

Estimates On Parts

No.	Qty	Particulars	Rate	Amount	%Disc	After Disc
1	1	Rear bumper DEF ✓	0.00	200.00	+10.00	220.00
2	2	Rear Bumper side retainer CRA ✓	0.00	30.00	+10.00	33.00
3	2	Rear Bumper bracket DEF ✓	0.00	30.00	+10.00	33.00
4	1	Rear Bumper inner sponge CRA ✓	0.00	60.00	+10.00	66.00
5	1	Rear Bumper Reinforcement DD ✓	0.00	140.00	+10.00	154.00
6	1	Rear Bumper Lower Garnish DEF ✓	0.00	60.00	+10.00	66.00
7	1	Boot Lid BUC ✓	0.00	320.00	+10.00	352.00
8	2	Boot Lid Hinge BT ✓	0.00	60.00	+10.00	66.00
9	1	Boot Lid Lock DIS ✓	0.00	45.00	+10.00	49.50
10	1	Boot Lid Lock Catch NN X	0.00	17.00	+10.00	18.70
11	1	Boot Lid Rubber DEF ✓	0.00	38.00	+10.00	41.80
12	1	Boot Lid Logo NEC ✓	0.00	25.00	+10.00	27.50
13	1	Boot Lid Cerato Emblem NEC ✓	0.00	15.00	+10.00	16.50
14	1	Boot Lid Forte Emblem NEC ✓	0.00	15.00	+10.00	16.50
15	1	Boot Lid C & C Emblem NEC ✓	0.00	18.00	+10.00	19.80
16	2	Boot Lid Reflector ?	0.00	150.00	+10.00	165.00
17	1	Boot Lid Trim Board DEF ✓	0.00	75.00	+10.00	82.50
18	1	Rear Number Plate Outer Chrome Handle ?	0.00	100.00	+10.00	110.00
19	2	Rear Number Plate Lamp ?	0.00	20.00	+10.00	22.00
20	2	Rear Tailamp ?	0.00	160.00	+10.00	176.00
21	2	Rear Taillamp lower bracket ?	0.00	30.00	+10.00	33.00
22	2	Rear Taillamp Panel ?	0.00	190.00	+10.00	209.00
23	1	Rear Fender LH BUC ✓	0.00	380.00	+10.00	418.00
24	1	Rear Fender RH NN X	0.00	380.00	+10.00	418.00
25	1	Rear Fender Inner Shield LH ?	0.00	80.00	+10.00	88.00
26	1	Rear Fender inner Panel LH ?	0.00	0.00	+10.00	0.00
27	1	Rear Fender inner Trim Board LH ?	0.00	160.00	+10.00	176.00
28	1	Rear Windscreen Moulding NN X NEC ✓	0.00	22.00	+10.00	24.20
29	1	Rear End Panel BUC ✓	0.00	180.00	+10.00	198.00
30	1	Rear End Panel Inner Garnish BUC ✓	0.00	40.00	+10.00	44.00
31	1	Rear Spare Tyre Panel ?	0.00	300.00	+10.00	330.00
32	1	Rear Spare Tyre Board ?	0.00	85.00	+10.00	93.50
33	1	Rear Spare Tyre Bolt ?	0.00	30.00	+10.00	33.00
34	1	Rear Chassis Member LH ?	0.00	440.00	+10.00	484.00
35	1	Rear Chassis Member RH ?	0.00	440.00	+10.00	484.00
36	1	Rear Exhaust Silencer ?	0.00	470.00	+10.00	517.00
37	1	Rear Exhaust Pipe NN X	0.00	320.00	+10.00	352.00
38	2	Rear Exhaust Pipe Mounting ?	0.00	30.00	+10.00	33.00

Total Parts (\$\$) 5,670.50

Estimates of Miscellaneous Items

No.	Qty	Particulars	Rate	Amount	%Disc	After Disc
1	1	Rear Bumper Clips NEC ✓	0.00	35.00	0.00 30	35.00
2	4	Rear Bumper Sensor shorted ✓	0.00	880.00	0.00 200	880.00
3	1	Rear Number Plate DEF ✓	0.00	45.00	0.00	45.00
4	2	Rear Tailamp Clips ?	0.00	8.00	0.00	8.00
5	1	Rear fender inner shield clips ?	0.00	35.00	0.00	35.00

Sub Total (\$\$) 1,003.00

Estimates On Labour						
No.	Qty	Particulars	Rate	Amount	%Disc	After Disc
1	1	To Remove And Refit Carpet And Trims On The Rear Section To Give Way To The Repair on The Rear Section.	100.00	100.00	0.00	50 100.00 ✓
2	1	To Remove and Refit Rear Cushion Fittings.	80.00	80.00	0.00	80.00 ✗
3	1	To Remove and Refit, Straighten and Re-adjust Exhaust Pipe and Rear Exhaust Silencer and Mountings.	180.00	180.00	0.00	180.00 ✗
4	1	To Remove and Refit Rear Bumper Sensor.	80.00	80.00	0.00	50 80.00 ✓
5	1	To Remove and Replace the above Damaged Parts, Straighten, Knock out, Realign and Repair including Cut and Weld body panels. To Re-adjust to the Original position using power tools.	1,800.00	1,800.00	0.00	1,800.00 1000 ✓
6	1	To Dismantle and Refit Rear Windscreen Glass.	100.00	100.00	0.00	100.00 ✓
7	1	To Disconnect and Reconnect, Check Electrical wiring Harness Wire, Sockets, Replace Damaged Parts.	70.00	70.00	0.00	40 70.00 ✓
Gross Labour Cost (\$\$)						2,410.00

Estimates On Paint Work Labour						
No.	Qty	Particulars	Rate	Amount	%Disc	After Disc
1	1	To Carry-Out Body Cavity Preservation.	80.00	80.00	0.00	40 80.00 ✓
2	1	To Spray painting on the Replaced and Repair Parts, Prepare Spray Such as Masking Tape the unaffected areas with paper, Cleaning and Sanding of Surfaces, Final Polishing and Waxing are also available.	1,200.00	1,200.00	0.00	1,200.00 800 ✓
3	1	To Supply Spray Terostat Sealant On The Cutting Areas.	45.00	45.00	0.00	45.00 ✓
4	1	To Apply Undercoating On The Repaired and Replaced Panels For Rust Protection.	60.00	60.00	0.00	60.00 ✓
Gross Labour Cost (\$\$)						1,385.00

< END OF ESTIMATES >

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Three Jir - LKK
24/2/19
C/S 6days.


hwajie@lkkauto.com