

ASS. REC. BY:

REF:

AXA

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

131 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

1

File pass to
83911.54

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Report Format :

Lump Sum / I.B.I. (\$) :

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS. SI

Fees

Others

TOTAL

Veh No:

S140 462J

Yr Regn:

07, 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Renault Latitude c.c. 1985

Colour:

M. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

148896

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VF1ABL15AUC. 2834085

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Giti

Front

Rear

R/Bal.

5

mm

R/Bal.

8

mm

L/Bal.

5

mm

L/Bal.

8

mm

D.O.A.

4/3/19

D.O.I.

6/3/19

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

R (\$ 41,781.92 / 887.)

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No.: 6287 6666 Fax No.: 6257 1330

CO./GST Reg. No. 201019626G

SHD 462J**AAD1903-030***Not Notarized**Recovery By paint**85911.54*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

SHD 462J

VF1ABL15AUC283405

RENAULT

LATITUDE

4.3.2019

AXA

31/7/2017

PART**LIST**

- 1 1 BUMPER COVER REAR
- 2 1 BUMPER LOWER REAR
- 3 1 BUMPER BRACKET CTR REAR
- 4 1 BUMPR BRACKET SIDE RH REAR
- 5 1 BUMPR RETAINER RH REAR
- 6 1 BUMPER REFLECTOR RH
- 7 1 BUMPR BRACKET SIDE LH REAR
- 8 1 BUMPR RETAINER LH REAR
- 9 1 BUMPER REFLECTOR LH
- 10 1 BUMPER BEAM REAR
- 11 1 BUMPER BEAM BRACKET LH REAR
- 12 1 BUMPER BEAM BRACKET RH REAR
- 13 1 BOOT REAR
- 14 1 BOOT FINISHER
- 15 1 BOOT WHEATERSTRIP
- 16 1 BOOT REFLECTOR LAMP LH
- 17 1 BOOT REFLECTOR LAMP RH
- 18 1 BOOT BADGE 'RENAULT'
- 19 1 BOOT BADGE
- 20 1 BOOT STRUT LH
- 21 1 BOOT STRUT RH
- 22 1 BOOT HINGE LH
- 23 1 BOOT HINGE RH
- 24 1 BOOT INNER TRIM
- 25 1 BOOT SWITCH
- 26 1 BOOT LOCK
- 27 1 BOOT LOCK CATCH
- 28 2 LICENCE PLATE LAMP
- 29 2 BOOT RUBBER PLUG

- | | | | |
|----|----------------|----------|-----|
| \$ | <i>Bu</i> | 1,108.46 | — |
| \$ | <i>nd 1011</i> | 768.84 | — |
| \$ | <i>SL</i> | 113.47 | X |
| \$ | <i>SL</i> | 135.97 | X |
| \$ | <i>SL</i> | 44.99 | X |
| \$ | <i>CM</i> | 43.61 | ✓ |
| \$ | <i>SL</i> | 135.97 | X |
| \$ | <i>SL</i> | 44.99 | X |
| \$ | <i>SL</i> | 43.61 | X |
| \$ | <i>W</i> | 777.52 | ✓ |
| \$ | <i>N</i> | 225.95 | X |
| \$ | <i>N.1</i> | 225.95 | ✓ |
| \$ | <i>K</i> | 2,872.68 | } X |
| \$ | <i>SL</i> | 470.06 | |
| \$ | <i>SL</i> | 323.05 | |
| \$ | <i>SL</i> | 493.35 | |
| \$ | <i>SL</i> | 493.35 | |
| \$ | <i>SL</i> | 225.36 | |
| \$ | <i>SL</i> | 225.36 | |
| \$ | <i>SL</i> | 276.08 | |
| \$ | <i>SL</i> | 276.08 | |
| \$ | <i>N</i> | 367.84 | |
| \$ | <i>N</i> | 367.84 | |
| \$ | <i>SL</i> | 586.45 | } |
| \$ | <i>N</i> | 168.13 | |
| \$ | <i>N</i> | 202.67 | |
| \$ | <i>SL</i> | 74.40 | } |
| \$ | <i>SL</i> | 50.52 | |
| \$ | <i>SL</i> | 221.81 | } |

11369.36

Trans-cab Auto Services Pte Ltd**AAD1903-030**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 462J

30	1 FENDER PANEL REAR RH	\$	<i>N</i>	3,299.13	} X
31	1 WHEELARCH REAR RH	\$	<i>Sn</i>	543.47	
32	1 FENDER PANEL REAR LH	\$	<i>N</i>	3,299.13	
33	1 WHEELARCH REAR LH	\$	<i>Sn</i>	543.47	
34	1 TAILLAMP LH	\$	<i>Sn</i>	552.55	
35	1 TAILLAMP PANEL LH	\$	<i>N</i>	986.70	
36	1 TAILLAMP RH	\$	<i>Sn</i>	552.55	}
37	1 TAILLAMP PANEL RH	\$	<i>N</i>	986.70	
38	1 OUTER PANEL REAR (End Panel)	\$	<i>N</i>	1,471.77	✓
39	1 OUTER PANEL REAR (End Panel)TRIM	\$	<i>Sn</i>	404.56	X
40	1 SPARE WHEEL PANEL (Luggage Floor Panel)	\$	<i>N</i>	2,189.88	X
41	1 SPARE WHEEL PANEL TRIM	\$	<i>Sn</i>	612.21	X
42	1 EXHAUST REAR	\$	<i>N</i>	7,489.05	X
43	1 EXHAUST CAP REAR	\$	<i>N</i>	230.49	X

231 61.66

TOTAL	\$	34,526.04	<i>02</i>
10%	\$	3,452.60	
	\$	31,073.44	<i>42</i>

Special Nett

1	1SET PARKING AID	\$	<i>Sn</i>	700.00	<i>Good</i>
2	1SET REAR BUMPER CLIP	\$	<i>N</i>	66.00	—
3	1SET BUMPER BRACKET CTR CLIP	\$	<i>N</i>	33.00	—
4	1SET BUMPER BRACKET SIDE CLIP RH RR	\$	<i>N</i>	10.00	X
5	1SET BUMPR RETAINER RH CLIP RR	\$	<i>N</i>	20.00	X
6	1SET BUMPR BRACKET SIDE CLIP LH RR	\$	<i>N</i>	10.00	X
7	1SET BUMPR RETAINER CLIP LH RR	\$	<i>N</i>	20.00	X
8	1SET BUMPER LOWER REAR RIVET	\$	<i>N</i>	22.00	X
9	1SET BUMPER LOWER REAR CLIP	\$	<i>N</i>	66.00	✓
10	1 EXHAUST MOUNTING REAR	\$	<i>Sn</i>	17.82	X
11	1SET BOOT FINISHER CLIP	\$	<i>N</i>	24.20	X
12	1 REAR BOOT STICKER 'TRANS-CAB'	\$	<i>N</i>	80.00	X
13	1 REAR BOOT STICKER '6555-3333'	\$	<i>N</i>	80.00	X

Trans-cab Auto Services Pte Ltd**AAD1903-030**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 462J

14	1SET FENDER WHEELARCH REAR RH CLIP	\$	nn	35.00	} X
15	1SET FENDER WHEELARCH REAR LH CLIP	\$	nn	35.00	
16	1 FENDER INNER TRIM CLIP LH	\$	nn	28.00	
17	1 FENDER INNER TRIM CLIP LH	\$	nn	28.00	
18	1 TAILLAMP CLIP RH	\$	nn	5.00	
19	1 TAILLAMP CLIP LH	\$	nn	5.00	
20	2 REAR WINDSCREEN SELANT	\$	nn	80.00	
21	1 WINDSCREEN MOULDING	\$	nn	100.00	
22	1 REAR WINDSCREEN INNER SPONGE SEAL	\$	nn	100.00	
23	1 SPARE TYRE RIM (ROUE 7J 16H 2547)	\$	nn	385.00	
24	1 SPARE TYRE	\$	nn	330.00	

TOTAL \$ 2,280.02**TOTAL PARTS \$ 33,353.46****LABOUR**

Putty And Spray Painting Of The Affected Portion.	\$	6,000.00	4401
Panel Beating, Knocking And Straightening The Necessary Portion, Remove And Renewal Of Parts, Adjust And Realign The Same	\$	6,000.00	6001
To Rust-Proofing Of The Affected Areas.	\$	170.00	301
To reinstall rear bumper parking sensor.	\$	170.00	601
To transfer of bootlid fittings, attachments and perform water seepage test.	\$	nn 170.00	X
To repair and realign rear exhaust pipe.	\$	nn 170.00	X
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	nn 170.00	X

Trans-cab Auto Services Pte Ltd**AAD1903-030**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 462J

To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	170.00	601
To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.	\$	170.00	X
To supply and re-do rear luggage floor panel insulation padding.	\$	380.00	X
To transfer of rear fender fittings, attachment and perform water seepage test.	\$	380.00	X
To transfer of rear windscreen fittings and conduct water seepage test.	\$	170.00	X
To check steering geometry and computer wheel alignment	\$	220.00	X
To transfer of rear door fittings, attachment and perform water seepage test.	\$	380.00	X
TOTAL	\$	14,340.00	14720

Over All Total \$ 47,693.46

48073.44

(PART-BY-PART)**Repair Days****20-DAYS**

4 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey.
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer:
Signature:
Date:



Re:MANDATE IA - SHD 462J - TRANS-CAB

Type

🔗 Question

Message

Pls proceed as per mandate. TY.

Reply



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 CRI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Immediate Advice

To : AXA Insurance Pte Ltd

Date: 6/3/2019

Survey Details:

Date of loss	4-Mar-19
Date of appointment	6-Mar-19
Date of survey	6-Mar-19
Location of survey	TRANS-CAB AUTO SERVICES PTE LTD

Vehicle Details:

Claim Type:	THIRD PARTY CLAIM
Vehicle number	SHD 462J
Make and Model	RENAULT LATITUDE 2.0L DCI - 1995cc
Date of registration	31-Jul-17
Parf Rebate	
Market Value	\$ -
Parf Rebate	\$ -
Nett Loss	\$ -

Repair details:

Initial Estimate	47,693.46
-------------------------	------------------

Proposed/Revised repair cost:

Parts	\$ 4,721.54
Check items (estimate)	\$ -
Labour	\$ 1,190.00
Total	\$ 5,911.54
Lump Sum(if applicable)	\$ -

Number of days for repair	<u>4 days</u>
----------------------------------	----------------------



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Remarks:

HEAD TO REAR - BOLA 27

Mandate:

Liability(TP)		100%
Proposed repair cost	\$	6,325.35
Loss of rental	\$	517.05
Loss of income	\$	250.00
LTA search fees	\$	7.49
Others		
Proposed Total	\$	7,099.89

Jay

Trans-Cab Services Pte Ltd

No. 2 Ang Mo Kio Street 63

Tel No.: 6287 6666 Fax No. 6281 1400

Co./GST Reg. No. 200303878K

Our Ref : AAD1903-030

Lkr

Your Ref : SDZ2772H

Date : 03.May 2019

AXA INSURANCE S PTE LTD

Dear Sir/Madam,

ACCIDENT INVOLVING SHD0462J AND SDZ2772H ON 04/03/19 05:45 PM ALONG AYE

It appears that the above accident was caused by your insured's negligence. We, therefore seeking compensation from you for our financial loss as itemized below :-

1.	Cost of Repair (inclusive of 7% GST)	\$	6,325.35
2.	Loss of Rental for <u>5</u> days @ \$ <u>103.41</u> per day	\$	517.05
3.	Loss of Income for <u>5</u> days @ \$ <u>50.00</u> per day	\$	250.00
4.	LTA Search Fee	\$	7.49
5.	Survey Fee	\$	0.00
	Total	\$	7,099.89

We enclose a copy of the following documents for your consideration :-

GIA report lodged by our driver

Rental rate and mileage records

Certificate of Insurance

Authorization To Act

Original final repair bill

LTA Search Fee

Kindly let us have the discharge voucher within the next 14 days, failing which we shall proceed to hand over the conduct of this matter to our solicitors without further reference to you.

Yours Faithfully

Trans-Cab Services Pte Ltd



Jasmine Tan

General Manager

Tel No. : 6603 1250 (DID)

Note : Please email any further correspondence to claims@transcab.com.sg (6603 1259)

THIRD PARTY EXPRESS SETTLEMENT (PAYMENT BREAKDOWN)

Vehicle No:	SDZ 2772H (Insd veh)	Model:	RENAULT LATITUDE (A)
	SHD 462J (TP veh)		
Date of Accident:	04/03/2019		

Global Sum Settlement	:	[] Yes	[X] No	
Repair Estimate	:	\$	51,438.58	
Final Repair Cost	:	\$	6,325.35	
Loss of Token Sum	:	\$	250.00	5 days at \$50.00 per day
Rental (if any)	:	\$	517.05	5 days
LTA / GIA Search Fee	:	\$	7.45	

Others:	:	\$	
---------	---	----	--

	:	\$	
Final Settlement Sum	:	\$	7,099.85

Is Third Party Workshop GIA Registered? [X] YES [] NO (Kindly indicate below)	
A) For Non GIA Registered Workshop:	Agreed Liability _____ (%)
B) For GIA Registered Workshop:	BOLA Applicable: Yes/ No BOLA Scenario No: _____
BOLA Liability: _____ 100 _____ (%)	Assessed Liability (*): _____ (%)
* Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.	
Remarks PLEASE SEND THE CHEQUE PAYMENT TO TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111	

Payment Instruction: Payee's Breakdown	
1) TRANS-CAB AUTO SERVICES PTE LTD	: \$ 7,099.85

NUR SHAQILAH BTE ABDOL
WAHAB

24/06/2019
Date

Please attach all the supporting documents to the form.
(Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report; Medical Report/ Bill (if any))



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AXA INSURANCE PTE LTD			Ref : CC3/ASM19004215/Kja3s2	
8 SHENTON WAY #24-01 AXA TOWERSINGAPORE 068811 ATTN: RICHARD ANG			Date : 24-06-2019	
			Code : ASM	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SDZ 2772H	Veh. Inspected	SHD 462J	
Policy No.	GA076247	Coverage (\$)	0.00	
Claim No.	S9M01G18	Excess (\$)	0.00	
Assign From		Assign Date	06/03/2019	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	VF1ABL15AUC283405	Colour	METALLIC WHITE / RED	
Odometer	148694	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60R16	GITI	5 mm	
L/H Front Tyre	215/60R16	GITI	5 mm	
R/H Rear Tyre	215/60R16	GITI	8 mm	
L/H Rear Tyre	215/60R16	GITI	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/03/2019	Inspection Date	06/03/2019	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 462J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BUMPER COVER REAR (CONSISTENT)	BUCKLED	1,108.46	1,108.46
1	BUMPER LOWER REAR (CONSISTENT)	DENTED / DISTORTED	768.84	768.84
1	BUMPER BRACKET CTR REAR (CONSISTENT)	SERVICEABLE	113.47	-
1	BUMPER BRACKET SIDE RH REAR (CONSISTENT)	SERVICEABLE	135.97	-
1	BUMPER RETAINER RH REAR (CONSISTENT)	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR RH (CONSISTENT)	CRACKED	43.61	43.61
1	BUMPER BRACKET SIDE LH REAR (CONSISTENT)	SERVICEABLE	135.97	-
1	BUMPER RETAINER LH REAR (CONSISTENT)	SERVICEABLE	44.99	-
1	BUMPER REFLECTOR LH (CONSISTENT)	SERVICEABLE	43.61	-
1	BUMPER BEAM REAR (CONSISTENT)	BENT	777.52	777.52
1	BUMPER BEAM BRACKET LH REAR (CONSISTENT)	TO REPAIR SEE LABOUR	225.95	-
1	BUMPER BEAM BRACKET RH REAR (CONSISTENT)	DISTORTED	225.95	225.95
1	BOOT REAR (CONSISTENT)	TO REPAIR SEE LABOUR	2,872.68	-
1	BOOT FINISHER (CONSISTENT)	SERVICEABLE	470.06	-
1	BOOT WEATHERSTRIP (CONSISTENT)	SERVICEABLE	323.05	-
1	BOOT REFLECTOR LAMP LH (CONSISTENT)	SERVICEABLE	493.35	-
1	BOOT REFLECTOR LAMP RH (CONSISTENT)	SERVICEABLE	493.35	-
1	BOOT BADGE 'RENAULT' (CONSISTENT)	NOT NECESSARY	225.36	-
1	BOOT BADGE (CONSISTENT)	NOT NECESSARY	225.36	-
1	BOOT STRUT LH (CONSISTENT)	SERVICEABLE	276.08	-
1	BOOT STRUT RH (CONSISTENT)	SERVICEABLE	276.08	-
1	BOOT HINGE LH (CONSISTENT)	TO REPAIR SEE LABOUR	367.84	-
1	BOOT HINGE RH (CONSISTENT)	TO REPAIR SEE LABOUR	367.84	-
1	BOOT INNER TRIM (CONSISTENT)	SERVICEABLE	586.45	-
1	BOOT SWITCH (CONSISTENT)	TO REPAIR SEE LABOUR	168.13	-
1	BOOT LOCK (CONSISTENT)	TO REPAIR SEE LABOUR	202.67	-

Report Ref No. CC3/ASM19004215/Kja3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT LOCK CATCH (CONSISTENT)	SERVICEABLE	74.40	-
2	LICENCE PLATE LAMP (CONSISTENT)	SERVICEABLE	50.52	-
2	BOOT RUBBER PLUG (CONSISTENT)	SERVICEABLE	221.81	-
1	FENDER PANEL REAR RH (CONSISTENT)	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR RH (CONSISTENT)	SERVICEABLE	543.47	-
1	FENDER PANEL REAR LH (CONSISTENT)	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR LH (CONSISTENT)	SERVICEABLE	543.47	-
1	TAILLAMP LH (CONSISTENT)	SERVICEABLE	552.55	-
1	TAILLAMP PANEL LH (CONSISTENT)	TO REPAIR SEE LABOUR	986.70	-
1	TAILLAMP RH (CONSISTENT)	SERVICEABLE	552.55	-
1	TAILLAMP PANEL RH (CONSISTENT)	TO REPAIR SEE LABOUR	986.70	-
1	OUTER PANEL REAR (END PANEL) (CONSISTENT)	BENT	1,471.77	1,471.77
1	OUTER PANEL REAR (END PANEL) TRIM (CONSISTENT)	SERVICEABLE	404.56	-
1	SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL) (CONSISTENT)	TO REPAIR SEE LABOUR	2,189.88	-
1	SPARE WHEEL PANEL TRIM (CONSISTENT)	SERVICEABLE	612.21	-
1	EXHAUST REAR (CONSISTENT)	TO REPAIR SEE LABOUR	7,489.05	-
1	EXHAUST CAP REAR (CONSISTENT)	TO REPAIR SEE LABOUR	230.49	-
	LESS 10% DISCOUNT		-3,452.60	-439.61
			31,073.42	3,956.54
	SPECIAL NETT ITEMS			
1	SET PARKING AID (SN) (CONSISTENT)	SCRATCHED	700.00	600.00
1	SET REAR BUMPER CLIP (SN) (CONSISTENT)	NECESSARY	66.00	66.00
1	SET BUMPER BRACKET CTR CLIP (SN) (CONSISTENT)	NECESSARY	33.00	33.00
1	SET BUMPER BRACKET SIDE CLIP RH RR (SN) (CONSISTENT)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER RH CLIP RR (SN) (CONSISTENT)	NOT NECESSARY	20.00	-
1	SET BUMPER BRACKET SIDE CLIP LH RR (SN) (CONSISTENT)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP LH RR (SN) (CONSISTENT)	NOT NECESSARY	20.00	-

Report Ref No. CC3/ASM19004215/Kja3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SET BUMPER LOWER REAR RIVET (SN) (CONSISTENT)	NOT NECESSARY	22.00	-
1	SET BUMPER LOWER REAR CLIP (SN) (CONSISTENT)	NECESSARY	66.00	66.00
1	EXHAUST MOUNTING REAR (SN) (CONSISTENT)	SERVICEABLE	17.82	-
1	SET BOOT FINISHER CLIP (SN) (CONSISTENT)	NOT NECESSARY	24.20	-
1	REAR BOOT STICKER 'TRANS-CAB' (SN) (CONSISTENT)	NOT NECESSARY	80.00	-
1	REAR BOOT STICKER '6555-3333' (SN) (CONSISTENT)	NOT NECESSARY	80.00	-
1	SET FENDER WHEELARCH REAR RH CLIP (SN) (CONSISTENT)	NOT NECESSARY	35.00	-
1	SET FENDER WHEELARCH REAR LH CLIP (SN) (CONSISTENT)	NOT NECESSARY	35.00	-
1	FENDER INNER TRIM CLIP LH (SN) (CONSISTENT)	NOT NECESSARY	28.00	-
1	FENDER INNER TRIM CLIP LH (SN) (CONSISTENT)	NOT NECESSARY	28.00	-
1	TAILLAMP CLIP RH (SN) (CONSISTENT)	NOT NECESSARY	5.00	-
1	TAILLAMP CLIP LH (SN) (CONSISTENT)	NOT NECESSARY	5.00	-
2	REAR WINDSCREEN SEALANT (SN) (CONSISTENT)	NOT NECESSARY	80.00	-
1	WINDSCREEN MOULDING (SN) (CONSISTENT)	NOT NECESSARY	100.00	-
1	REAR WINDSCREEN INNER SPONGE SEAL (SN) (CONSISTENT)	NOT NECESSARY	100.00	-
1	SPARE TYRE RIM (ROUE 7J 16H 2547) (SN) (CONSISTENT)	SERVICEABLE	385.00	-
1	SPARE TYRE (SN) (CONSISTENT)	SERVICEABLE	330.00	-
			2,280.02	765.00
	LABOUR			
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	440.00
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF BUMPER BEAM BRACKET LH REAR, BOOT REAR, BOOT HINGE LH, BOOT HINGE RH, BOOT SWITCH, BOOT LOCK, FENDER PANEL REAR RH, FENDER PANEL REAR LH, TAILLAMP PANEL LH, TAILLAMP PANEL RH, SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL), EXHAUST REAR AND EXHAUST CAP REAR.		6,000.00	600.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	30.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00

Report Ref No. CC3/ASM19004215/Kja3s2

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF BOOTLID FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.		170.00	60.00
	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO SUPPLY AND RE-DO REAR LUAGGGE FLOOR PANEL INSULATION PADDING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF REAR DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
			14,720.00	1,190.00
GRAND TOTAL			48,073.44	5,911.54
RECOMMENDED COST OF REPAIRS				5,911.54

Report Ref No. CC3/ASM19004215/Kja3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.