



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 2942U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b>REPLACEMENT OF PARTS</b>				
1	REAR BUMPER (CONSISTENT)	DEFORMED	530.00	530.00
1	REAR BUMPER RETAINER LH (CONSISTENT)	NECESSARY	60.00	60.00
1	REAR BUMPER RETAINER RH (CONSISTENT)	NECESSARY	60.00	60.00
1	REAR BUMPER CORNER RETAINER RH (CONSISTENT)	NECESSARY	60.00	60.00
1	REAR BUMPER CORNER RETAINER LH (CONSISTENT)	NECESSARY	60.00	60.00
6	REAR BUMPER CLIP (CONSISTENT)	NECESSARY	44.00	44.00
1	REAR BUMPER STAY RH (CONSISTENT) (NPA)	NOT NECESSARY	-	-
1	REAR BUMPER STAY LH (CONSISTENT) (NPA)	NOT NECESSARY	-	-
1	REAR END PANEL (CONSISTENT)	TO REPAIR SEE LABOUR	660.00	-
1	REAR END PANEL TOP GARNISH (CONSISTENT) }	CUT	269.00	269.00
4	REAR END PANEL TOP GARNISH CLIP (CONSISTENT) }		-	-
1	TAILGATE WEATHERSTRIP (CONSISTENT)	TWISTED	355.00	355.00
1	TAILGATE ESTIME EMBLEM (CONSISTENT)	NECESSARY	48.00	48.00
1	REAR LOGO (CONSISTENT)	NECESSARY	48.00	48.00
	LESS 25% DISCOUNT		-548.50	-383.50
			1,645.50	1,150.50
<b>SPECIAL NETT ITEMS</b>				
4	REVERSE SENSOR (CONSISTENT) (SN)	DAMAGED	200.00	200.00
			200.00	200.00
<b>LABOUR</b>				
	TO CUT,WELD ON REAR END PANEL ,REPAIR AFFECTED AREAS,REPLACE DAMAGE PARTS AND REALIGN AFFECTED ARES TO REPAIR TAILGATE.INCLUSIVE OF THE REPAIR OF REAR END PANEL .		1,000.00	200.00
	TO PUTTY ,RESPRAY ON REAR TAILGATE ,BUMPER FENDERS,END PANEL,FLOOR PANEL AND AFFECTED AREAS.		1,000.00	500.00
	TO TUFF KOTE ON REAR AFFECTED AREAS.	NOT NECESSARY	150.00	-
	TO CHECK LIGHTING AND WIRING ,REPLACE REVERSE SENSOR.		80.00	40.00
	TO REMOVE INTERIOR UPHOLSTERY TO ASSIST REPAIR AND REFIT TO REMOVE REAR BACK SEAT TO ASSIST REPAIR AND CHECK FOR DAMAGE (JAMMED).		180.00	60.00
			2,410.00	800.00
<b>GRAND TOTAL</b>			<b>4,255.50</b>	<b>2,150.50</b>



<b>RECOMMENDED COST OF REPAIRS</b>			<b>2,150.50</b>
------------------------------------	--	--	-----------------

Report Ref No. CC6/AXA14021304/Gza3q2

**XING GUO QIANG**

**M.MATAI, AMSAE-A**

**Automotive Assessor**

**HO LEONG CHUAN**

**Automotive Assessor**

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

**No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.**