

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
Assessment number: 002615
Version: 1810
Date calculated: 04/24/2019 03:06 PM

Full Report
Registration: SLR5348C
Printed: 24/04/2019 3:06 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:		Date of Incident:	2019-04-13
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	FORD
Model:	MONDEO (BA7)
Sub Model:	TREND
Model Sheet Number:	02 81 02
Registration:	SLR5348C
VIN number:	WF0DXXGBBD9A31292
Odometer:	

Model Specs

FROM 06/2009	AUTO AIR CON	GREEN TINT WINDOWS	WINDSCREEN W/SENSOR
FRT/RR ELECT WINDOWS	CENTR DOUBLE LOCKING	MIRR EL/FOLD/HEAT/IL	XENON HEADLAMPS
FRONT FOG LAMPS	HEADLAMP WASHERS	CLOTH LEATHER PAD	SPORT SEATS
ELECTRIC LEFT SEAT	LEATHER STRG WHEEL	INT MIRROR AUTODIP	HEIGHT ADJ PASS SEAT
LEATHER GEAR KNOB	LIGHT SWITCHING AUTO	2.3 LTR 118 KW	CRUISE CONTROL
TYRES 215/55 VR 16	WHEELS 6.5J X 16	SPARE WHEEL	AUDIO SYSTEM SONY CD
ESP	WHEEL COVER 16 INCH	4-DOOR	TWO COAT METALLIC
RAD GRILLE CHROMED			

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
Assessment number: 002615
Version: 1810
Date calculated: 04/24/2019 03:06 PM

Full Report
Registration: SLR5348C
Printed: 24/04/2019 3:06 PM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

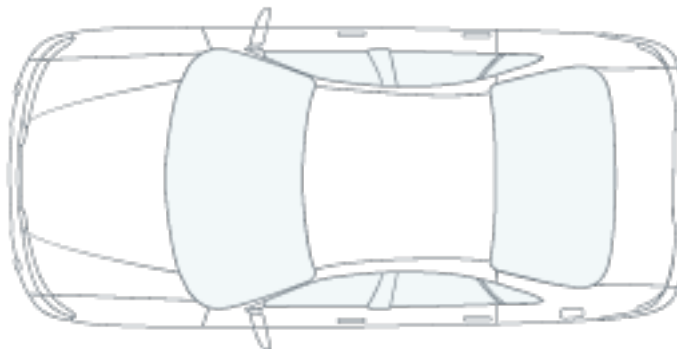

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	ADD/TIME FOR ONE MAIN POSITION		2.0	8.40
43 427 1	R + R FRONT BUMPER INCLUDES: R + R RADIATOR GRILLE AND HEADLAMPS		10.0	42.00
43 427 4	RENEW FRONT BUMPER (REMOVED)		3.0	12.60
43 427 6	ADD/TIME FOR RENEW FRONT BUMPER COVER (VEHICLE WITH HEADLAMP WASHER)		1.0	4.20
NO NUMBER	RENEW L/BUMPER BRACKET		1.0	4.20
32 115 5	RENEW L/HEADLAMP (REMOVED)		1.0	4.20
32 113 1	ADJUST HEADLAMPS		1.0	4.20
44 263 3	R + R FRONT LOCK CARRIER		10.0	42.00
44 274 2	R + R FRONT CROSSMEMBER (BUMPER REMOVED)		8.0	33.60
44 252 2	RENEW L/F WING		7.0	29.40
32 622 1)	R + R SCREEN WASHER BOTTLE		3.0	12.60
1125	L/F APRON EXTENSION REPAIR		30.0*	126.00

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
 Assessment number: 002615
 Version: 1810
 Date calculated: 04/24/2019 03:06 PM

Full Report
 Registration: SLR5348C
 Printed: 24/04/2019 3:06 PM

Code	Description	WU	Price SGD
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	7.70	77.0
	Total of Labour		323.40

Paint

Code	Description - TWO COAT METALLIC	WU	Price SGD
	L/F WING NEW PART PAINTING	10.0	
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	BONNET SURFACE PAINT	12.0	
	R/F WING SURFACE PAINT	6.0	
	L/F APRON EXTENSION SURFACE PAINT	4.0	
	LEFT FRONT DOOR SURFACE PAINT	8.0	

Paint Material Per Part

Code	Description	Price SGD
0741	L/F WING NEW PART PAINTING	21.16
0281	FRONT BUMPER NEW PART PAINT K1R	51.17
0471	BONNET SURFACE PAINT	41.09
0742	R/F WING SURFACE PAINT	10.21
1125	L/F APRON EXTENSION SURFACE PAINT	3.98
1481	LEFT FRONT DOOR SURFACE PAINT	21.66

Labour Cost - Paint	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		51.0	
Preparation Main Work Metal	1.10	11.0	46.20
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	67.0	281.40

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
Assessment number: 002615
Version: 1810
Date calculated: 04/24/2019 03:06 PM

Full Report
Registration: SLR5348C
Printed: 24/04/2019 3:06 PM

Material Cost - Paint	Price SGD
New Part Painting	21.16
New Part Painting - Plastic K1R	51.17
Surface-/Blend Paint	76.94
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	176.37

Spare Parts

				prices as at 2009-01-01
Code	Description	Part Number	Supplier	Price SGD
0281	FRONT BUMPER	7S7117757CAXWAA		950.00
0317	L/F OUT BUMPER BRKT	7S7117E857AF		40.00
0565	LEFT HEADLAMP ASSY	7S7113006BR		830.00
0625	L/HEADLAMP WASH JET	7S7113L015AA		260.00
0637	L/F FOG LAMP	7S7115K202AD		300.00
0741	L/F WING	P7S7116006AB		315.00
0930	FRT LOCK CARRIER	AM218B041AD		490.00
1001	FRT BUMPER C-MEMBER	7S71A10922AJ		0.00
1438	WASHER CONTAINER	6M2113K163AF		185.00
1000	ECU cover	Engine ECU		0.00
1002	Electrical work	Electrical work		20.00

f: OEM Parts	Savings	0.00
n: Non-OEM Parts	Subtotal	3,390.00
u: Used parts	Fixed Sundry Parts Price	100.00
	Total	3,490.00

Extras

Code	Description	Price SGD
1001	ECU diagnostic ECU diagnostic	180.00*
1003	Engine coolant Engine coolant	20.00*
1004	Vacuum & top up AC	50.00*
1005	Wheel alignment Wheel alignment	60.00*
	Total Extras	310.00

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
Assessment number: 002615
Version: 1810
Date calculated: 04/24/2019 03:06 PM

Full Report
Registration: SLR5348C
Printed: 24/04/2019 3:06 PM

Final Calculation

	SGD	SGD
Parts	3,390.00	
Fixed Sundry Parts Price	100.00	
Total Parts		3,490.00
Labour Time Base 10 WU/h		
Total 77.0 WU X 42.00 SGD/h	323.40	
Total of Labour		323.40
Total Of Extras		310.00
Paint Work Time Base 10 WU/h		
Labour Cost 67.0 WU X 42.00 SGD/h	281.40	
Material Cost	176.37	
Total Paint Including Material		457.77
Repair Cost Excludes GST		4,581.17
GST (+7.0%)		320.68
Repair Cost Included GST		4,901.85

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS