

15/2/2011

INS. CASE OWNER:

CC3 / CTI1900 7712

LKK:

IDAC:

Surveyor:

Kenneth

DOI:

ASSIGNMENT

26/4/19

Date / Time:

26/4/19

Registered in Merimen:

Pre-assign / CCU / FTE



Insured Vehicle No.:

SMC 8187Y

Name of Insured:

TAN YONG HE (LIEW YONG HE)

Insured Tel No.:

HP:

Excess Sec II :SS

D.O.A.:

26/4/19

Is driver the owner?

(YES / NO)

Nature of Accident:

Claim No.:

SNM 190201849027(66)

Policy No.:

DMP(SN1875)7(500)

Make / Model:

HOWDA

Place of Accident:

BLD T&H TUCK RD

If NO, Driver Name / Age:

Driver Tel No.:

(V/L: YES / NO)

OI GIA REPORT: YES / NO : TP GIA REPORT: YES / NO

Insured Liability:

% Final ? Yes / No

SHD 81A



INSRS:

WSP:

Tel:

Liability:

RMKS:

Trans
cub.

INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:



INSRS:

WSP:

Tel:

Liability:

RMKS:

Date/ Time

SHD 81A 26/04/19 20/09/19

STAGE

DATE / PIC

Non-Reporting ltr (1st):

Non-Reporting ltr (2nd):

Non-Reporting ltr (Final):

Notification ltr (if non-pickup):

Call OI:

After call ltr to OI: 20/09/19 - vic

Documentation Check List: Handler Typist

Notification ltr (if non-pickup)

After call ltr to OI:

Authorisation To Act:

Release Voucher:

Final Repair Bill:

Car Rental Invoice:

Towing Invoice:

LTA/GIA:

Medical Bill:

PIR:

Mandate/Reject Instruction:

LOD:

Payment Breakdown Form:

Post-Repair Photos:

Others:

20/09/19

ORIGINAL TP LOD IN

TO GET TP VIDEO FOOTAGE

MUE REBUKED. OI REPORTED HE WAS HIT BY TP, TP THEN LOSE CONTROL & HIT ANOTHER VEHICLE. TP REPORTED GET VIDEO FOOTAGE. SEND LETTER TO OI & BUREAU TO NOTIFY TP CLAIM & NCD ISSUES.

BUREAU TO TP REQUEST GUIDANCE.

TP VIDEO IN. VIDEO SHD 81A.

26/09/19

TYPE REPORT FOR WARRANTS APPROVAL

REPORT DONE

SEND WARRANTS APPROVAL TO OI

OI APPROVED WARRANTS. SEND ACCEPTANCE

18/10/19

PRELIMINARY ADVICE Date/Time: 25/10/19 Sent By: BS

FINALIZATION

Date/Time:

Confirm with:

Confirm by:

Repair Cost: P/P S\$ 51,344.15 (24 days) Reduction: 54 %

Email ☐ Call ☐

FINAL SETTLEMENT Date/Time: 20/11/19 Confirm with: SAKWING

Email ☐ Call ☐

Final Liability: % 100 (Assessed) BOLA S/N No.: NIL

If NO or B 28. Ass. Lia:

Repair Cost: (w/loss) S\$ 54,938.24

COI FROM MINOR RATE)

Loss of Rental (LOR): S\$ 2,171.61 (21 days) x \$103.41

3 CARS INVOLVED

Loss of Use (LOU): S\$ - (S x days)

Loss of Income (LOI): S\$ - (S x days)

LOR only ☒ LOU only ☐ LOR + LOU ☐ LOR + LO ☐ [Tick only one]

GLA/LTA Search S\$ 7.49

Medical: S\$ -

Disbursement: S\$ - (e.g. Tow/ Independent)

Legal Cost S\$ -

Total: S\$ 57,117.34 Global Sum S\$: -

1) Claim status: Normal/Reject/Private Settle

2) Report Format:

3) Survey fee: \$400.00

FINAL PAYMENT Date/Time: Confirm with: Email ☐ Call ☐

Payee 1: S\$ 57,117.34 Name 1: TRANS-ORB AUTO SERVICES PTE LTD

Payee 2: (Strike if N.A.) S\$ - Name 2: -

Payee 3: (Strike if N.A.) S\$ - Name 3: -

ASS. REC. BY:

REF: 0721

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

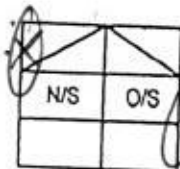

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

24

days

Res.: Yes or No

Lum Sum:

1. B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

S140 SIA

Yr Regn:

07.17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or

Make:

Renault Latitude

c.c

1985

Colour:

M. White / Red

A/C:

Insured / Std / NI / NA

Sp. Reading

188029

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

VIFIABL 15AUC 283395

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

215/60R16

R:

BS / DUN / EXNOVA / GYFS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or

Giti

Front

Rear

R/Bal.

9

mm

R/Bal.

7

mm

L/Bal.

9

mm

L/Bal.

7

mm

D.O.A.

23/4/11P

D.O.I.

24/4/19

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S Rear & N/S Frt

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 File pass to

P/B 451,344.15

CWB: 460,514.65 (54.1%)

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S - RS. SI

Photos

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your ref: To Be Advised
Our ref: CC3/CTI19007312/Kjb3

Date: 25.04.2019

The Motor Claims Department
M/s CHINA TAIPING INSURANCE (S) PTE LTD

Dear Sir/Madam,

PRELIMINARY ADVICE OF VEHICLE NO.

SHD81A


We refer to the above matter.

Please be informed that we had conducted the inspection of the above mentioned vehicle on 24.04.2019 at the premises of M/s Trans-cab Auto Services Pte Ltd and have the following to report:-

Workshop Estimate Amount	: S\$	111,858.80
Revised Estimate Amount	: S\$	51,344.15
"Check" Items Amount	: S\$	15,897.94
Market Value	: S\$	-
LTA Reimbursement Value	: S\$	-
Nett Value	: S\$	-

Description of Damage:

 The vehicle sustained damages at the
O/S Rear Portion & N/S Front Portion



Comments/Present Status:

Damages Consistent

Estimated normal period for repairs: 24 days

Yours faithfully,

KENNETH KONG
Licensed Appraiser

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 81A

AAD1904-224

*Not Authored
Resony B4 paint*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

Date of Registration :

SHD 81A

VF1ABL15AUC283395

RENAULT

LATITUDE

23.4.2019

CHINA TAIPING

24/7/2017

PART**LIST**

1	1	BUMPER COVER FRT
2	1	BUMPER SPOILER FRT
3	1	BUMPER ABSORBER FRT
4	1	BUMPER RETAINER FRT LH
5	1	BUMPER SUPPORT FRT
6	1	BUMPER RETAINER FRT RH
7	1	BUMPER SUPPORT FRT
8	1	BUMPER UNDERTRAY FRT
9	1	BUMPER GRILLE LOWER FRT
10	1	BUMPER FOG LAMP GRILLE LH
11	1	BUMPER FOG LAMP GRILLE RH
12	1	BUMPER BEAM FRT
13	1	TOW COVER FRT
14	1	RADIATOR GRILLE
15	1	RADIATOR GRILLE BADGE 'RENAULT'
16	1	RADIATOR GRILLE FRAME
17	1	FRAME FULL SUPPORT PANEL
18	1	FRAME FULL SUPPORT BRACKET
19	1	FRONT BRACE PANEL
20	1	HORN
21	1	HORN BRACKET
22	1	HEADLAMP LH
22	1	HEADLAMP HARNESS
22	1	HEADLAMP RH
22	1	HEADLAMP HARNESS
22	1	HEADLAMP PANEL FRT LH
25	1	HEADLAMP PANEL FRT RH
26	1	BONNET

\$	<i>BA/CM</i>	1,259.42	✓
\$	<i>Sm</i>	181.75	X
\$	<i>CM</i>	394.68	✓
\$	<i>CM</i>	151.41	✓
\$	<i>Sm</i>	123.88	X
\$	<i>Sm</i>	150.77	X
\$	<i>Sm</i>	123.88	X
\$	<i>CM</i>	472.83	✓
\$	<i>Sm</i>	266.80	X
\$	<i>Mr</i>	207.21	✓
\$	<i>Sm</i>	207.21	X
\$	<i>R</i>	914.08	✓
\$	<i>Sm</i>	28.61	X
\$	<i>Sm</i>	1,707.78	X
\$	<i>Sm</i>	225.36	X
\$	<i>CM</i>	1,353.75	✓
\$	<i>CM</i>	615.90	✓
\$	<i>R</i>	89.79	X
\$	<i>R</i>	177.22	X
\$	<i>Sm</i>	314.17	X
\$	<i>R</i>	40.45	X
\$	<i>R</i>	1,184.43	✓
\$	<i>BRO</i>	928.29	✓
\$	<i>MB CM</i>	1,184.43	✓
\$	<i>Sm</i>	928.29	X
\$	<i>Mr</i>	152.15	✓
\$	<i>R</i>	152.15	X
\$	<i>R</i>	1,941.63	✓

Trans-cab Auto Services Pte Ltd**AAD1904-224**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 81A

27	1	BONNET INSULATOR	\$	SL	405.73	X
28	1	BONNET STRUT LH	\$	SL	88.61	X
29	1	BONNET STRUT RH	\$	SL	88.61	X
30	1	BONNET HINGE LH	\$	BZ	348.31	✓
31	1	BONNET HINGE RH	\$	DIT	348.31	✓
32	1	BONNET LOCK	\$	R	305.48	X
33	1	BONNET CABLE	\$	SL	119.19	X
34	1	BONNET CABLE COVER	\$	SL	161.03	X
35	1	BONNET SEAL OUTER	\$	SL	92.36	X
36	1	BONNET SEAL INNER	\$	SL	157.28	X
37	1	FENDER PANEL FRT LH	\$	BZ	783.83	✓
38	1	WHEELARCH FRT LH	\$	CM	278.84	✓
39	1	FENDER BRACKET LOWER LH	\$	DIT	15.79	✓
40	1	FENDER INSULATOR LH	\$	SL	130.84	X
41	1	FENDER PANEL INNER FRT RH L70Y	\$	BZ	1,654.50	✓
42	1	FENDER PANEL SUPPORT FRT RH L70Y	\$	QVC	1,095.24	?X
43	1	FENDER PANEL BRACKET FRT RH L70Y	\$	QVC	209.97	?X
44	1	FENDER PANEL BRACKET FRT RH L70Y	\$	QVC	143.27	?X
45	1	WHEEL HOUSING PANEL FRT RH L70Y	\$	QVC	4,682.09	?X
46	1	WIPER RESERVOIR	\$	SL	348.25	X
47	1	WIPER RESERVOIR NECK	\$	SL	136.11	X
48	1	WIPER RESERVOIR MOTOR	\$	SL	270.06	X
49	1	AIR CLEANER LOWER	\$	SL	271.26	X
50	1	AIR CLEANER HOSE	\$	SL	76.14	X
51	1	AIR CLEANER BOX	\$	QVC	464.20	?X
52	1	TURBO DUCT	\$	QVC	1,027.80	?X
53	1	A/C HEATER VALVE	\$	QVC	484.50	?X
54	1	SUBFRAME OUTER FRT	\$	BZ	2,652.45	✓
55	1	SUBFRAME BRACKET OUTER LH	\$	DIT	92.36	✓
56	1	SUBFRAME BRACKET OUTER RH	\$	SL	92.36	✓
57	1	ENGINE UNDERTRAY	\$	QVC	564.98	?X
58	1	A/C CONDENSER	\$	SL	2,020.37	} X
59	1	A/C CONDENSER GARNISH LH UPPER	\$	SL	39.67	
60	1	A/C CONDENSER GARNISH RH UPPER	\$	SL	39.67	
61	1	A/C CONDENSER GARNISH LH	\$	SL	58.81	
62	1	A/C CONDENSER GARNISH RH	\$	SL	59.60	
63	1	A/C PIPE CONDENSER TO COMPRESSOR	\$	SL	208.39	} X
64	1	A/C PIPE CONDENSER TO EXPENSION VALVE	\$	SL	658.72	

Trans-cab Auto Services Pte Ltd

AAD1904-224

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 81A

74	1	A/C PIPE COMPRESSOR	\$	334.29	
75	1	A/C PIPE	\$	658.72	
76	1	A/C COMPRESSOR	\$	2,684.61	
77	1	AIR COOLER	\$	792.60	
78	1	AIR INTERCOOLER HOSE (LONG)	\$	1,014.13	
79	1	AIR INTERCOOLER HOSE (Short)	\$	375.14	
80	1	TRANSMISSION COOLER	\$	1,219.30	
81	1	TRANSMISSION COOLER PAD	\$	17.96	
82	1	RADIATOR	\$	1,202.20	
83	2	RADIATOR STUD UPPER	\$	14.41	
84	2	RADIATOR BUSH UPPER	\$	50.12	
85	2	RADIATOR MTG LOWER	\$	55.85	
86	1	RADIATOR FAN COWLING	\$	820.54	
87	1	RADIATOR FAN MOTOR LH	\$	967.36	
88	1	RADIATOR FAN MOTOR RH	\$	1,479.46	
89	1	RADIATOR TANK	\$	324.62	
90	1	RADIATOR HOSE UPPER	\$	240.56	
91	1	RADIATOR HOSE LOWER	\$	491.18	
92	1	RADIATOR TANK HOSE	\$	61.18	
93	1	AUTO COMPUTER	\$	5,032.17	✓
94	1	INJECTION COMPUTER	\$	4,706.30	✓
95	1	RHD HYDRAULIC POWER(ROCK&PINION)	\$	5,154.52	✓
96	1	STEERING PUMP ELECTRIC	\$	2,306.90	✓
97	1	STEERING PINION RACK	\$	4,413.11	X
98	1	SEATBELT LH L70Y	\$	2,937.80	✓
99	1	SEATBELT RH L70Y	\$	2,925.37	✓
100	1	SEATBELT BUCKLE LH L70Y	\$	984.13	7X
101	1	SEATBELT BUCKLE RH L70Y	\$	949.80	7X
102	1	PASSENGER AIRBAG L70Y	\$	3,412.40	✓
103	1	STEERING AIRBAG L70Y	\$	2,525.75	✓
104	1	AIRBAG COMPUTER L70Y	\$	1,259.82	✓
105	1	AIRBAG SENSOR L70Y	\$	724.63	✓
106	1	AIRBAG SENSOR L70Y	\$	289.30	✓
107	1	DASHBOARD L70Y	\$	4,900.54	✓
108	1	WINDSCREEN FRT L70Y	\$	1,364.06	✓
109	1	AIRBAG COMPUTER L70Y	\$	1,259.82	X
110	1	AIRBAG SENSOR L70Y	\$	724.63	X
111	1	AIRBAG SENSOR L70Y	\$	289.30	X

Trans-cab Auto Services Pte Ltd

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

AAD1904-224

SHD 81A

112	1	LOWER ARM LH	\$	B	685.76	—
113	1	KUNCKLE ARM LH	\$	B	846.98	—
114	1	ABSORBER FRT LH	\$	B	360.54	—
115	1	STABILIZER BAR FRT	\$	WC	604.65	?X
116	1	DRIVESHAFT LH	\$	WC	1,747.45	?X
117	1	LOWER ARM LH L70Y	\$	WC	685.76	X
118	1	KUNCKLE ARM LH L70Y	\$	WC	846.98	X
119	1	ABSORBER FRT LH L70Y	\$	WC	360.54	X

TOTAL	\$	101,256.53
10%	\$	10,125.65
	\$	91,130.88

Specical Nett

1	1SET	RADIATOR GRILLE FRAME CLIP	\$	nn	52.00	X
2	1SET	BUMPER CLIP FRT	\$	nn	66.00	—
3	1	BUMPER BRACKET CLIP FRT LH	\$	nn	12.00	X
4	1	BUMPER SUPPORT CLIP FRT LH	\$	nn	10.50	
5	1	BUMPER BRACKET CLIP FRT RH	\$	nn	12.00	
6	1	BUMPER SUPPORT CLIP FRT RH	\$	nn	10.50	
7	1	TOW COVER FRT	\$	nn	14.50	
8	1SET	RADAIOR GRILLE SCREW	\$	nn	16.00	X
9	1SET	BUMPER GRILLE LOWER CLIP	\$	nn	69.00	
10	1SET	FRAME FULL SUPPORT PANEL CLIP	\$	nn	70.00	
11	2	FRAME FULL SUPPORT PANEL NUT	\$	nn	20.00	
12	2	FRAME FULL SUPPORT PANEL STUD	\$	nn	30.00	X
21	1	Windscreen moulding	\$	nn	100.00	
22	1SET	Front licence plate with holder	\$	nn	80.00	
23	1	DOOR CHECK BOLT	\$	nn	22.69	
24	1	DOOR GUIDE SCREW	\$	nn	10.85	X
25	1	DOOR HINGE BOLT	\$	nn	10.85	
26	1	DOOR HINGE NUT RH	\$	nn	14.60	
27	1	DOOR CHECK BOLT	\$	nn	22.69	
28	1	DOOR CHECK NUT	\$	nn	3.75	X
29	1	DOOR LOCK SCREW L70Y	\$	nn	6.12	

Trans-cab Auto Services Pte Ltd

AAD1904-224

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 81A

30	1	DOOR CATCH SCREW L70Y	\$	Sn	10.06
31	1	WINDSCREEN SEALANT	\$	Nu	253.80 405m
32	1	FRONT LEFT TYRE	\$	Ar	300.00 802m 200
33	1	FRONT LEFT TYRE RIM	\$	B	380.00

TOTAL	\$	1,597.93
--------------	-----------	-----------------

TOTAL PARTS	\$	92,728.80
--------------------	-----------	------------------

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same	\$	1200 6,000.00
Towing Fees.	\$	120.00 500
To apply paint protection system (PPS) maintain and enhancement	\$	nu 380.00 X
Putty and spray painting of the affected portion.	\$	6,000.00 13200
To rust-proofing of the affected areas.	\$	170.00 1200
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	nu 380.00 X
To check steering geometry and computer wheel alignment	\$	220.00 600
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	380.00
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	380.00 } 2500
To lift-up engine with gear box and refit.	\$	440.00 2800

Trans-cab Auto Services Pte Ltd**AAD1904-224**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 81A

To remove and renew power steering pump, oil cooler pipe and final checking and testing.	\$	440.00 100%
To remove and refit air bag system and reset.	\$	480.00 220%
To drop diesel tank, pipes, hoses to facilitate bodywork repair, final checking and testing.	\$	na 380.00 X
To vacuum, replace, refix and recharge air condenser	\$	380.00 100%
To replace, refix and top up coolant for radiator	\$	170.00 50%
To vacuum, replace, refix and recharge Air Intercooler	\$	170.00 50%
To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.	\$	na 170.00 X
To Transfer Of Door Fittings, Attachments And Perform Water Seepage Test.	\$	na 170.00 X
To Remove And Refit Front W/Screen Glass To Facilitate Bodywork Repair.	\$	170.00 120%
To remove and renew engine and gear box mounting.	\$	na 380.00 X
To dismantle and refit engine cross-member and engine mounting.	\$	na 380.00 X
To remove and renew power steering pump, oil cooler pipe and final checking and testing.	\$	na 440.00 X
To check ABS brake efficiency, final checking and testing.	\$	na 380.00 X

Trans-cab Auto Services Pte Ltd**AAD1904-224**

No. 2 Ang Mo Kio Street 63 Singapore 569111

Tel No. : 6287 6666 Fax No. : 6257 1330

CO./GST Reg. No. 201019626G

SHD 81A

To remove and refit ABS pump relay to enable repair. \$ *nn* 380.00 *X*

To transfer of tire, rim and on wheel balancing. \$ 170.00 *201*

TOTAL \$ 19,130.00

Over All Total \$ 111,858.80

Repair Days (Lump Sum)**30-DAYS***24 days*

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Company

Owner ID: 3878K

Vehicle Details

Vehicle No.: SHD81A

Vehicle to be Exported: Yes

Intended Deregistration Date: 23 Apr 2019

Vehicle Make: RENAULT

Vehicle Model: LATITUDE 2.0L DCI AUTO D/AB 4DR

Primary Colour: Red

Manufacturing Year: 2016

Engine No.: M9R8839C003114

Chassis No.: VF1ABL15AUC283395

Maximum Power Output: 127.0 kW (170 bhp)

Open Market Value: \$19,998.00

Original Registration Date: 24 Jul 2017

First Registration Date: 24 Jul 2017

Transfer Count: 0

Actual ARF Paid: \$19,998.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 23 Jul 2025

PARF Rebate Amount: \$14,998.00

Intended COE Rebate Details

COE Expiry Date: 23 Jul 2025

COE Category: A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years): 8

PQP Paid: \$38,560.00

COE Rebate Amount: \$30,125.00

Total Rebate Amount: \$45,123.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 23 Apr 2019

OK



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC3/CTI19007312/Khb3s2

3 ANSON ROAD #16-00

SPRINGLEAF TOWERS SINGAPORE 079909

Date : 04-12-2019

Code : CTI



1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SMC 8187Y	Veh. Inspected	SHD 81A
Policy No.	DMPCSN1823271800	Coverage (\$)	0.00
Claim No.	SNM19D201849C02/7(bt)	Excess (\$)	0.00
Assign From		Assign Date	24/04/2019

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	VF1ABL15AUC283395	Colour	METALLIC WHITE / RED
Odometer	188029	Steering	JAMMED
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	GITI	9 mm
L/H Front Tyre	215/60 R16	GITI	9 mm
R/H Rear Tyre	215/60 R16	GITI	7 mm
L/H Rear Tyre	215/60 R16	GITI	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION AND N/S FRONT PORTION. THE UNDERCARRIAGE AND BODY STRUCTURE AFFECTED DUE TO COLLISION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	23/04/2019	Inspection Date	24/04/2019
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 24 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 81A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BUMPER COVER FRT	BENT / CRACKED	1,259.42	1,259.42
1	BUMPER SPOILER FRT	SERVICEABLE	181.75	-
1	BUMPER ABSORBER FRT	CRACKED	394.68	394.68
1	BUMPER RETAINER FRT LH	CRACKED	151.41	151.41
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER RETAINER FRT RH	SERVICEABLE	150.77	-
1	BUMPER SUPPORT FRT	SERVICEABLE	123.88	-
1	BUMPER UNDERTRAY FRT	CRACKED	472.83	472.83
1	BUMPER GRILLE LOWER FRT	SERVICEABLE	266.80	-
1	BUMPER FOG LAMP GRILLE LH	MISSING	207.21	207.21
1	BUMPER FOG LAMP GRILLE RH	SERVICEABLE	207.21	-
1	BUMPER BEAM FRT	BENT	914.08	914.08
1	TOW COVER FRT	SERVICEABLE	28.61	-
1	RADIATOR GRILLE	SERVICEABLE	1,707.78	-
1	RADIATOR GRILLE BADGE 'RENAULT'	SERVICEABLE	225.36	-
1	RADIATOR GRILLE FRAME	CRACKED	1,353.75	1,353.75
1	FRAME FULL SUPPORT PANEL	CRACKED	615.90	615.90
1	FRAME FULL SUPPORT BRACKET	TO REPAIR SEE LABOUR	89.79	-
1	FRONT BRACE PANEL	TO REPAIR SEE LABOUR	177.22	-
1	HORN	SERVICEABLE	314.17	-
1	HORN BRACKET	TO REPAIR SEE LABOUR	40.45	-
1	HEADLAMP LH	BROKEN	1,184.43	1,184.43
1	HEADLAMP HARNESS	BROKEN	928.29	928.29
1	HEADLAMP RH	MTG CRACKED	1,184.43	1,184.43
1	HEADLAMP HARNESS	SERVICEABLE	928.29	-
1	HEADLAMP PANEL FRT LH	DISTORTED	152.15	152.15
1	HEADLAMP PANEL FRT RH	TO REPAIR SEE LABOUR	152.15	-
1	BONNET	BENT	1,941.63	1,941.63

Report Ref No. CC3/CTI19007312/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET INSULATOR	SERVICEABLE	405.73	-
1	BONNET STRUT LH	SERVICEABLE	88.61	-
1	BONNET STRUT RH	SERVICEABLE	88.61	-
1	BONNET HINGE LH	BENT	348.31	348.31
1	BONNET HINGE RH	DISTORTED	348.31	348.31
1	BONNET LOCK	TO REPAIR SEE LABOUR	305.48	-
1	BONNET CABLE	SERVICEABLE	119.19	-
1	BONNET CABLE COVER	SERVICEABLE	161.03	-
1	BONNET SEAL OUTER	SERVICEABLE	92.36	-
1	BONNET SEAL INNER	SERVICEABLE	157.28	-
1	FENDER PANEL FRT LH	BENT	783.83	783.83
1	WHEELARCH FRT LH	CRACKED	278.84	278.84
1	FENDER BRACKET LOWER LH	DISTORTED	15.79	15.79
1	FENDER INSULATOR LH	SERVICEABLE	130.84	-
1	FENDER PANEL INNER FRT RH L70Y	BENT	1,654.50	1,654.50
1	FENDER PANEL SUPPORT FRT RH L70Y	SERVICEABLE	1,095.24	-
1	FENDER PANEL BRACKET FRT RH L70Y	SERVICEABLE	209.97	-
1	FENDER PANEL BRACKET FRT RH L70Y	SERVICEABLE	143.27	-
1	WHEEL HOUSING PANEL FRT RH L70Y	SERVICEABLE	4,682.09	-
1	WIPER RESERVOIR	SERVICEABLE	348.25	-
1	WIPER RESERVOIR NECK	SERVICEABLE	136.11	-
1	WIPER RESERVOIR MOTOR	SERVICEABLE	270.06	-
1	AIR CLEANER LOWER	SERVICEABLE	271.26	-
1	AIR CLEANER HOSE	SERVICEABLE	76.14	-
1	AIR CLEANER BOX	SERVICEABLE	464.20	-
1	TURBO DUCT	SERVICEABLE	1,027.80	-
1	A/C HEATER VALVE	SERVICEABLE	484.50	-
1	SUBFRAME OUTER FRT	BENT	2,652.45	2,652.45
1	SUBFRAME BRACKET OUTER LH	DISTORTED	92.36	92.36
1	SUBFRAME BRACKET OUTER RH	DENTED	92.36	92.36
1	ENGINE UNDERTRAY	SERVICEABLE	564.98	-
1	A/C CONDENSER	SERVICEABLE	2,020.37	-

Report Ref No. CC3/CT119007312/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	A/C CONDENSER GARNISH LH UPPER	SERVICEABLE	39.67	-
1	A/C CONDENSER GARNISH RH UPPER	SERVICEABLE	39.67	-
1	A/C CONDENSER GARNISH LH	SERVICEABLE	58.81	-
1	A/C CONDENSER GARNISH RH	SERVICEABLE	59.60	-
1	A/C PIPE CONDENSER TO COMPRESSOR	SERVICEABLE	208.39	-
1	A/C PIPE CONDENSER TO EXPANSION VALVE	SERVICEABLE	658.72	-
1	A/C PIPE COMPRESSOR	SERVICEABLE	334.29	-
1	A/C PIPE	SERVICEABLE	658.72	-
1	A/C COMPRESSOR	SERVICEABLE	2,684.61	-
1	AIR COOLER	SERVICEABLE	792.60	-
1	AIR INTERCOOLER HOSE (LONG)	SERVICEABLE	1,014.13	-
1	AIR INTERCOOLER HOSE (SHORT)	SERVICEABLE	375.14	-
1	TRANSMISSION COOLER	SERVICEABLE	1,219.30	-
1	TRANSMISSION COOLER PAD	SERVICEABLE	17.96	-
1	RADIATOR	SERVICEABLE	1,202.20	-
2	RADIATOR STUD UPPER	SERVICEABLE	14.41	-
2	RADIATOR BUSH UPPER	SERVICEABLE	50.12	-
2	RADIATOR MTG LOWER	SERVICEABLE	55.85	-
1	RADIATOR FAN COWLING	SERVICEABLE	820.54	-
1	RADIATOR FAN MOTOR LH	SERVICEABLE	967.36	-
1	RADIATOR FAN MOTOR RH	SERVICEABLE	1,479.46	-
1	RADIATOR TANK	SERVICEABLE	324.62	-
1	RADIATOR HOSE UPPER	SERVICEABLE	240.56	-
1	RADIATOR HOSE LOWER	SERVICEABLE	491.18	-
1	RADIATOR TANK HOSE	SERVICEABLE	61.18	-
1	AUTO COMPUTER	CRACKED	5,032.17	5,032.17
1	INJECTION COMPUTER	NOT NECESSARY	4,706.30	-
1	RHD HYDRAULIC POWER (RACK & PINION)	BENT / JAMMED	5,154.52	5,154.52
1	STEERING PUMP ELECTRIC	BENT	2,306.90	2,306.90
1	STEERING PINION RACK	NO SUCH PARTS	4,413.11	-
1	SEATBELT LH L70Y	JAMMED	2,937.80	2,937.80
1	SEATBELT RH L70Y	JAMMED	2,925.37	2,925.37
1	SEATBELT BUCKLE LH L70Y	SERVICEABLE	984.13	-

Report Ref No. CC3/CT119007312/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No. 4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	SEATBELT BUCKLE RH L70Y	SERVICEABLE	949.80	-
1	PASSENGER AIRBAG L70Y	BURST	3,412.40	3,412.40
1	STEERING AIRBAG L70Y	BURST	2,525.75	2,525.75
1	AIRBAG COMPUTER L70Y	BURST	1,259.82	1,259.82
1	AIRBAG SENSOR L70Y	BURST	724.63	724.63
1	AIRBAG SENSOR L70Y	BURST	289.30	289.30
1	DASHBOARD L70Y	TORN	4,900.54	4,900.54
1	WINDSCREEN FRT L70Y	CRACKED	1,364.06	1,364.06
1	AIRBAG COMPUTER L70Y	REPEATED	1,259.82	-
1	AIRBAG SENSOR L70Y	REPEATED	724.63	-
1	AIRBAG SENSOR L70Y	REPEATED	289.30	-
1	LOWER ARM LH	BENT	685.76	685.76
1	KNUCKLE ARM LH	BENT	846.98	846.98
1	ABSORBER FRT LH	BENT	360.54	360.54
1	STABILIZER BAR FRT	SERVICEABLE	604.65	-
1	DRIVESHAFT LH	SERVICEABLE	1,747.45	-
1	LOWER ARM LH L70Y	REPEATED	685.76	-
1	KNUCKLE ARM LH L70Y	REPEATED	846.98	-
1	ABSORBER FRT LH L70Y	REPEATED	360.54	-
	LESS 10% DISCOUNT		-10,125.65	-5,175.35
			91,130.89	46,578.15
	SPECIAL NETT ITEMS			
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NOT NECESSARY	52.00	-
1	SET BUMPER CLIP FRT (SN)	NECESSARY	66.00	66.00
1	BUMPER BRACKET CLIP FRT LH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT LH (SN)	NOT NECESSARY	10.50	-
1	BUMPER BRACKET CLIP FRT RH (SN)	NOT NECESSARY	12.00	-
1	BUMPER SUPPORT CLIP FRT RH (SN)	NOT NECESSARY	10.50	-
1	TOW COVER FRT (SN)	SERVICEABLE	14.50	-
1	SET RADIATOR GRILLE SCREW (SN)	NOT NECESSARY	16.00	-
1	SET BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	20.00	-

Report Ref No. CC3/CTI19007312/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	30.00	-
1	WINDSCREEN MOULDING (SN)	NECESSARY	100.00	100.00
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	80.00	-
1	DOOR CHECK BOLT (SN)	SERVICEABLE	22.69	-
1	DOOR GUIDE SCREW (SN)	SERVICEABLE	10.85	-
1	DOOR HINGE BOLT (SN)	SERVICEABLE	10.85	-
1	DOOR HINGE NUT RH (SN)	SERVICEABLE	14.60	-
1	DOOR CHECK BOLT (SN)	SERVICEABLE	22.69	-
1	DOOR CHECK NUT (SN)	SERVICEABLE	3.75	-
1	DOOR LOCK SCREW L70Y (SN)	SERVICEABLE	6.12	-
1	DOOR CATCH SCREW L70Y (SN)	SERVICEABLE	10.06	-
1	WINDSCREEN SEALANT (SN)	NECESSARY	253.80	40.00
1	FRONT LEFT TYRE (@ \$300.00 DISC 80%) (SN)	CUT	300.00	240.00
1	FRONT LEFT TYRE RIM (SN)	BENT	380.00	380.00
			1,597.91	826.00
	LABOUR			
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF FRAME FULL SUPPORT BRACKET, FRONT BRACE PANEL, HORN BRACKET, HEADLAMP PANEL FRT RH AND BONNET LOCK.		6,000.00	1,200.00
	TOWING FEES.		120.00	50.00
	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT.	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	1,320.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	120.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRUALIC PNEUMATIC JACK. }		380.00	250.00
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR. }		380.00	-

Report Ref No. CC3/CTI19007312/Khb3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO LIFT-UP ENGINE WITH GEAR BOX AND REFIT.		440.00	280.00
	TO REMOVE AND RENEW POWER STEERING PUMP, OIL COOLER PIPE AND FINAL CHECKING AND TESTING.		440.00	100.00
	TO REMOVE AND REFIT AIR BAG SYSTEM AND RESET.		480.00	220.00
	TO DROP DIESEL TANK, PIPES, HOSES TO FACILITATE BODYWORK REPAIR, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR CONDENSER.		380.00	100.00
	TO REPLACE, REFIX AND TOP UP COOLANT FOR RADIATOR.		170.00	50.00
	TO VACUUM, REPLACE, REFIX AND RECHARGE AIR INTERCOOLER.		170.00	50.00
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF DOOR FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REMOVE AND REFIT FRONT W/SCREEN GLASS TO FACILITATE BODYWORK REPAIR.		170.00	120.00
	TO REMOVE AND RENEW ENGINE AND GEAR BOX MOUNTING.	NOT NECESSARY	380.00	-
	TO DISMANTLE AND REFIT ENGINE CROSS-MEMBER AND ENGINE MOUNTING.	NOT NECESSARY	380.00	-
	TO REMOVE AND RENEW POWER STEERING PUMP, OIL COOLER PIPR AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO CHECK ABS BRAKE EFFICIENCY, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO REMOVE AND REFIT ABS PUMP RELAY TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.		170.00	20.00
			19,130.00	3,940.00
	GRAND TOTAL		111,858.80	51,344.15
RECOMMENDED COST OF REPAIRS				51,344.15

Report Ref No. CC3/CTI19007312/Khb3s2

KSC

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.