

INS. CASE OWNER: **BONNIE** | **CC6** /AIG1900 **7484, A 23** | LKK: **ADIAN** | IDAC:

Supervisor: **Adian** | DOI: **ASSIGNMENT 2014/19** | Date / Time: **2014/19**
 Registered in Merimen: **2014/19**

Pre-assign / CCU / FTE

Insured Vehicle No.: **SJV 4943T** | Claim No.: **517966589754**
 Name of Insured: **UM SM HANG JOANNE** | Policy No.: **700186753**
 Insured Tel No.: _____ | HP: _____ | Make / Model: **TOYOTA**
 Excess Sec II :SS _____ | D.O.A: **22/3/19** | Place of Accident: **PIE**
 Is driver the owner? (YES / NO) _____ | Nature of Accident: _____
 If NO. Driver Name / Age: **PHUA HENG SWEE MARIELE** | OI GIA REPORT: YES / NO _____ | TP GIA REPORT: YES / NO _____
 Driver Tel No.: _____ | (V/L: YES / NO) _____ | Insured Liability: % _____ | Final ? Yes / No _____

SLL 65712

INSRS: WSP: Tel: Liability: RMKS: **man men**

INSRS: WSP: Tel: Liability: RMKS:

INSRS: WSP: Tel: Liability: RMKS:

INSRS: WSP: Tel: Liability: RMKS:

Date/Time	STAGE	DATE / PIC
	Non-Reporting Itr (1st)	
	Non-Reporting Itr (2nd)	
	Non-Reporting Itr (Final)	
	Notification Itr (if non-pickup)	
	Call OI	
	After call Itr to OI	20/10/19-UC
	Documentation Check List:	Handler Typist
	Notification Itr (if non-pickup)	<input checked="" type="checkbox"/>
	After call Itr to OI	<input checked="" type="checkbox"/>
	Authorisation To Act	<input checked="" type="checkbox"/>
	Release Voucher:	<input checked="" type="checkbox"/>
	Final Repair Bill:	<input checked="" type="checkbox"/>
	Car Rental Invoice:	<input checked="" type="checkbox"/>
	Towing Invoice:	<input type="checkbox"/>
	LTA / GIA	<input checked="" type="checkbox"/>
	Medical Bill:	<input type="checkbox"/>
	PIR:	<input type="checkbox"/>
	Mandate/Reject Instruction:	<input checked="" type="checkbox"/>
	LOD	<input checked="" type="checkbox"/>
	Payment Breakdown Form:	<input type="checkbox"/>
	Post-Repair Photos:	<input type="checkbox"/>
	Others:	<input type="checkbox"/>

PRELIMINARY ADVICE Date/Time: **20/10/19** Sent By: **WANGKAT**

FINALIZATION Date/Time: _____ Confirm with: _____ Confirm by: _____
 Repair Cost: **40** \$S **9,700.00** (**10** days) Reduction: **53** % Email: Call:

FINAL SETTLEMENT Date/Time: **03/02/20** Confirm with: **SING** Email: Call:
 Final Liability: % **100** (Assessed / Assessed) BOLA S/N No.: **21**
 Repair Cost: \$S **9,700.00**
 Loss of Rental (LOR): \$S **1,350.00** (**9** days) X **150.00**
 Loss of Use (LOU): \$S **-** (**5** days)
 Loss of Income (LOI): \$S **-** (**5** days)

LOR only LOU only LOR + LOU LOR + LOI [Tick only one]
 CHA/LTA Search: \$S **7.49**
 Medical: \$S **-**
 Disbursement: \$S **-** (e.g. Tow/Independent)
 Legal Cost: \$S **-**

Total: \$S **11,057.49** Global Sum \$S: **11,050.00**
 If NO or B 25. Ass. Lia: **COI LOST CONTROL**
COPY SENT 6/2/2020

1) Claim status: **Normal** / Reject / Private Settle
 2) Report Format: _____
 3) Survey fee: **\$320.00**

FINAL PAYMENT Date/Time: _____ Confirm with: _____ Email: Call:
 Payer 1: \$S **11,050.00** Name 1: **HUK HENG SPRAY PRINTING WORKSHOP**

Payer 2: (Strike if N.A.) \$S **-** Name 2: **-**
 Payer 3: (Strike if N.A.) \$S **-** Name 3: **-**

ASS. REC. BY:

REF:

Adrian

ASSIGNMENT

Front: _____ Date: _____
 Estimated Cost: _____
OO / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

Veh No: SLL65712 Yr Regn: 2017, March
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Hyundai Tucson c.c. 1999
 Colour: Grey A/C: Insured / Std / NI / NA
 Sp. Reading: 77574 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: KMHJ3813MH4.3481A
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or _____
 Brake: In order / Jammed / Leaked / Burnt or _____
 Mod: Nil / SRim / STD A/Rim or _____
 Tyre Size: F: 225/55R18
 R: 225/55R18
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Kumho

N/S	O/S

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 10 days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No

<u>Front</u>	<u>Rear</u>
R/Bal. <u>06</u> mm	R/Bal. <u>06</u> mm
L/Bal. <u>06</u> mm	L/Bal. <u>06</u> mm
D.O.A. _____	D.O.I. <u>26/04/19</u>

CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Survey held at Hua Meng
 Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or _____
 The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	<u>TP ALG.</u>
	<u>REPINALISED @ 30% UG</u>
	<u>L/G \$11,000.00 \$9,700.00</u>
	<u>CRSD: \$9,702.20 (46%) CRSD: \$11,002.20 (53%)</u>
	<u>MV:</u>
	<u>PV:</u>
	<u>Nett:</u>

Date/Time, File Pass to?	Date/Time, File Return to?	Part Prices Check:		Survey Fee:	Date:					
1)	2)	IN	OUT	Basic & Add.	<table border="1"> <tr><td> </td></tr> <tr><td> </td></tr> <tr><td> </td></tr> <tr><td> </td></tr> <tr><td> </td></tr> </table>					
3)	4)			___ S + RS, ___ SI						
5)	6)			Photos						
Preli. Report:				Others						
Final Report:				TOTAL						

HUA MENG SPRAY PAINTING WORKSHOP

1, Kaki Bukit Avenue 6, Blk C #01-61 / 01-34, Singapore 417883

Autobay @ Kaki Bukit

Tel: 6747 8064, 6746 5519 / 9666 9680 Fax: 6743 4896

ESTIMATE

KMHJ3813MHU34814

CHIN BOON KHAI
83 TAMPINES AVENUE 1
#08-22
S 528686

TPA16.
Joy

Date :07.05.2019
Vehicle no :SLL 6571 Z
Make/Model :HYUNDAI TUCSON
Accident date :22.03.2019

No	Description	Qty	Amount (\$\$)
----	-------------	-----	---------------

LIST ITEMS

1	Rear windscreen rubber <i>new</i>	1	\$ 47.1 ✓
2	Rear tailgate <i>Dented</i>	1	\$ 1790.8 ✓
3	Rear tailgate hinges@47.10 <i>new</i>	2	\$ 94.2 x
4	Rear tailgate upper lock <i>Damaged</i>	1	\$ 74.6 ✓
5	Rear tailgate reflector @958.80 <i>cracked RH</i>	2	\$ 1917.6 395.
6	Rear tailgate emblem <i>new</i>	1	\$ 46.9 ✓
7	Rear tailgate TUCSON emblem	1	\$ 43.6 ✓
8	Rear tailgate inner board <i>cracked.</i>	1	\$ 313.5 ✓
9	Rear tailgate weather strip <i>lt</i>	1	\$ 174.9 ✓
10	Rear tailgate shock absorber @142.60 <i>new</i>	2	\$ 285.2 x
11	Rear tailgate inner handle <i>Dented.</i>	1	\$ 41.8 ✓
12	Rear tailgate side inner rubber @80.10 <i>new</i>	2	\$ 160.2 x
13	Rear tailgate lower garnish <i>Dented</i>	1	\$ 579.7 ✓
14	Rear number plate lamp @35.20 <i>new</i>	2	\$ 70.4 x
15	Rear end panel <i>Dented</i>	1	\$ 813.8 ✓
16	Rear end panel inner top garnish <i>deformed</i>	1	\$ 94.2 ✓
17	Rear bumper <i>Distorted</i>	1	\$ 544.5 ✓
18	Rear bumper side holder @26.40 <i>new</i>	2	\$ 52.8 ✓
19	Rear bumper reflector @112.90 <i>cracked.</i>	2	\$ 225.8 ✓
20	Rear bumper reverse sensor @138.40 <i>2 pieces damaged</i>	4	\$ 553.6 276.80.
21	Rear bumper lower lip <i>Distorted</i>	1	\$ 393.8 ✓
22	Rear bumper towing hook cover <i>old</i>	1	\$ 30.8 ✓
23	Rear bumper clips(1 set) <i>new</i>	1	\$ 85.50
24	Rear bumper reinforcement <i>Dished.</i>	1	\$ 475.2 ✓
25	Rear bumper bracket @90.30 <i>Damaged</i>	2	\$ 180.6 ✓
26	Rear tailgate inner lock pump <i>Damaged</i>	1	\$ 283.8 ✓
27	Rear tailgate sensor <i>cracked</i>	1	\$ 170.5 ✓
28	Rear RH lamp <i>new</i>	1	\$ 1081.3 x
29	Rear tailgate outer handle <i>new</i>	1	\$ 69.1 x
30	Rear RH lamp housing <i>new</i>	1	\$ 275.7 x
31	Rear RH inner shield <i>new</i>	1	\$ 320.1 ✓
32	Rear RH lower side garnish <i>Deformed</i>	1	\$ 325.4 ✓
33	Rear exhaust <i>Bent.</i>	1	\$ 1410.8 1282.
34	Rear exhaust mounting <i>new</i>	1	\$ 46.2 x

13073.5

HUA MENG SPRAY PAINTING WORKSHOP

1, Kaki Bukit Avenue 6, Blk C #01-61 / 01-34, Singapore 417883

Autobay @ Kaki Bukit

Tel: 6747 8064, 6746 5519 / 9666 9680 Fax: 6743 4896

ESTIMATE

CHIN BOON KHAI

83 TAMPINES AVENUE 1

#08-22

S 528686

Date

:07.05.2019

Vehicle no

:SLL 6571 Z

Make/Model

:HYUNDAI TL TUCSON

Accident date

:22.03.2019

No	Description	Qty	Amount (\$)
35	Rear RH fender inner side garnish <i>cracked</i>	1	\$ 533.5 ✓
36	Rear exhaust pipe top cover <i>crushed</i>	1	\$ 101.9 ✓
37	Rear spare tyre top board <i>Delaminated</i>	1	\$ 528 ✓
38	Rear spare tyre well <i>Cracked</i>	1	\$ 861.8 ✓
39	Rear spare tyre well insulation @319.70 <i>per</i>	2	\$ 639.4 280 (SW)
40	Rear RH lamp side cover <i>2nd</i>	1	\$ 52.3 ✓
41	Rear centre exhaust pipe <i>Best</i>	1	\$ 1582.5 1325
42	Rear centre exhaust pipe mounting @46.20 <i>per</i>	2	\$ 92.4 x
			\$ 17465.3
		Less 20% disc	\$ 3493.1
		Total	\$ 13972.2

Special Nett Items

1	Rear number plate <i>Detached</i>	1	\$ 50 30
2	Rear number plate holder <i>Delaminated</i>	1	\$ 50 30
3	Rear tailgate camera <i>Damaged</i>	1	\$ 800 380
		Total	\$ 900

Labour Cost

1	Towing fee	\$ 150 x	
2	To supply rear windscreen sealant	\$ 50 ✓	
3	To supply rear end panel inner sealant	\$ 200 60	
4	Remove & reinstall rear windscreen	\$ 200 120	
5	Remove & reinstall bootlid inner garnish	\$ 150 80	
6	Remove & reinstall exhaust pipe	\$ 300 160	
7	Remove & reinstall reverse sensor	\$ 180 60	
8	Remove & reinstall petrol tank	\$ 150 80	
9	Remove, replace & repair consistent to the accident	\$ 2500 1300	
10	Respray painting	\$ 1800 1200	
11	Tuff kote	\$ 150 80	
		Total	\$ 5830

11 Tuff kote

LKK Auto Cons. wants hence notify the Reparer of the following:

- To resurvey before/after spray painting
- To display damaged parts during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Reparer
Signature:

11K
10Days

Grand Total \$ 20702.2

total 13854.40
H/S 11K 10Days

Panel Beating }
Inclusive of } 7 Days.
upholstery work,
exhaust work } ↓

Spray Painting 3 Days

Print Received Message

This mail is associated with :

***SLL6571Z (5179665897SG)**
[SJV4943T]
TP
CHIN BOON KHAI
Mar 22 2019 7:00AM
[LIM SAI HIANG JOANNE]
Hua Meng Spray Painting Workshop

From AIG Asia Pacific Insurance Pte. Ltd. (Express) (AIG_SG_EXPRESS), sent on 24/01/2020 22:41 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$11050.00) - SLL6571Z - Claim Handler: Tan, Bennie-WZ

Approved:11050.00:Pls do your utmost to negotiate settlement from: \$10,700 to \$11,050 (All-in). Subj to Final Repair Bill, Rental Agreement & Invoice, LTA Search Fee in order.



CERTIFICATE OF INSURANCE

Motor Vehicles (Third-Party Risks and Compensation) Act. (Chapter 189) Motor Vehicles (Third-Party Risks and Compensation) Rules, 1960 Road Transport Act, 1987 (Malaysia) Motor Vehicles (Third-Party Risks) Rules, 1959 (Malaysia)

CERTIFICATE NO. : VFA/P1910529 Account No. : 08260
Coverage : Comprehensive
Sum Insured : Market Value At The Time Of Loss
Name of Policy Holder : CHIN BOON KHAI
Vehicle Registration No. : SLL65713
Period of Insurance : From 04/03/2019 To 03/03/2020 (Both Dates Inclusive)

PERSONS OR CLASSES OF PERSONS ENTITLED TO DRIVE*

- (a) The Policyholder
The Policyholder may also drive a Motor Car not belonging to or not hired (under a hire purchase agreement or otherwise) to him or his employer or his partner
(b) Any other person who is driving on the Policyholder's order or with his permission
Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

LIMITATIONS AS TO USE*

Use only for social, domestic and pleasure purposes and for the Policyholder's business. The policy does not cover - use for hire or reward, racing, pace-making, reliability trial, speedtesting, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with motor trade; or when the Motor Car, whether stationary, in use or otherwise, is in or on, a racing track, circuit, route, course or any other roads by whatever name called that are typically used for racing, pace-making or such similar purposes.

Basic Own Damage Excess : NIL

An Additional Excess is applicable as follows:
S\$500.00 for Unnamed Authorized Driver.
S\$2,500.00 for Undeclared Young and inexperienced Driver.
(Please refer to your policy on the terms & conditions)

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act, (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), and Section 189 of the Road Transport Act, 1987 (Malaysia).

I/We hereby certify that the policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act, (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

N.B :
Your authorised workshop is Komoco Motors Pte Ltd.

AXA INSURANCE PTE LTD


Authorized Signature

Issued by - SGOVGBP on 08/03/2019

IMPORTANT :
Policyholders are warned that on the sale of a motor vehicle they must surrender the Certificate of Insurance and the Policy to the insurance company. If the Certificate of Insurance has been lost or destroyed a Statutory Declaration to the effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicle (Third-Party Risks and Compensation Act (Cap. 189)). Warranty Clause requires the premium to be paid in full within a specific period of time for the validity under the policy, renewal certificate, covernote and

Vic (LKKAuto)

From: Tan, Bennie-WZ <Bennie-WZ.Tan@aig.com>
Sent: Tuesday, 29 October, 2019 4:14 PM
To: Vic (LKKAuto)
Cc: Admin A
Subject: RE: Your Ref: 5179665897SG-003_ACCIDENT INVOLVING VEHICLES SJV 4943T AND SLL 6571Z ON 22/03/2019 LKK REF CC6/AIG19007484/Ahb3

Hi Vic

Thank you for your email.

We write to inform you may proceed to handle this matter per usual since there is nothing incriminating found.

Kindly write to TP repairer to discharge their lawyer immediately in view of maintaining an amicable settlement with them.

Best Regards

Bennie Tan
AIG
Senior Complex Claims Examiner
Claims | AIG Asia Pacific Insurance Pte. Ltd

78 Shenton Way #08-16 Singapore 079120
Tel +(65) 6419 1718

Bennie-WZ.Tan@aig.com | www.aig.sg

From: Vic (LKKAuto) [mailto:vicalpeh@lkkauto.com]
Sent: Tuesday, October 29, 2019 4:09 PM
To: Tan, Bennie-WZ
Cc: Admin A; Vic (LKKAuto)
Subject: [EXTERNAL] RE: Your Ref: 5179665897SG-003_ACCIDENT INVOLVING VEHICLES SJV 4943T AND SLL 6571Z ON 22/03/2019 LKK REF CC6/AIG19007484/Ahb3

This message is from an external sender; be cautious with links and attachments.

Dear Bennie,

We refer further to our below email.

Please be informed that TP had decided to submit the claim through their solicitor together with the BI claim (see attached email).

Kindly advise if we can proceed to close and submit our WP report.

Thank you.

...CLAIM SUBFOLDER...(Pending for Survey Report)

Fastlane

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	30 Apr 2019 Edit Reg		26 Apr 2019 00:00 Edit Adj Rpt	S\$9,700.00 Edit Estimates	S\$9,700.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by adjuster]									
Insured:	LIM SAI HIANG JOANNE, ID: S0096124H								
Main Claimant:	CHIN BOON KHAI, ID: S7933817F								
Vehicle Reg. No.:	SLL6571Z	Date of Loss:	22/03/2019 07:00 - :59 [24 Months and 18 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / 51796658975G	Policy/Cover Note No.:	2100188753 (Comprehensive)						
Vehicle Reg. No. (Insured):	SJV4943T	Policy No. (Claimant):	VPA/P1910529						
Repairer:	Hua Meng Spray Painting Workshop (HQ) No 1 Kaki Bukit Avenue 6, #01-61 Autobay@Kaki Bukit, 417883 Kaki Bukit - Tel: 67478064, 67465519								
Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd. (Express) - Tel: 65-6419-3000 ... [Handled by Tan, Bennie-WZ - 6419 1718] Bennie-WZ.Tan@aig.com								
Claimant's Insurer:	AXA Insurance Pte Ltd (HQ) - Tel: 6880 4888								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by ADRIAN LING] ... [Final Rpt due 09/05/2019]								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
<ul style="list-style-type: none"> AIG_SG_EXPRESS (24/01/2020): Alert - Adj Mandate Approved (S\$11050.00) - SLL6571Z - Claim Handler: Tan, Benni... AIG_SG_EXPRESS (22/11/2019): Alert - Adj Mandate Maintained - SLL6571Z - Claim Handler: Tan, Bennie-WZ 									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SLL6571Z (5179665897SG)
[SJV4943T]
TP
CHIN BOON KHAI
Mar 22 2019 7:00AM
[LIM SAI HIANG JOANNE]
Hua Meng Spray Painting Workshop

Upload Documents			Upload Photos			Compose New Letter			Upload Video			Upload Audio			View View in Browser		
Letters/Correspondences															1 per page		<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)										Thumbnail	Print				
1	(Draft)	Third Party Express Settlement - Payment Breakdown											Edit				
Photos/Images															3 per page		<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)										Thumbnail	Print				
1	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
2	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
3	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
4	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
5	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
6	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
7	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
8	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
9	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
10	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
11	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
12	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
13	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
14	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
15	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
16	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
17	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
18	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
19	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
20	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
21	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
22	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
23	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
24	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
25	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
26	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
27	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
28	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
29	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
30	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
31	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
32	13/06/19 10:40	General View											Load JPG <input checked="" type="checkbox"/>				
33	13/06/19 10:41	Reinspection Photo											Load JPG <input checked="" type="checkbox"/>				
34	13/06/19 10:41	Reinspection Photo											Load JPG <input checked="" type="checkbox"/>				
35	13/06/19 10:41	Reinspection Photo											Load JPG <input checked="" type="checkbox"/>				
36	13/06/19 10:41	Reinspection Photo											Load JPG <input checked="" type="checkbox"/>				
37	13/06/19 10:41	Reinspection Photo											Load JPG <input checked="" type="checkbox"/>				
38	13/06/19 10:41	Reinspection Photo											Load JPG <input checked="" type="checkbox"/>				
39	13/06/19 10:41	Reinspection Photo											Load JPG <input checked="" type="checkbox"/>				
40	13/06/19 10:41	Reinspection Photo											Load JPG <input checked="" type="checkbox"/>				

Letters/Correspondences			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
				<input checked="" type="checkbox"/>
41	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
42	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
43	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
44	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
45	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
46	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
47	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
48	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
49	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
50	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
51	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
52	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
53	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
54	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
55	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
56	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
57	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
58	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
59	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
60	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
61	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
62	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
63	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
64	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
65	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
66	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
67	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
68	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
69	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
70	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
71	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
72	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
73	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
74	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
75	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
76	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
77	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
78	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
79	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
80	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
81	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
82	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
83	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
84	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
85	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
86	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
87	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
88	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
89	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
90	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
94	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
95	13/06/19 10:41	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Letters/Correspondences			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
96	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
97	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
98	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
99	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
100	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
101	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
102	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
103	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
104	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
105	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
106	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
107	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
108	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
109	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
110	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
111	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
112	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
113	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
114	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
115	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
116	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
117	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
118	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
119	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
120	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
121	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
122	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>
123	13/06/19 10:41	Reinspection Photo		<input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	29/04/19 18:55	TP GIA REPORT.		<input type="checkbox"/>
2	13/06/19 10:54	TP ESTIMATE		<input type="checkbox"/>
3	03/10/19 15:37	TP LOD		<input type="checkbox"/>
4	03/10/19 15:38	EMAIL FROM TP		<input type="checkbox"/>
5	29/10/19 16:05	EMAIL FROM TP		<input type="checkbox"/>
6	29/10/19 16:22	EMAIL FROM AIG		<input type="checkbox"/>
7	29/10/19 16:40	LETTER TO OI		<input type="checkbox"/>
8	08/11/19 13:46	RENTAL RECEIPT		<input type="checkbox"/>
9	08/11/19 13:46	LTA SEARCH		<input type="checkbox"/>
10	08/11/19 13:46	LOD		<input type="checkbox"/>
11	07/02/20 12:09	AUTHORISATION TO ACT FORM		<input type="checkbox"/>
12	07/02/20 12:09	Release Voucher		<input type="checkbox"/>
13	07/02/20 12:09	WORKSHOP INVOICE		<input type="checkbox"/>

No	Finalized On	AIG Asia Pacific Insurance Pte. Ltd. (SG)	Thumbnail	Print
1	30/04/19 10:58	OI GIA REPORT		<input type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; width: 100%;"></div>			
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

NOTE: TO BE COMPLETED BY SURVEYOR

TEAM _____

**THIRD PARTY EXPRESS SETTLEMENT
(PAYMENT BREAKDOWN)**

Vehicle No:	SJV4943T (Insd veh)	Model:	HYUNDAI TUCSON 2.0 TL (A)
	SLL6571Z (TP veh)		
Date of Accident:	22/03/2019		

Global Sum Settlement	:	<input checked="" type="checkbox"/> Yes	<input type="checkbox"/> No
Repair Estimate	:	\$	20,702.24
Final Repair Cost	:	\$	11,050.00
Loss of Use	:	\$	_____ days at \$0.00 per day
Rental (if any)	:	\$	9 days
LTA / GIA Search Fee	:	\$	
Others:	:	\$	
	:	\$	
Final Settlement Sum (Global Sum)	:	\$	11,050.00
Is Third Party Workshop GIA Registered? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO (Kindly indicate below)			
A) For Non GIA Registered Workshop:		Agreed Liability _____ 100 _____ (%)	
B) For GIA Registered Workshop:		BOLA Applicable: Yes/ No BOLA Scenario No: _____	
BOLA Liability: _____ (%)		Assessed Liability (*): _____ (%)	
* Assessed Liability to be filled only for chain collisions and for cases where BOLA does not apply.			
Remarks _____			

Payment Instruction: Payee's Breakdown			
1)	Hua Meng Spray Painting Workshop	:	\$ 11,050.00
2)		:	\$
3)		:	\$
4)		:	\$

JOANNE LEE KHANG MIN _____ LKK Auto Consultants Pte Ltd	07 Feb 2020 _____ Date
---	---------------------------------

Please attach all the supporting documents to the form.
(Final Repair Bill; Rental Invoice; Release Voucher; Authorisation to Act; Survey Report; Medical Report/ Bill (if any))

LKK Auto Consultants Pte Ltd (Co.Reg.No:199807198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG19007484/AHS3Q2

Date: 07/02/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100188753
 Claimant: SLL6571Z Insured Vehicle No: SJV4943T
 Vehicle No: SLL6571Z Nature of Claim: TP Claim No: 5179665897SG
 Date of Loss: 22/03/2019

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SLL6571Z
 Make & Model: HYUNDAI TUCSON, 2.0 TL (A) Engine No: G4NAGU287059
 Reg. Date: 04/03/2017 (Man. Year: 2016) Chassis No: KMHJ3813MHU348114
 Colour: Grey Odometer: 77574 km
 Engine Capacity: 1999 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/55 R18 Rear Tyre Size: 225/55 R18
 Front Left Side: Kumho 6 mm Rear Left Side: Kumho 6 mm
 Front Right Side: Kumho 6 mm Rear Right Side: Kumho 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,872.24	10,664.40	4,207.84	28.29
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,830.00	3,190.00	2,640.00	45.28
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	20,702.24	13,854.40	6,847.84	33.08
Approved Total (Overridden) (S\$)		9,700.00		
Nett Amount (S\$)	20,702.24	9,700.00	11,002.24	53.15
+ Car Rental (9.0 x S\$150.00/day) (S\$)		1,350.00		
+ Doc/Search Fee (S\$)		7.49		
Nett Liability (S\$)		11,057.49		
Global Sum Settlement (S\$)		11,050.00		

INSPECTION

Date of Assignment: 26/04/2019
 Date Inspected: 26/04/2019 Inspected At: Hua Meng Spray Painting Workshop (HQ)
 No 1 Kaki Bukit Avenue 6, #01-61
 Autobay@Kaki Bukit
 Singapore 417883

Estimated Period of Repair: 10.0 days

Adjuster: ADRIAN LING

Manager: VIC ALPEH

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TAILGATE RUBBER	Necessary	47.10 FL	*47.10 FL
2	1		*REAR TAILGATE	Dented	1,790.80 FL	*1,790.80 FL
3	2		*REAR TAILGATE HINGES	Not Necessary	94.20 FL	*- FL
4	1		*REAR TAILGATE UPPER LOCK	Damaged	74.60 FL	*74.60 FL
5	1		*REAR TAILGATE REFLECTOR	O/S Cracked	1,917.60 FL	*395.00 FL
6	1		*REAR TAILGATE EMBLEM	Necessary	46.90 FL	*46.90 FL
7	1		*REAR TAILGATE TUCSON EMBLEM	Necessary	43.60 FL	*43.60 FL
8	1		*REAR TAILGATE INNER BOARD	Cracked	313.50 FL	*313.50 FL
9	1		*REAR TAILGATE WEATHERSTRIP	Cut	174.90 FL	*174.90 FL
10	2		*REAR TAILGATE SHOCK ABSORBER	Not Necessary	285.20 FL	*- FL
11	1		*REAR TAILGATE INNER HANDLE	Deformed	41.80 FL	*41.80 FL
12	2		*REAR TAILGATE SIDE INNER RUBBER	Not Necessary	160.20 FL	*- FL
13	1		*REAR TAILGATE LOWER GARNISH	Cracked	579.70 FL	*579.70 FL
14	2		*REAR NUMBER PLATE LAMP	Not Necessary	70.40 FL	*- FL
15	1		*REAR END PANEL	Dented	813.80 FL	*813.80 FL
16	1		*REAR END PANEL INNER TOP GARNISH	Deformed	94.20 FL	*94.20 FL
17	1		*REAR BUMPER	Distorted	544.50 FL	*544.50 FL
18	2		*REAR BUMPER SIDE HOLDER	Necessary	52.80 FL	*52.80 FL
19	2		*REAR BUMPER REFLECTOR	Cracked	225.80 FL	*225.80 FL
20	4		*REAR BUMPER REVERSE SENSOR	Damaged (2 PCS ONLY)	553.60 FL	*276.80 FL
21	1		*REAR BUMPER LOWER LIP	Distorted	393.80 FL	*393.80 FL
22	1		*REAR TAILGATE TOWING HOOK COVER	Deformed	30.80 FL	*30.80 FL
23	1		*SET REAR BUMPER CLIPS	Necessary	85.00 FL	*50.00 FL
24	1		*REAR BUMPER REINFORCEMENT	Distorted	475.20 FL	*475.20 FL
25	2		*REAR BUMPER BRACKET	Damaged	180.60 FL	*180.60 FL
26	1		*REAR TAILGATE INNER LOCK PUMP	Damaged	283.80 FL	*283.80 FL
27	1		*REAR TAILGATE SENSOR	Cracked	170.50 FL	*170.50 FL
28	1		*REAR RH LAMP	Not Necessary	1,081.30 FL	*- FL
29	1		*REAR TAILGATE OUTER HANDLE	Not Necessary	69.10 FL	*- FL
30	1		*REAR RH LAMP HOUSING	Not Necessary	275.70 FL	*- FL
31	1		*REAR RH INNER SHIELD	Torn	320.10 FL	*320.10 FL
32	1		*REA RH LOWER SIDE GARNISH	Deformed	325.40 FL	*325.40 FL
33	1		*REAR EXHAUST	Bent	1,410.80 FL	*1,282.00 FL
34	1		*REAR EXHAUST MOUNTING	Not Necessary	46.20 FL	*- FL
35	1		*REAR RH FENDER INNER SIDE GARNISH	Cracked	533.50 FL	*533.50 FL
36	1		*REAR EXHAUST PIPE TOP COVER	Crumpled	101.90 FL	*101.90 FL
37	1		*REAR SPARE TYRE TOP BOARD	Deformed	528.00 FL	*528.00 FL
38	1		*REAR SPARE TYRE WELL	Buckled	861.80 FL	*861.80 FL
39	2		*REAR SPARE TYRE WELL INSULATION	Necessary	511.52 FS	*280.00 FS
40	1		*REAR RH LAMP SIDE COVER	Deformed	52.30 FL	*52.30 FL
41	1		*REAR CENTRE EXHAUST PIPE	Bent	1,582.50 FL	*1,325.00 FL
42	2		*REAR CENTRE EXHAUST PIPE MOUNTING	Not Necessary	92.40 FL	*- FL
43	1		*REAR NUMBER PLATE	Dented	50.00 FS	*30.00 FS
44	1		*REAR NUMBER PLATE HOLDER	Deformed	50.00 FS	*30.00 FS
45	1		*REAR TAILGATE CAMERA	Damaged	800.00 FS	*380.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	18,237.42	13,150.50
- List Item Discount on L Items 20.00/20.00% (\$\$)	3,365.18	2,486.10
Total Parts (\$\$)	14,872.24	10,664.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TOWING FEE	New	150.00	0.00
2	TO SUPPLY REAR WINDSCREEN SEALANT	New	50.00	50.00
3	TO SUPPLY REAR END PANEL INNER SEALANT	New	200.00	60.00
4	REMOVE & REINSTALL REAR WINDSCREEN	New	200.00	120.00
5	REMOVE & REINSTALL BOOTLID INNER GARNISH	New	150.00	80.00
6	REMOVE & REINSTALL EXHAUST PIPE	New	300.00	160.00
7	REMOVE & REINSTALL REVERSE SENSOR	New	180.00	60.00
8	REMOVE & REINSTALL PETROL TANK	New	150.00	80.00
9	REMOVE, REPLACE & REPAIR CONSISTENT TO THE ACCIDENT	New	2,500.00	1,300.00
10	RESPRAY PAINTING	New	1,800.00	1,200.00
11	TUFF KOTE	New	150.00	80.00
Gross Labour Cost (S\$)			5,830.00	3,190.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >