



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FW 1737J

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	TOP COWLING	CRACKED	195.00	195.00
1	COWLING SCREEN	SCRATCHED	82.50	82.50
1	COWLING STAY	BENT	60.50	60.50
2	HANDLE BAR @\$71.50	O/S BENT	143.00	71.50
1	SET HANDLE BALANCER	GRAZED	40.00	40.00
1	BRAKE LEVER	SCRATCHED	20.00	20.00
1	BRAKE MASTER PUMP	CUT	145.00	145.00
1	HEAD LAMP ASSY	HDR CRACKED	160.00	160.00
2	MIRROR @ \$30.00	BROKEN	60.00	60.00
1	METER ASSY	NOT NECESSARY	495.00	-
2	FRONT SIGNAL @ \$30.00	N/S BROKEN	60.00	30.00
2	FRONT FORK ASSY @ \$350.00	TO REPAIR SEE LABOUR	700.00	-
1	FRONT FORK UNDER BRACKET	SERVICEABLE	160.00	-
2	SIDE FAIRING @ \$170.00	NOT FITTED	340.00	-
1	FRONT FENDER	CUT	85.00	85.00
1	FRONT RIM	TO REPAIR SEE LABOUR	320.00	-
1	FRONT DISC PLATE	SERVICEABLE	155.00	-
2	AIR DUCT @ \$42.00	NOT NECESSARY	84.00	-
1	RADIATOR ASSY	NOT NECESSARY	210.00	-
1	FRONT FOOTREST	NOT NECESSARY	55.00	-
1	FRONT FOOTREST BRACKET	NOT NECESSARY	75.00	-
1	BRAKE PEDAL	BENT	58.00	58.00
1	REAR FOOTREST	BENT	35.00	35.00
1	REAR FOOTREST BRACKET	BENT	65.00	65.00
1	EXHAUST ASSY	DAMAGED	506.00	180.00
	LESS 10% DISCOUNT		-430.90	-128.75
			3,878.10	1,158.75
1	FUEL TANK (SN)	TO REPAIR SEE LA	460.00	100.00

Report Ref No. CS/CTI17020720/Utd3s2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	TAIL BOARD (SN)	TO REPAIR SEE LABOUR	132.00	60.00
	LESS 10% DISCOUNT		-59.20	-
			532.80	160.00
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	NECESSARY	20.00	10.00
1	FRONT TYRE (SN)	NOT NECESSARY	120.00	-
1	SET STEERING CONE / BEARING (SN)	NECESSARY	140.00	70.00
			280.00	80.00
	<u>LABOUR</u>			
	TOWING FEE (2 TRIPS)		120.00	100.00
	CHASSIS FRAME ALIGN. INCLUSIVE OF THE REPAIR OF FRONT FORK ASSY, FRONT RIM, FUEL TANK AND TAIL BOARD.		450.00	350.00
	LABOUR FEE.		350.00	280.00
			920.00	730.00
GRAND TOTAL			5,610.90	2,128.75
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,700.00

Report Ref No. CS/CTI17020720/Utd3s2-1

NOTE: THIS MOTORCYCLE ONLY BALANCE 3 MONTHS PLUS AND CANNOT BE FURTHER RENEWAL.

MARKET VALUE: \$320.00 - \$500.00 (EST)

LTA: \$105.00

NETT VALUE: \$215.00 - \$395.00 (EST)

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.