



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLQ 5343X

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER (CONSISTENT)	DEEP CUT / TORN	1,455.10	1,455.10
1	FRONT BUMPER SPONGE (CONSISTENT)	NOT NECESSARY	233.80	-
1	FRONT BUMPER REINFORCEMENT (CONSISTENT)	NOT NECESSARY	422.10	-
1	FRONT BUMPER SIDE RETAINER N/S (CONSISTENT)	BENT	89.50	89.50
1	SET FRONT BUMPER CLIPS (CONSISTENT)	NECESSARY	50.00	50.00
1	FRONT BUMPER FOG LAMP N/S (CONSISTENT)	CRACKED	481.50	481.50
1	HEADLAMP N/S (CONSISTENT)	SCRATCHED / CRACKED	1,288.10	1,050.10
1	FRONT SUPPORT PANEL (CONSISTENT)	TO REPAIR SEE LABOUR	1,045.10	-
1	FRONT FENDER N/S (CONSISTENT)	BUCKLED	711.90	711.90
1	FRONT FENDER INNERSHIELD N/S (CONSISTENT)	TORN	288.10	288.10
1	SET FRONT FENDER INNERSHIELD CLIPS N/S (CONSISTENT)	NECESSARY	50.00	50.00
1	FRONT GRILLE (CONSISTENT)	CRACKED	485.10	485.10
1	FRONT GRILLE LOGO (CONSISTENT)	NECESSARY	66.50	66.50
1	FRONT SHOCK ABSORBER N/S (CONSISTENT)	BENT	699.10	699.10
1	FRONT LOWER ARM N/S (CONSISTENT)	BENT	715.30	715.30
1	FRONT KNUCKLE ARM BEARING N/S (CONSISTENT)	NECESSARY	350.00	350.00
1	FRONT KNUCKLE ARM N/S (CONSISTENT)	BENT	620.10	620.10
1	FRONT DRIVESHAFT N/S (CONSISTENT)	NOT NECESSARY	1,180.10	-
1	FRONT STEERING RACK ASSY (CONSISTENT)	NOT NECESSARY	1,995.50	-
1	FRONT TYRE N/S (CONSISTENT)	SERVICEABLE	250.00	-
	LESS 50% DISCOUNT		-	-3,556.15
			12,476.90	3,556.15
<b><u>SPECIAL NETT ITEMS</u></b>				
1	FRONT BUMPER LOWER LIP (CARBON) (CONSISTENT) (SN)	NECESSARY	650.00	300.00
1	FRONT SPORT RIM N/S (CONSISTENT) (SN)	DENTED / BENT	850.00	380.00
			1,500.00	680.00

Report Ref No. CC4/ASM19008237/Ugs3q2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>LABOUR</b>			
	TO CHECK WIRING .	NOT NECESSARY	80.00	20.00
	TO REFILL AIRCON GAS .		120.00	-
	TO CONDUCT WHEEL ALIGNMENT .		150.00	120.00
	TO DISMANTLE & REPLACING FRONT UNDERCARRIAGE .		180.00	120.00
	TO SPRAY RUST PROOFING.		80.00	30.00
	LABOUR FOR PANEL BEATING & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF FRONT SUPPORT PANEL.		880.00	400.00
	TO PUTTY & SPRAY PAINTING .		1,080.00	400.00
			2,570.00	1,090.00
	<b>GRAND TOTAL</b>		<b>16,546.90</b>	<b>5,326.15</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>5,300.00</b>

Report Ref No. CC4/ASM19008237/Ugs3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.