

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT**

AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building, 78 Shenton Way #08-16  
Singapore 079120

**Our File No:** CC3/AIG19009719/ETD3S2**Date:** 31/03/2020**REFERENCE**

|                   |                |                  |            |                        |
|-------------------|----------------|------------------|------------|------------------------|
| Insured/Claimant: | NG CHUN KHIANG | Policy No:       | 1700069141 |                        |
| Date of Loss:     | 28/05/2019     | Nature of Claim: | OD         | Claim No: 3750110720SG |

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

|                             |                                      |             |                   |
|-----------------------------|--------------------------------------|-------------|-------------------|
| Reg No:                     | <b>SLT3810L</b>                      |             |                   |
| Make & Model:               | AUDI Q2, 999cc 1.0 TFSI S TRONIC (A) | Engine No:  | CHZ390331         |
| Reg. Date:                  | 26/10/2017 (Man. Year: 2017)         | Chassis No: | WAUZZZGA4HA060138 |
| Colour:                     | Yellow                               | Odometer:   | 34250 km          |
| Engine Capacity:            | 999 cc                               |             |                   |
| Market Value/New Car Price: | S\$104,000.00                        |             |                   |
| Sum Insured (\$\$):         | <b>Market Value/New Car Price</b>    |             |                   |

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

|                          |      |                         |     |                          |     |
|--------------------------|------|-------------------------|-----|--------------------------|-----|
| General Condition:       | Good | Steering (Serviceable): | Yes | Footbrake (Serviceable): | Yes |
| Handbrake (Serviceable): | Yes  | Engine Modification:    | No  | Pre-accident Condition:  |     |

**CONDITION OF TYRES**

|                   |                  |                  |                  |
|-------------------|------------------|------------------|------------------|
| Front Tyre Size:  | 215/60 R16       | Rear Tyre Size:  | 215/60 R16       |
| Front Left Side:  | Bridgestone 7 mm | Rear Left Side:  | Bridgestone 7 mm |
| Front Right Side: | Bridgestone 7 mm | Rear Right Side: | Bridgestone 7 mm |

*The above values represent the remaining tyre treads depth*

| <b>COST OF CLAIMS</b>                     | <b>Repairer's</b> | <b>Adjuster's</b> | <b>Difference</b> | <b>Diff %</b> |
|-------------------------------------------|-------------------|-------------------|-------------------|---------------|
| Parts                                     | 67,315.84         | 42,443.84         | 24,872.00         | 36.95         |
| Miscellaneous Items                       | 0.00              | 0.00              | 0.00              |               |
| Labour                                    | 43,404.00         | 30,824.00         | 12,580.00         | 28.98         |
| Paintwork Labour                          | 0.00              | 0.00              | 0.00              |               |
| Towing                                    | 0.00              | 0.00              | 0.00              |               |
| <b>Calculated Gross Total (\$\$)</b>      | <b>110,719.84</b> | <b>73,267.84</b>  | <b>37,452.00</b>  | <b>33.83</b>  |
| <b>Approved Total (Overridden) (\$\$)</b> |                   | <b>60,000.00</b>  |                   |               |
| <b>- Excess (\$\$)</b>                    | 800.00            | 800.00            | 0.00              | 0.00          |
| <b>(\$\$)</b>                             | 109,919.84        | 59,200.00         | 50,719.84         | 46.14         |
| <b>+ GST 7.00/7.00% (\$\$)</b>            | 7,694.39          | 4,144.00          | 3,550.39          | 46.14         |
| <b>Nett Amount (\$\$)</b>                 | <b>117,614.23</b> | <b>63,344.00</b>  | <b>54,270.23</b>  | <b>46.14</b>  |

**INSPECTION**

|                             |            |                                                                                          |
|-----------------------------|------------|------------------------------------------------------------------------------------------|
| Date of Assignment:         | 03/06/2019 |                                                                                          |
| Date Inspected:             | 31/05/2019 | Inspected At: Premium Automobiles Pte Ltd (Benoi)<br>24 Benoi Sector<br>Singapore 629857 |
| Estimated Period of Repair: | 43.0 days  |                                                                                          |

**Adjuster:** CHEN TSUE YEE**Manager:** DENISE TAY KWEE CHENG

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

# REPAIR DETAILS

## Recommended Parts

| No. | Qty | Part No. | Particulars                                            | Condition             | Repairer's  | Amount       |
|-----|-----|----------|--------------------------------------------------------|-----------------------|-------------|--------------|
| 1   | 1   |          | *FRONT BUMPER                                          | Broken                | 1,706.00 FS | *1,364.00 FS |
| 2   | 1   |          | *FRONT BUMPER FIXING PARTS                             | Not Necessary         | 314.00 FS   | *- FS        |
| 3   | 1   |          | *FRONT BUMPER GRILLE - CENTRE                          | Not Necessary         | 179.00 FS   | *- FS        |
| 4   | 2   |          | *FRONT BUMPER AIR GRILLE - LH / RH                     | N/s Cut / O/s Missing | 308.00 FS   | *245.60 FS   |
| 5   | 2   |          | *FRONT BUMPER AIR GRILLE EN CAP - LH / RH              | N/s Cut / O/s Missing | 62.00 FS    | *48.80 FS    |
| 6   | 1   |          | *FRONT BUMPER SPOILER                                  | Cut                   | 273.00 FS   | *218.00 FS   |
| 7   | 1   |          | *FRONT BUMPER CLOSING ELEMENT - CENTRE                 | Not Necessary         | 142.00 FS   | *- FS        |
| 8   | 2   |          | *FRONT WHEEL SPOILER - LH/RH                           | N/s Cut / O/s Missing | 62.00 FS    | *49.12 FS    |
| 9   | 1   |          | *FRONT BUMPER ADAPTER - LH / RH                        | Broken                | 70.00 FS    | *55.92 FS    |
| 10  | 1   |          | *RADIATOR GRILLE                                       | Not Necessary         | 1,301.00 FS | *- FS        |
| 11  | 1   |          | *RADIATOR GRILLE STRICKER PLATE (TOP)                  | Not Necessary         | 114.00 FS   | *- FS        |
| 12  | 1   |          | *FRONT BUMPER CARRIER                                  | Not Necessary         | 625.00 FS   | *- FS        |
| 13  | 1   |          | *FRONT BUMPER GUIDE SECTION - LH / RH                  | O/s Broken            | 64.00 FS    | *25.60 FS    |
| 14  | 1   |          | *FRONT BUMPER TOP COVER - LH / RH                      | Not Necessary         | 91.00 FS    | *- FS        |
| 15  | 1   |          | *FOAM FILLER PIECE                                     | Not Necessary         | 71.00 FS    | *- FS        |
| 16  | 1   |          | *FRONT BUMPER DISTANCE PIECE                           | Not Necessary         | 12.00 FS    | *- FS        |
| 17  | 1   |          | *CAUTION STICKER                                       | Not Necessary         | 13.00 FS    | *- FS        |
| 18  | 1   |          | *A/C STICKER                                           | Not Necessary         | 7.00 FS     | *- FS        |
| 19  | 1   |          | *FRONT FENDER - LH / RH                                | Dented                | 2,094.00 FS | *1,675.20 FS |
| 20  | 2   |          | *FRONT FENDER ATTACHMENT PARTS                         | Dented                | 72.00 FS    | *72.00 FS    |
| 21  | 2   |          | *FRONT FENDER TOP REAR BRACKET - LH / RH               | Dented                | 28.00 FS    | *22.08 FS    |
| 22  | 2   |          | *FRONT FENDER TOP FRONT BRACKET - LH / RH              | Dented                | 86.00 FS    | *68.16 FS    |
| 23  | 2   |          | *FRONT FENDER TOP CENTER BRACKET - LH / RH             | Dented                | 28.00 FS    | *22.08 FS    |
| 24  | 1   |          | *FRONT FENDER RIVET                                    | Necessary             | 36.00 FS    | *28.80 FS    |
| 25  | 2   |          | *FRONT FENDER BRACE - LH / RH                          | Dented                | 58.00 FS    | *46.08 FS    |
| 26  | 1   |          | *FRONT FENDER CLOSING ELEMENT - RH                     | Necessary             | 30.00 FS    | *23.76 FS    |
| 27  | 1   |          | *FRONT FENDER INSULATION - RH                          | Crushed               | 69.00 FS    | *55.04 FS    |
| 28  | 2   |          | *FRONT WHEEL HOUSING LINER SEAL - UPPER                | Necessary             | 66.00 FS    | *52.16 FS    |
| 29  | 2   |          | *FRONT WHEEL HOUSING LINER - LH / RH                   | Necessary / Crushed   | 366.00 FS   | *292.00 FS   |
| 30  | 2   |          | *FRONT WHEEL HOUSING LINER ATTACHMENT PARTS            | Necessary             | 103.00 FS   | *82.40 FS    |
| 31  | 1   |          | *BONNET                                                | Dented                | 2,549.00 FS | *2,039.20 FS |
| 32  | 1   |          | *BONNET ATTACHMENT PARTS                               | Not Necessary         | 149.00 FS   | *- FS        |
| 33  | 2   |          | *BONNET HINGE - LH / RH                                | Dented                | 112.00 FS   | *88.48 FS    |
| 34  | 1   |          | *BONNET ABSORBER                                       | Not Necessary         | 93.00 FS    | *- FS        |
| 35  | 1   |          | *BONNET ABSORBER BRACKET - RH                          | Not Necessary         | 31.00 FS    | *- FS        |
| 36  | 2   |          | *BONNET STRIKER                                        | Dented                | 200.00 FS   | *159.04 FS   |
| 37  | 1   |          | *BONNET SOUND ABSORBER                                 | Not Necessary         | 201.00 FS   | *- FS        |
| 38  | 1   |          | *BONNET IMPACT PORTECTION<br>3pcs                      | Necessary             | 82.00 FS    | *64.40 FS    |
| 39  | 1   |          | *FRONT FENDER TOP REAR COVER - RH (FENDER INNER)       | Crushed               | 37.00 FS    | *29.44 FS    |
| 40  | 1   |          | *FRONT FENDER TOP REAR SMALL COVER - RH (FENDER INNER) | Crushed               | 14.00 FS    | *11.04 FS    |
| 41  | 1   |          | *PLENUM CHAMBER COVER                                  | Not Necessary         | 144.00 FS   | *- FS        |
| 42  | 1   |          | *PLENUM CHAMBER PANEL                                  | Not Necessary         | 124.00 FS   | *- FS        |
| 43  | 1   |          | *BONNET LOCK                                           | Dented                | 367.00 FS   | *293.60 FS   |
| 44  | 1   |          | *BOWDEN CABLE                                          | Not Necessary         | 53.00 FS    | *- FS        |
| 45  | 1   |          | *BONNET LOCK CABLE                                     | Not Necessary         | 67.00 FS    | *- FS        |
| 46  | 1   |          | *BONNET LOCK CABLE COVER                               | Not Necessary         | 9.00 FS     | *- FS        |
| 47  | 1   |          | *BONNET RELEASE ELEMENT                                | Not Necessary         | 53.00 FS    | *- FS        |
| 48  | 1   |          | *BONNET BOWDEN CABLE                                   | Not Necessary         | 53.00 FS    | *- FS        |
| 49  | 1   |          | *BONNET RELEASE LEVER                                  | Not Necessary         | 12.00 FS    | *- FS        |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars                                   | Condition          | Repairer's  | Amount       |
|-----|-----|----------|-----------------------------------------------|--------------------|-------------|--------------|
| 50  | 1   |          | *HORN - LOW TONE                              | Not Necessary      | 262.00 FS   | *- FS        |
| 51  | 1   |          | *HORN - HIGH TONE                             | Not Necessary      | 180.00 FS   | *- FS        |
| 52  | 2   |          | *HORN BRACKET                                 | Not Necessary      | 58.00 FS    | *- FS        |
| 53  | 2   |          | *FRONT WHEEL ARCH TRIM - LH / RH              | Necessary / Broken | 588.00 FS   | *469.60 FS   |
| 54  | 2   |          | *HEADLIGHT MOUNTING - LH / RH                 | Broken             | 214.00 FS   | *171.20 FS   |
| 55  | 2   |          | *HEADLIGHT - LH / RH                          | Cut / Broken       | 8,982.00 FS | *7,184.00 FS |
| 56  | 1   |          | *HEADLIGHT POWER MODULE                       | Shorted            | 693.00 FS   | *554.00 FS   |
| 57  | 1   |          | *HEADLIGHT CONTROL MODULE                     | Shorted            | 508.00 FS   | *406.00 FS   |
| 58  | 1   |          | *HEADLIGHT HEAT SINK                          | Torn               | 666.00 FS   | *532.40 FS   |
| 59  | 1   |          | *HEADLIGHT VENTILATION HOSE                   | Broken             | 26.00 FS    | *20.72 FS    |
| 60  | 1   |          | *HEADLIGHT LIFT CYLINDER - LH / RH            | O/s Broken         | 256.00 FS   | *102.00 FS   |
| 61  | 1   |          | *HEADLIGHT LIFT CYLINDER HOSE                 | Not Necessary      | 170.00 FS   | *- FS        |
| 62  | 1   |          | *HEADLIGHT LIFT CYLINDER HOSE JOINT           | Necessary          | 27.00 FS    | *21.44 FS    |
| 63  | 3   |          | *HEADLIGHT LIFT CYLINDER ELBOW FITTING        | Necessary          | 81.00 FS    | *64.80 FS    |
| 64  | 1   |          | *WATER RESERVOIR                              | Not Necessary      | 156.00 FS   | *- FS        |
| 65  | 1   |          | *LOCK CARRIER (RH)                            | Broken             | 907.00 FS   | *725.60 FS   |
| 66  | 1   |          | *A/C CONDENSER                                | Not Necessary      | 503.00 FS   | *- FS        |
| 67  | 1   |          | *A/C REFRIGERANT LINE                         | Bent               | 601.00 FS   | *480.40 FS   |
| 68  | 1   |          | *A/C REFRIGERANT LINE - TO COMPRESSOR         | Bent               | 461.00 FS   | *368.80 FS   |
| 69  | 1   |          | *RADIATOR                                     | Not Necessary      | 878.00 FS   | *- FS        |
| 70  | 1   |          | *ADDITIONAL RADIATOR                          | Not Necessary      | 837.00 FS   | *- FS        |
| 71  | 1   |          | *COOLANT                                      | Necessary          | 84.00 FS    | *67.20 FS    |
| 72  | 1   |          | *RADIATOR FAN WITH RING                       | Not Necessary      | 1,483.00 FS | *- FS        |
| 73  | 1   |          | *RADIATOR AIR GUIDE - LH / RH                 | Not Necessary      | 54.00 FS    | *- FS        |
| 74  | 1   |          | *RADIATOR SEAL - RH OUTER                     | Not Necessary      | 6.00 FS     | *- FS        |
| 75  | 1   |          | *RADIATOR AIR GUIDE - UPPER CENTRE            | Not Necessary      | 19.00 FS    | *- FS        |
| 76  | 1   |          | *AIR DUCT AIR GUIDE - FRONT                   | Not Necessary      | 53.00 FS    | *- FS        |
| 77  | 1   |          | *AIR DUCT HOSE                                | Not Necessary      | 62.00 FS    | *- FS        |
| 78  | 1   |          | *AIR DUCT WATER DRAINAGE HOSE                 | Not Necessary      | 31.00 FS    | *- FS        |
| 79  | 1   |          | *INTAKE MANIFOLD SUCTION PIPE                 | Not Necessary      | 129.00 FS   | *- FS        |
| 80  | 1   |          | *AIR FILTER                                   | Not Necessary      | 252.00 FS   | *- FS        |
| 81  | 1   |          | *FRONT FENDER REAR CLOSING ELEMENT - RH       | Not Necessary      | 27.00 FS    | *- FS        |
| 82  | 1   |          | *SIDE MEMBER - RH                             | Dented             | 368.00 FS   | *294.00 FS   |
| 83  | 1   |          | *A-PILLAR - RH                                | Dented             | 1,703.00 FS | *1,362.40 FS |
| 84  | 1   |          | *FRONT DOOR - RH                              | Dented             | 2,285.00 FS | *1,828.00 FS |
| 85  | 1   |          | *FRONT DOOR SEAL INNER - RH                   | Necessary          | 146.00 FS   | *116.80 FS   |
| 86  | 1   |          | *FRONT DOOR ATTACHMENT PARTS                  | Not Necessary      | 85.00 FS    | *- FS        |
| 87  | 1   |          | *FRONT DOOR CATCH - LH                        | Not Necessary      | 109.00 FS   | *- FS        |
| 88  | 1   |          | *FRONT DOOR HINGE - UPPER RH                  | Dented             | 41.00 FS    | *32.08 FS    |
| 89  | 2   |          | *FRONT DOOR HINGE - LOWER RH                  | Dented             | 81.00 FS    | *64.64 FS    |
| 90  | 1   |          | *FRONT DOOR HINGE UPPER PART - UPPER INNER RH | Dented             | 39.00 FS    | *30.80 FS    |
| 91  | 1   |          | *FRONT DOOR REGULATOR - RH                    | Dented             | 241.00 FS   | *192.40 FS   |
| 92  | 1   |          | *FRONT DOOR REGULATOR MOTOR - RH              | Not Necessary      | 224.00 FS   | *- FS        |
| 93  | 1   |          | *FRONT DOOR CONTROL UNIT                      | Not Necessary      | 456.00 FS   | *- FS        |
| 94  | 1   |          | *WIND MIRROR MOUNTING - RH                    | Cut                | 471.00 FS   | *376.40 FS   |
| 95  | 1   |          | *WIND MIRROR CAP - RH                         | Cut                | 136.00 FS   | *108.00 FS   |
| 96  | 1   |          | *WIND MIRROR GLASS - RH                       | Not Necessary      | 282.00 FS   | *- FS        |
| 97  | 1   |          | *FRONT DOOR CORNER TRIM - RH                  | Not Necessary      | 41.00 FS    | *- FS        |
| 98  | 1   |          | *FRONT DOOR WINDOW GUIDE - RH                 | Not Necessary      | 377.00 FS   | *- FS        |
| 99  | 1   |          | *FRONT DOOR WINDOW APERTURE SEAL - RH         | Necessary          | 119.00 FS   | *95.20 FS    |
| 100 | 1   |          | *FRONT DOOR LOWER COVER                       | Cut                | 235.00 FS   | *187.60 FS   |
| 101 | 1   |          | *REAR DOOR - RH                               | Dented             | 2,285.00 FS | *1,828.00 FS |
| 102 | 1   |          | *REAR DOOR OUTER SEAL - RH                    | Necessary          | 119.00 FS   | *94.80 FS    |
| 103 | 1   |          | *BONDING AGENT                                | Necessary          | 45.00 FS    | *35.92 FS    |
| 104 | 1   |          | *CLEANING SOLUTION                            | Necessary          | 65.00 FS    | *51.68 FS    |
| 105 | 1   |          | *APPLICATOR                                   | Not Necessary      | 7.00 FS     | *- FS        |
| 106 | 1   |          | *REAR DOOR ATTACHMENT PARTS                   | Not Necessary      | 85.00 FS    | *- FS        |
| 107 | 1   |          | *REAR DOOR CATCH - RH                         | Not Necessary      | 109.00 FS   | *- FS        |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars                                     | Condition     | Repairer's  | Amount       |
|-----|-----|----------|-------------------------------------------------|---------------|-------------|--------------|
| 108 | 1   |          | *REAR DOOR LOWER COVER (MOULDING)               | Cut           | 206.00 FS   | *164.80 FS   |
| 109 | 1   |          | *FRONT WINDSCREEN                               | Not Necessary | 913.00 FS   | *- FS        |
| 110 | 1   |          | *GEL FOIL                                       | Not Necessary | 128.00 FS   | *- FS        |
| 111 | 2   |          | *PRIMER                                         | Not Necessary | 38.00 FS    | *- FS        |
| 112 | 1   |          | *FRONT SEATBELT - LH                            | Jammed        | 952.00 FS   | *761.60 FS   |
| 113 | 2   |          | *FELT STRIPS                                    | Necessary     | 44.00 FS    | *33.92 FS    |
| 114 | 1   |          | *FRONT SEAT BELT - RH                           | Jammed        | 952.00 FS   | *761.60 FS   |
| 115 | 2   |          | *FRONT TOP SEAT BELT ADJUSTER                   | Necessary     | 322.00 FS   | *257.60 FS   |
| 116 | 1   |          | *AIRBAG CONTROL UNIT                            | Necessary     | 1,578.00 FS | *1,262.40 FS |
| 117 | 2   |          | *AIRBAG CRASH SENSOR                            | Necessary     | 763.00 FS   | *610.40 FS   |
| 118 | 2   |          | *FRONT RIM - LH/RH                              | Cut           | 1,096.00 FS | *876.80 FS   |
| 119 | 1   |          | *RUBBER VALVE                                   | Necessary     | 13.00 FS    | *9.92 FS     |
| 120 | 1   |          | *FRONT SUB FRAME                                | Bent          | 718.00 FS   | *574.40 FS   |
| 121 | 1   |          | *FRONT SUB FRAME BOLTS                          | Not Necessary | 209.00 FS   | *- FS        |
| 122 | 1   |          | *FRONT LOWER ARM - LH                           | Bent          | 332.00 FS   | *265.20 FS   |
| 123 | 1   |          | *FRONT LOWER ARM BOLTS - LH                     | Not Necessary | 32.00 FS    | *- FS        |
| 124 | 1   |          | *FRONT LOWER ARM - RH                           | Bent          | 332.00 FS   | *265.20 FS   |
| 125 | 1   |          | *FRONT LOWER ARM BOLTS - RH                     | Not Necessary | 32.00 FS    | *- FS        |
| 126 | 1   |          | *FRONT STABILIZER                               | Bent          | 372.00 FS   | *297.20 FS   |
| 127 | 1   |          | *FRONT STABILIZER BOLTS                         | Not Necessary | 16.00 FS    | *- FS        |
| 128 | 1   |          | *FRONT WHEEL BEARING HOUSING - LH               | Bent          | 620.00 FS   | *496.00 FS   |
| 129 | 1   |          | *FRONT WHEEL BEARING HOUSING BOLTS - LH         | Not Necessary | 72.00 FS    | *- FS        |
| 130 | 1   |          | *FRONT WHEEL BEARING HOUSING - RH               | Bent          | 620.00 FS   | *496.00 FS   |
| 131 | 1   |          | *FRONT WHEEL BEARING HOUSING BOLTS - RH         | Not Necessary | 72.00 FS    | *- FS        |
| 132 | 1   |          | *FRONT WHEEL BEARING- LH/RH                     | Necessary     | 884.00 FS   | *707.20 FS   |
| 133 | 1   |          | *FRONT LOWER ARM BALL JOINT - LH                | Necessary     | 132.00 FS   | *105.20 FS   |
| 134 | 1   |          | *FRONT LOWER ARM BALL JOINT BOLTS - LH          | Not Necessary | 15.00 FS    | *- FS        |
| 135 | 1   |          | *FRONT LOWER ARM BALL JOINT - RH                | Necessary     | 132.00 FS   | *105.20 FS   |
| 136 | 1   |          | *FRONT LOWER ARM BALL JOINT BOLTS - RH          | Not Necessary | 15.00 FS    | *- FS        |
| 137 | 1   |          | *FRONT STABILIZER LINK - LH/RH                  | Bent          | 175.00 FS   | *139.84 FS   |
| 138 | 1   |          | *FRONT DRIVE SHAFT - LH                         | Not Necessary | 2,208.00 FS | *- FS        |
| 139 | 1   |          | *FRONT DRIVE SHAFT BOLTS - LH                   | Not Necessary | 31.00 FS    | *- FS        |
| 140 | 1   |          | *FRONT DRIVE SHAFT - RH                         | Bent          | 2,208.00 FS | *1,766.40 FS |
| 141 | 1   |          | *FRONT DRIVE SHAFT BOLTS - RH                   | Not Necessary | 31.00 FS    | *- FS        |
| 142 | 2   |          | *FRONT ABSORBER                                 | Bent          | 559.00 FS   | *223.60 FS   |
| 143 | 1   |          | *FRONT ABSORBER BOLTS                           | Not Necessary | 35.00 FS    | *- FS        |
| 144 | 2   |          | *FRONT ABSORBER MOUNTING                        | Not Necessary | 228.00 FS   | *- FS        |
| 145 | 1   |          | *FRONT ABSORBER MOUNTING BOLTS                  | Not Necessary | 35.00 FS    | *- FS        |
| 146 | 2   |          | *FRONT ABSORBER BEARING                         | Not Necessary | 85.00 FS    | *- FS        |
| 147 | 2   |          | *FRONT ABSORBER STOPPER                         | Not Necessary | 61.00 FS    | *- FS        |
| 148 | 1   |          | *FRONT TIE ROD END - LH/RH                      | Bent          | 236.00 FS   | *188.80 FS   |
| 149 | 1   |          | *ACRYLIC SEALANT                                | Necessary     | 180.00 FS   | *180.00 FS   |
| 150 | 1   |          | *CRAVITY WAX                                    | Necessary     | 140.00 FS   | *140.00 FS   |
| 151 | 1   |          | *STONE CHIP TREATMENT                           | Necessary     | 180.00 FS   | *180.00 FS   |
| 152 | 1   |          | *FRONT WINDSCREEN SEALANT                       | Not Necessary | 200.00 FS   | *- FS        |
| 153 | 1   |          | *FRONT NO. PLATE                                | Not Necessary | 40.00 FS    | *- FS        |
| 154 | 1   |          | *SUNDRIES                                       | Necessary     | 800.00 FS   | *509.84 FS   |
| 155 | 1   |          | *ENGINE MOUNTING                                | Bent          | 172.40 FS   | *172.40 FS   |
| 156 | 1   |          | *GEARBOX MOUNTING                               | Deformed      | 192.80 FS   | *192.80 FS   |
| 157 | 1   |          | *HEXAGON FLANGE SCREW                           | Necessary     | 33.92 FS    | *33.92 FS    |
| 158 | 1   |          | *FRONT SUBFRAME SUPPORT LHS                     | Bent          | 16.96 FS    | *16.96 FS    |
| 159 | 1   |          | *FRONT SUBFRAME SUPPORT RHS                     | Bent          | 16.96 FS    | *16.96 FS    |
| 160 | 1   |          | *SHOCK ABSORBER DEEP GROOVE BALL THRUST BEARING | Bent          | 34.00 FS    | *34.00 FS    |
| 161 | 1   |          | *SHOCK ABSORBER SUSPENSION STRUT STORAGE        | Distorted     | 91.20 FS    | *91.20 FS    |
| 162 | 1   |          | *STEERING GEAR                                  | Bent          | 3,632.00 FS | *3,632.00 FS |
| 163 | 1   |          | *TRACK ROD                                      | Bent          | 136.96 FS   | *136.96 FS   |
| 164 | 1   |          | *FRONT FENDER TOP SUPPORT UPPER PART RHS        | Bent          | 21.20 FS    | *21.20 FS    |
| 165 | 1   |          | *CHASSIS TAG                                    | Necessary     | 338.00 FS   | *338.00 FS   |

Report was unsubmitted during this print-out.

| No. | Qty | Part No. | Particulars                             | Condition | Repairer's | Amount     |
|-----|-----|----------|-----------------------------------------|-----------|------------|------------|
| 166 | 1   |          | *COOLANT PIPE WITH INNER HEAT EXCHANGER | Bent      | 368.80 FS  | *368.80 FS |
| 167 | 1   |          | *PRESSURE SENSOR REFRIGERANT LINE       | Bent      | 140.00 FS  | *140.00 FS |
| 168 | 1   |          | *NOISE INSULATION                       | Cracked   | 191.20 FS  | *191.20 FS |
| 169 | 1   |          | *REPAIR SET FOR STEERING BOX            | Necessary | 34.00 FS   | *34.00 FS  |
| 170 | 1   |          | *FRONT TYRE - LH                        | Cut       | 560.00 FS  | *560.00 FS |
| 171 | 1   |          | *FRONT FENDER TOP MIDDLE BRACKET RHS    | Dented    | 16.32 FS   | *16.32 FS  |
| 172 | 1   |          | *HEADLIGHT COMPENSATING PIECE           | Broken    | 69.12 FS   | *69.12 FS  |

F=Franchise part. S=SpcNett.

**Total Parts (S\$) 67,315.84 42,443.84**

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                              | Particulars                                                                                                                                                                                                                                                                                                                                                                                     | Lab.Type | Repairer's       | Amount           |
|---------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|------------------|------------------|
| <b>Labour Items</b>             |                                                                                                                                                                                                                                                                                                                                                                                                 |          |                  |                  |
| 1                               | TO TOW AND RECOVER VEHICLE FROM SCENE OF ACCIDENT.<br>(NPA) (AIG)                                                                                                                                                                                                                                                                                                                               | New      | 0.00             | 0.00             |
| 2                               | TO CARRY OUT FIRST MEASUREMENT TEST ON CAR O-LINER.                                                                                                                                                                                                                                                                                                                                             | New      | 800.00           | 800.00           |
| 3                               | TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.                                                                                                                                                                                                                                                                  | New      | 360.00           | 360.00           |
| 4                               | TO REMOVE AND RENEW AIRCON CONDENSER, ADDITIONAL RADIATOR, RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.                                                                                                                                                                                                                            | New      | 1,400.00         | 1,400.00         |
| 5                               | TO REMOVE AND REINSTALL CENTRE CONSOLE AND DASHBOARD ASSY FOR A-PILLAR RENEWAL. TO RENEW BOTH FRONT SEATBELT AND AIRBAG CONTROL UNIT.                                                                                                                                                                                                                                                           | New      | 3,200.00         | 3,200.00         |
| 6                               | TO REMOVE AND REINSTALL RHS FRONT SEAT ASSY, ABCD PILLAR TRIMS, SILL TRIMS, CARPET, ELECTRONIC COMPONENTS AND FUSE TRAYS.                                                                                                                                                                                                                                                                       | New      | 1,800.00         | 1,800.00         |
| 7                               | TO REMOVE AND REINSTALL ENGINE ASSY WITH GEARBOX ASSY TO FACILITATE CAR O-LINER REPAIRS.                                                                                                                                                                                                                                                                                                        | New      | 2,800.00         | 2,800.00         |
| 8                               | TO REMOVE AND REINSTALL FRONT SUSPENSION ASSY WITH SUBFRAME TO FACILITATE CAR O-LINER REPAIRS. INSPECT FOR DAMAGES AND RENEW IF NECESSARY.                                                                                                                                                                                                                                                      | New      | 2,400.00         | 2,400.00         |
| 9                               | TO RENEW FRONT WINDSCREEN FOR A-PILLAR RENEWAL.                                                                                                                                                                                                                                                                                                                                                 | New      | 480.00           | 0.00             |
| 10                              | TO REPLACE VEHICLE ON CAR O-LINER.                                                                                                                                                                                                                                                                                                                                                              | New      | 1,800.00         | 1,800.00         |
| 11                              | TO DISLodge AND REINSTALL RHS A-PILLAR, RHS FRONT DOORS AND RHS REAR DOOR HARNESS, MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES.                                                                                                                                                                                                                                                                  | New      | 1,060.00         | 1,060.00         |
| 12                              | TO DISMANTLE AND RENEW FRONT BUMPER, BOTH HEADLIGHTS, BOTH FRONT FENDERS, RHS FRONT DOOR, RHS WING MIRROR ASSY AND RHS REAR DOOR. CUT OUT AND REWELD RHS FENDER SUPPORT AND CLOSING ELEMENT AND RHS A-PILLAR. ALIGN BOTH FRONT CHASSIS FRAMES TO SPECIFICATION OF ORIGIN. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED. | New      | 17,200.00        | 9,000.00         |
| 13                              | TO RESPRAY FRONT BUMPER, BONNET, RHS A-PILLAR, RHS FRONT FENDER TOP SUPPORT, RHS FRONT DOOR, BOTH FRONT FENDERS, ENGINE COMPARTMENT, RHS WING MIRROR COVER, DOOR ENTRANCE, RHS REAR DOOR AND HINGES. TO CARRY OUT JOINT SEALANT WORK AND STONE CHIP TREATMENT.                                                                                                                                  | New      | 9,400.00         | 5,500.00         |
| 14                              | TO RENEW RHS FRONT RIMS, LHS FRONT TYRE AND LHS FRONT RIM. TO CARRY OUT WHEEL ALIGNMENT.                                                                                                                                                                                                                                                                                                        | New      | 320.00           | 320.00           |
| 15                              | TO CARRY OUT DIAGNOSTIC CHECK.                                                                                                                                                                                                                                                                                                                                                                  | New      | 384.00           | 384.00           |
| <b>Gross Labour Cost (\$\$)</b> |                                                                                                                                                                                                                                                                                                                                                                                                 |          | <b>43,404.00</b> | <b>30,824.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >