

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC4/AIG19009984/ABA3Q2

**Date:** 06/08/2020

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1900003062

**Claimant**  
**Vehicle No :** SFP2382D **Insured Vehicle No :** SKR4314T

Date of Loss: 30/05/2019 Nature of Claim: TP Claim No: 6031272010SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SFP2382D	Engine No:	G4FC9U745711
Make & Model:	HYUNDAI AVANTE, 1.6 (A)	Chassis No:	KMH DU41BMAU893127
Reg. Date:	30/09/2009 (Man. Year: 2009)	Odometer:	176442 km
Colour:	Black		
Engine Capacity:	1591 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	225/45 R17	Rear Tyre Size:	225/45 R17
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	2,745.00	1,162.40	1,582.60	57.65
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,400.00	810.00	590.00	42.14
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (\$)</b>	<b>4,145.00</b>	<b>1,972.40</b>	<b>2,172.60</b>	<b>52.41</b>
<b>Approved Total (Overridden) (\$)</b>		<b>1,550.00</b>		
<b>(S\$)</b>	4,145.00	1,550.00	2,595.00	62.61
<b>+ GST 7.00/7.00% (S\$)</b>	290.15	108.50	181.65	62.61
<b>Nett Amount (\$)</b>	<b>4,435.15</b>	<b>1,658.50</b>	<b>2,776.65</b>	<b>62.61</b>
<b>Global Sum Settlement (\$)</b>		<b>0.00</b>		

### INSPECTION

Date of Assignment: 04/06/2019

Date Inspected: 10/07/2019 Inspected At:

Precise Auto Service (HQ)  
No 1 Kaki Bukit Ave 6, #02-34/36  
Singapore 417883

Estimated Period of Repair: 4.0 days

**Adjuster:** ADRIAN LING

**Manager:** CHUA ZHEN LI

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	452.00 F	*452.00 FL
2	1		*FRONT BUMPER CLIPS	Necessary	30.00 F	*30.00 FL
3	1		*FRONT BUMPER SIDE HOLDER RH	Necessary	35.00 F	*35.00 FL
4	1		*FRONT BUMPER SPONGE	Not Necessary	145.00 F	* - FL
5	1		*FRONT BUMPER REINFORCEMENT	Not Necessary	274.00 F	* - FL
6	1		*FRONT BUMPER FOG LAMP RH	Not Necessary	243.00 F	* - FL
7	1		*HEADLAMP RH	Not Necessary	480.00 F	* - FL
8	1		*FRONT RH FENDER	Buckled	436.00 F	*436.00 FL
9	1		*FRONT RH WHEEL RIM CUT	Cut	650.00 FS	*400.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$\$)</b>	<b>2,745.00</b>	<b>1,353.00</b>
<b>- List Item Discount on L Items 0.00/20.00% (\$\$)</b>	0.00	190.60
<b>Total Parts (\$\$)</b>	<b>2,745.00</b>	<b>1,162.40</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b><u>Labour Items</u></b>				
1	PANEL BEATING	New	600.00	300.00
2	SPRAY PAINTING	New	600.00	400.00
3	WIRING	New	50.00	30.00
4	TO PERFORM WHEEL ALIGNMENT	New	150.00	80.00
<b>Gross Labour Cost (\$\$)</b>			<b>1,400.00</b>	<b>810.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >