


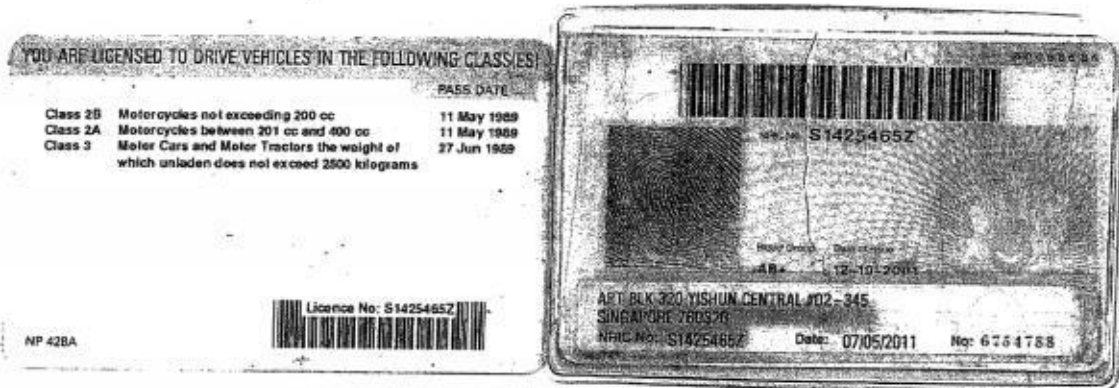

Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



Accident Photo



PAR Automotive Consultancy

Regn. No: 52986974L

Thomson Rd Post Office PO Box 029 Singapore 915701. Tel : 645 31173, Fax : 645 36131.

Report No: 0215-19-TCA

06 May 2019

ACCIDENT VEHICLE SURVEY REPORT

Li Yoon Di
Blk 216 Marsiling Lane #15-822
Singapore 730216

VEHICLE INFORMATION:

<i>Vehicle Reg No.:</i>	GV2178J	<i>Odometer:</i>	454561km
<i>Make & Model:</i>	Mercedes Benz Vito	<i>Colour:</i>	Red
<i>Chassis number:</i>	VSA63809423387314	<i>Date of accident:</i>	13/06/2018
<i>Year of Regn.:</i>	23/01/2002	<i>Date inspected:</i>	16/06/2018
<i>Repairer at:</i>	Twincar Automotive Pte Ltd 2 Kaki Bukit Ave 2 #01-17 Kaki Bukit Auto Hub Singapore 417921	<i>Date inspected (After Repair):</i>	27/06/2018

STATIC CHECKS, where applicable:

<i>Steering :</i>	serviceable
<i>Footbrake :</i>	serviceable
<i>Handbrake :</i>	serviceable
<i>Paintwork :</i>	Good
<i>General condition :</i>	Good

TIRE CONDITION:

	<u>LH / Make</u>	<u>RH / Make</u>	<u>Size</u>
<i>Front:</i>	6mm/Falken	6mm/Falken	215/65R15
<i>Rear:</i>	6mm/Falken	6mm/Falken	215/65R15

POINT OF IMPACT AND DAMAGE, where applicable:

Impact on the rear and front portion.
Please see details as described in the Annex for parts and labour.

REMARKS:

We have inspected the above-mentioned vehicle on a "Without Prejudice" basis.

Parts and Labour Assessment

PARTS

Description of part	Qty	Condition	Repairer's estimate	Our adjustment	
AIRCON CONDENSER	1	reuse	1,180.00	0.00	+
FRONT APRON PANEL <i>Repair</i>	1	fractured	470.00	470.00	X
FRONT BUMPER	1	squashed	588.00	588.00	✓
FRONT BUMPER REINFORCEMENT	1	bent	418.00	418.00	✓
FRONT BUMPER SIDE BRACKET L/R	2	bent	110.00	110.00	✓
FRONT GRILLE	1	fractured	198.55	198.55	✓
FRONT GRILLE '110CDI' EMBLEM	1	necessary	43.00	43.00	✓
FRONT GRILLE 'LOGO' EMBLEM	1	necessary	58.00	58.00	✓
FRONT HEADLAMP L/R	2	fractured	1,376.80	1,376.80	✓
FRONT SIDE LAMP L/R	2	fractured	300.00	300.00	✓
FRONT TOP PANEL	1	repair	785.00	0.00	+
REAR AIR VENT	1	reuse	178.50	0.00	+
REAR BUMPER	1	squashed	897.00	897.00	✓
REAR BUMPER INNER FRAME BRACKET	1	deformed	175.00	175.00	✓
REAR BUMPER SIDE BRACKET L/R	2	bent	100.00	100.00	✓
REAR END INNER PANEL	1	buckled	201.00	201.00	✓
REAR END OUTER PANEL	1	buckled	137.00	137.00	✓
REAR LH FENDER AIR VENT <i>Not new</i>	1	warped	32.00	32.00	X
REAR LH TAILLAMP INNER PANEL <i>Repair</i>	1	buckled	227.00	227.00	X
REAR LH TAILLAMP INNER PANEL COVER	1	reuse	68.00	0.00	+
REAR LH TAILLAMP OUTER PANEL	1	buckled	435.00	435.00	✓
REAR NUMBER PLATE LAMP L/R	2	fractured	220.00	220.00	✓
REAR SPARE TYRE BRACKET	1	reuse	213.50	0.00	+
REAR SPARE TYRE BRACKET ROD L/R	2	repair	210.00	0.00	+
REAR TAILGATE	1	buckled	1,965.00	1,965.00	✓
REAR TAILGATE 'LOGO' EMBLEM	1	necessary	48.00	48.00	✓
REAR TAILGATE 'VITO' EMBLEM	1	necessary	69.00	69.00	✓
REAR TAILGATE CENTER LOCK MOTOR	1	shorted	315.00	315.00	✓
REAR TAILGATE DAMPER L/R <i>Not new</i>	2	bent	280.00	280.00	X
REAR TAILGATE HINGES L/R <i>Not new</i>	2	bent	550.00	550.00	X
REAR TAILGATE INNER TRIM BOARD	1	deformed	155.00	155.00	✓
REAR TAILGATE MECHANISM LOCK	1	bent	265.00	265.00	✓
REAR TAILGATE MECHANISM LOCK STRIKER	1	bent	26.00	26.00	✓
REAR TAILGATE OUTER GARNISH	1	fractured	83.00	83.00	✓
REAR TAILGATE OUTER HANDLE	1	distorted	65.00	65.00	✓
REAR TAILGATE SIDE RUBBER STOPPER L/R	2	deformed	72.00	72.00	✓
REAR TAILGATE WEATHERSTRIP	1	deformed	205.00	205.00	✓
REAR TAILGATE WIPER ARM	1	reuse	102.00	0.00	+
REAR TAILGATE WIPER ARM COVER	1	reuse	15.00	0.00	+
REAR TAILGATE WIPER BLADE	1	reuse	60.00	0.00	+
REAR TAILGATE WIPER MOTOR <i>Not new</i>	1	shorted	386.00	386.00	X
REAR TAILLAMP BACK RUBBER GASKET L/R	2	necessary	37.00	37.00	✓

PAR Automotive Consultancy

Annex A: Page 2
Report No: 0215-19-TCA-GV2178J

REAR TAILLAMP L/R

RH Not New

2 fractured

1,048.00

1,048.00

Subtotal before discount

SS 14,367.35

SS 11,555.35

Percentage discount 10% and 10%

SS 1,436.74

SS 1,155.54

Sub-total 1

SS 12,930.62

SS 10,399.82

FRONT NUMBER PLATE

1 bent

25.00

25.00

FRONT NUMBER PLATE HOLDER

1 bent

50.00

50.00

REAR BUMPER CLIPS - SET

1 necessary

50.00

50.00

REAR NUMBER PLATE

1 bent

25.00

25.00

REAR NUMBER PLATE HOLDER

1 bent

50.00

50.00

REAR SPARE TYRE

1 reuse

280.00

0.00

REAR SPARE TYRE RIM

1 reuse

450.00

0.00

REAR TAILGATE '70KM' STICKER

1 necessary

15.00

15.00

REAR TAILGATE 'C&C' EMBLEM

1 necessary

80.00

80.00

REAR TAILGATE INNER TRIM BOARD CLIPS - SET

1 necessary

80.00

80.00

REAR TAILGATE INNER TRIM GARNISH CLIPS - SET

1 necessary

100.00

100.00

REAR TAILGATE OUTER GARNISH CLIPS - SET

1 necessary

30.00

30.00

REAR TAILGATE WINDSCREEN SEALANT

1 necessary

100.00

100.00

REAR TAILLAMP CLIPS L/R - SET

2 necessary

60.00

60.00

Subtotal before discount

SS 1,395.00

SS 665.00

Sub-total 2

SS 1,395.00

SS 665.00

Parts-total

SS 14,325.62

SS 11,064.82

LABOUR

To remove, change air con parts, vacuums, refill air con gas.

180.00

150.00

To reset system after repair works

400.00

400.00

To remove, reinstall electrical wiring harness, check lighting, resetting headlamp focusing and rewire for parking sensor.

200.00

140.00

To remove, reinstall tailgate windscreen

200.00

150.00

To remove, reinstall roof top trim upholstery, cushion seat, trim garnish, trim liner carpet. (to FR)

150.00

0.00

To re-spray painting on the change bodyparts, repair portion, and where consistent to the accident.

2,000.00

1,760.00

To remove and reinstall exhaust pipe.

80.00

80.00

To provide labour, workmanship to change the above damaged bodyparts, repair, re-construct and re-align body structure, body alignments and damaged consistent to the accident.

2,500.00

2,000.00

To apply anti-rust chemical on repaired and replaced panel.

150.00

150.00

Labour Total

SS 5,860.00

SS 4,830.00

Parts & Labour Total

SS 20,185.62

SS 15,894.82

Results of inspection of the accident vehicle are as shown above.

We have taken into consideration the age and condition of the vehicle in our recommendation.

Hence, the recommended cost of repairs based on Lump Sum repairs is : SS 13,500.00 and the recommended number of working days for the repairs is within 14 day(s).

B J Loi (I Eng., MIMI, AIRTE)

Automotive Appraiser

total: 11222.71

n/s: 89K2

11 Days

> Back to OneMotoring



Land Transport Authority
10 Sin Ming Drive
Singapore 575701
GST Registration No. : M4-0006529-2

Print Date/Time : 14 Jun 2018 / 17:18:43

Receipt Date/Time : 14 Jun 2018 / 17:18:43

Tax Invoice/Receipt

Receipt No. : ITNET-00000-180614-001785

Previous Receipt No. :

S/N Item Description/

Business Transaction Reference
No.

Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
-------------------------------	------------------------	------------------------------

Result of Insurance Enquiry - GW1784K

As at 13 Jun 2018/18:30:00

Insurance Co: EQ INSURANCE COMPANY LTD

1 Insurance Enquiry - GW1784K
Enquiry Fee
20180614171814428903

7.00	0.49	7.49
------	------	------

Sub-Total	7.00	0.49	7.49
-----------	------	------	------

Total Before Rounding	7.00	0.49	7.49
-----------------------	------	------	------

Rounding Difference			0.04
---------------------	--	--	------

Total Amount Payable			7.45
----------------------	--	--	------

Paid By

xxxxxxxxxxxx2392	Credit Card: Visa/MasterCard	7.45
------------------	---------------------------------	------

Total		7.45
-------	--	------

Cash Change		0.00
-------------	--	------

Tendered Amount		7.45
-----------------	--	------

Excess Refundable Amount		0.00
--------------------------	--	------

THANK YOU AND HAVE A NICE DAY!

Please ensure that all payments to the Authority are good and promptly settled by the payment service provider / financial institution. Otherwise, the transaction and receipt is considered void and late fee may apply.

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

EQ INSURANCE COMPANY LTD

Ref : CS3/EQ118010978/Avd3s2-1

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEXSINGAPORE 069110

Date : 04-07-2019



Code : EQI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GW 1784K	Veh. Inspected	GV 2178J
Policy No.	DMCPHQ17-003858	Coverage (\$)	0.00
Claim No.	DM18HO02081-JG	Excess (\$)	0.00
Assign From	JOEL GOH	Assign Date	14/06/2019

2. Vehicle Particulars & Condition

Make & Model	MERCEDES BENZ VITO	c.c	2151
Engine No.	HIDDEN	Year of Reg.	2002
Chassis No.	VSA63809423387314	Colour	RED
Odometer	454561	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/65R15	FALKEN	6 mm
L/H Front Tyre	215/65R15	FALKEN	6 mm
R/H Rear Tyre	215/65R15	FALKEN	6 mm
L/H Rear Tyre	215/65R15	FALKEN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	13/06/2018	Inspection Date	19/06/2018
Survey held at	N-51 AUTOMOTIVE PL 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	11 Working Days
-------------------------------------	------------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GV 2178J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	AIRCON CONDENSER	REUSE	1,180.00	-
1	FRONT APRON PANEL	TO REPAIR SEE LABOUR	470.00	-
1	FRONT BUMPER	SQUASHED	588.00	588.00
1	FRONT BUMPER REINFORCEMENT	BENT	418.00	418.00
2	FRONT BUMPER SIDE BRACKET L/R	BENT	110.00	110.00
1	FRONT GRILLE	FRACTURED	198.55	198.55
1	FRONT GRILLE '110CDI' EMBLEM	NECESSARY	43.00	43.00
1	FRONT GRILLE 'LOGO' EMBLEM	NECESSARY	58.00	58.00
2	FRONT HEADLAMP L/R	FRACTURED	1,376.80	1,376.80
2	FRONT SIDE LAMP L/R	FRACTURED	300.00	300.00
1	FRONT TOP PANEL	TO REPAIR SEE LABOUR	785.00	-
1	REAR AIR VENT	REUSE	178.50	-
1	REAR BUMPER	SQUASHED	897.00	897.00
1	REAR BUMPER INNER FRAME BRACKET	DEFORMED	175.00	175.00
2	REAR BUMPER SIDE BRACKET L/R	BENT	100.00	100.00
1	REAR END INNER PANEL	BUCKLED	201.00	201.00
1	REAR END OUTER PANEL	BUCKLED	137.00	137.00
1	REAR LH FENDER AIR VENT	NOT NECESSARY	32.00	-
1	REAR LH TAILLAMP INNER PANEL	TO REPAIR SEE LABOUR	227.00	-
1	REAR LH TAILLAMP INNER PANEL COVER	REUSE	68.00	-
1	REAR LH TAILLAMP OUTER PANEL	BUCKLED	435.00	435.00
2	REAR NUMBER PLATE LAMP L/R	FRACTURED	220.00	220.00
1	REAR SPARE TYRE BRACKET	REUSE	213.50	-
2	REAR SPARE TYRE BRACKET ROD L/R	TO REPAIR SEE LABOUR	210.00	-
1	REAR TAILGATE	BUCKLED	1,965.00	1,965.00
1	REAR TAILGATE 'LOGO' EMBLEM	NECESSARY	48.00	48.00
1	REAR TAILGATE 'VITO' EMBLEM	NECESSARY	69.00	69.00
1	REAR TAILGATE CENTER LOCK MOTOR	SHORTED	315.00	315.00

Report Ref No. CS3/EQ18010978/Avd3s2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REAR TAILGATE DAMPER L/R	NOT NECESSARY	280.00	-
2	REAR TAILGATE HINGES L/R	NOT NECESSARY	550.00	-
1	REAR TAILGATE INNER TRIM BOARD	DEFORMED	155.00	155.00
1	REAR TAILGATE MECHANISM LOCK	BENT	265.00	265.00
1	REAR TAILGATE MECHANISM LOCK STRIKER	BENT	26.00	26.00
1	REAR TAILGATE OUTER GARNISH	FRACTURED	83.00	83.00
1	REAR TAILGATE OUTER HANDLE	DISTORTED	65.00	65.00
2	REAR TAILGATE SIDE RUBBER STOPPER L/R	DEFORMED	72.00	72.00
1	REAR TAILGATE WEATHERSTRIP	DEFORMED	205.00	205.00
1	REAR TAILGATE WIPER ARM	REUSE	102.00	-
1	REAR TAILGATE WIPER ARM COVER	REUSE	15.00	-
1	REAR TAILGATE WIPER BLADE	REUSE	60.00	-
1	REAR TAILGATE WIPER MOTOR	NOT NECESSARY	386.00	-
2	REAR TAILLAMP BACK RUBBER GASKET L/R	NECESSARY	37.00	37.00
2	REAR TAILLAMP L/R	O/S NOT NECESSARY / N/S FRACTURED	1,048.00	524.00
	LESS 10% DISCOUNT		-1,436.73	-908.63
			12,930.62	8,177.72
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	BENT	25.00	25.00
1	FRONT NUMBER PLATE HOLDER (SN)	BENT	50.00	30.00
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	30.00
1	REAR NUMBER PLATE (SN)	BENT	25.00	25.00
1	REAR NUMBER PLATE HOLDER (SN)	BENT	50.00	30.00
1	REAR SPARE TYRE (SN)	REUSE	280.00	-
1	REAR SPARE TYRE RIM (SN)	REUSE	450.00	-
1	REAR TAILGATE '70KM' STICKER (SN)	NECESSARY	15.00	15.00
1	REAR TAILGATE 'C&C' EMBLEM	NECESSARY	80.00	80.00
1	SET REAR TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	80.00	30.00
1	SET REAR TAILGATE INNER TRIM GARNISH CLIPS (SN)	NECESSARY	100.00	20.00
1	SET REAR TAILGATE OUTER GARNISH CLIPS (SN)	NECESSARY	30.00	10.00
1	REAR TAILGATE WINDSCREEN SEALANT (SN)	NECESSARY	100.00	60.00

Report Ref No. CS3/EQ118010978/Avd3s2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	SET REAR TAILLAMP CLIPS L/R (SN)	NECESSARY	60.00	10.00
			1,395.00	365.00
	LABOUR			
	TO REMOVE, CHANGE AIR CON PARTS, VACUUMS, REFILL AIR CON GAS.	NOT NECESSARY	180.00	-
	TO RESET SYSTEM AFTER REPAIR WORKS.	NOT NECESSARY	400.00	-
	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING, RESETTING HEADLAMP FOCUSING AND REWIRE FOR PARKING SENSOR.		200.00	100.00
	TO REMOVE, REINSTALL TAILGATE WINDSCREEN.		200.00	120.00
	TO REMOVE, REINSTALL ROOF TOP UPHOLSTERY, CUSHION SEAT, TRIM GARNISH, TRIM LINER CARPET. (TO FR)	NOT NECESSARY	150.00	-
	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS, REPAIR PORTION, AND WHERE CONSISTENT TO THE ACCIDENT.		2,000.00	1,000.00
	TO REMOVE AND REINSTALL EXHAUST PIPE.	NOT NECESSARY	80.00	-
	TO PROVIDE LABOUR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RE-CONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT. INCLUSIVE OF THE REPAIR OF FRONT APRON PANEL, FRONT TOP PANEL, REAR LH TAILLAMP INNER PANEL AND REAR SPARE TYRE BRACKET ROD L/R.		2,500.00	1,400.00
	TO APPLY ANTI-RUST CHEMICAL AND REPLACED PANEL.		150.00	60.00
			5,860.00	2,680.00
GRAND TOTAL			20,185.62	11,222.72
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				8,900.00

Report Ref No. CS3/EQ18010978/Avd3s2-1

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.