Claim Reference:

Assessment number: 190296

Version: 1810

Date calculated: 08/07/2019 8:56 AM

Full Report Registration: SLD7744C Printed: 08/07/2019 8:57 AM

Summary Information

Claim

Location: Printed by:

Claim Reference:

Actual Repair Days:

Estimated Repair Time:

Work Provider:

Currency:

Date of Incident: Hire Car Start:

Hire Car End:

AXA Insurance Pte Ltd

SGD 03/06/19

Vehicle Details

Vehicle

Manufacturer:

FORD

Model:

GALAXY (CA1)

Singapore (SG)

SANDRA KHONG

Sub Model:

GHIA

Model Sheet Number:

02 12 04

Registration:

SLD7744C

VIN number:

WF0MXXGBWMAS56485

Odometer:

Model Specs

FROM 03.2010 FRT/RR ELECT WINDOWS LEATHER UPHOLSTERY INT MIRROR AUTODIP D/HANDLE CHROME/PAIN TYRES 225/50 WR 17

ESP

HEAT ABSORB FRT SCR CENTR DOUBLE LOCKING ELEC DRIVER SEAT MEM ROOF CONSOLE LONG 2.3 LTR 118 KW

WHEELS 7J X 17 ALLOY PAINTING OFF VEHICLE WINDSCREEN W/SENSOR SIDE WINDOW FOLDING FRT/RR AIR CON AUTO LEATHER STRG WHEEL **CONVERS INFO SYSTEM AUTO GEARBOX 6 SPEED AUDIO SYSTEM SONY CD** TWO COAT PEARL/MICA

FRONT FOG LAMPS SIDE SUN VISOR LIGHT SWITCHING AUTO **CRUISE CONTROL ROOF RAILS**

575722

Claim Reference:

Assessment number: 190296

Version: 1810

Date calculated: 08/07/2019 8:56 AM

Full Report Registration: SLD7744C Printed: 08/07/2019 8:57 AM


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All [

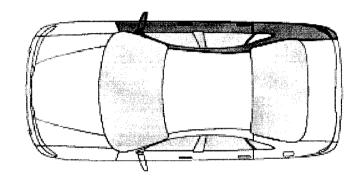

Labour

	Time Base 10 WU/h	Price = 45.00 SGD/h
Code	Description	WU Price SGD
NO NUMBER	ADD/TIME FOR ONE MAIN POSITION	2.0 9.00
32 115 1	R + R RIGHT HEADLAMP	1,0 4.50
44 253 1)	R + R RIGHT FRONT WING (RIGHT HEADLAMP ASSY REMOVED)	7.0 31.50
	INCLUDES: WHEELHOUSE LINER R + R *	
44 030 4	RIGHT REAR DOOR EDGE SEALANT	2.0 9.00
44 414 4	RENEW R/R DOOR (REMOVED)	27.0 121.50
	INCLUDES: CONVERT PARTS	
43 447 1	R + R REAR BUMPER	3.0 13.50
43 447 4	RENEW REAR BUMPER (REMOVED)	2.0 9.00
NO NUMBER	R + R R/R BUMPER BRACKET	1.0 4.50
44 474 0	RENEW RIGHT OUTER SILL PANEL	101.0 454.50
	INCLUDES. R + R DOORS, RIGHT SEAT, TRIM	
	PANELS AND FLOOR CARPETS IN REPAIR AREA	
12 254 1)	DETACH + REFIT REAR BRAKE CALIPER	1.0 4.50

Claim Reference:

Assessment number: 190296

Version: 1810

Date calculated: 08/07/2019 8:56 AM

Full Report Registration: SLD7744C Printed: 08/07/2019 8:57 AM

Code	Description		Μ'n	Price SGD
15 373 1) 3482	R + R R/REAR WHEEL HUB R/SIDE PANEL CPL REPAIR	ıS	3.0 30 . 0*	13.50 135.00
	Labour Cost Panel / Mechanical Labour	Hrs 18.00	WU 180.0	810.00
	Total of Labour			810,00
Paint Paint Work			ime Basi	s 10WU/h

Paint Work		Time Basi	s 10WU/h
Code	Description - TWO COAT PEARL/MICA	WU	Price SGD
45 443 4	R/R DOOR NEW PART PAINT ST 1	12.0	54.00
45 034 4	R/R DOOR MOULDING NEW PART PAINT ST 1	2.0	9.00
45 482 4	R/SILL PANEL NEW PART PAINT ST 1	15.0	67.50
45 512 4	R/SIDE PANEL CPL REP PAINTING ST IV	23.0	103.50
45 432 4	RIGHT FRONT DOOR SURFACE PAINT ST II	7.0	the state of the s
45 482 4	R/SILL PANEL SURFACE PAINT ST II	6.0	27.00
45 252 4	RIGHT A-PILLAR SURFACE PAINT ST II	2.0	9.00
45 254 4	R/OUTER B-PILLAR SURFACE PAINT ST II	2.0	9.00
45 246 4	R/ROOF FRAME SURFACE PAINT ST II	4.0	18.00
45 000 0	ADD/TIME FOR MAIN WORK	18.0	81,00
45 018 4	ADDITIONAL TIME PAINTING PLASTIC PARTS	4.0	18.00

	Hrs	WU	Price SGD
Total Paint	9.50	95.0	427.50

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2009-01-01 Price SGD	
1782	R/R DOOR	PAM21U24630AB		87 1,150.00	/
1814	R/R DOOR SEAL	6M21U247A14AJ		180.00	?
1848	R/R WINDOW REGULATOR	6M21U27000CB	2-X-11 70 70 70 70 70 70 70 70 70 70 70 70 70	* 280.00	_
1948	R/R DOOR TRIM FRONT	6M21U254A40AL		130.00	
1952	R/R DOOR TRIM REAR	-6M21U254A42AF	V	130.00	_
1954	R/R DOOR BADGE	4M5AA001B58AE		n/c 65.00	
1982	R/R DOOR MOULDING	6M21U25532BN)	(W) ×	\$ ٧ و 230.00	×

Claim Reference:

Assessment number: 190296

Version: 1810

Date calculated: 08/07/2019 8:56 AM

Full Report Registration: SLD7744C Printed: 08/07/2019 8:57 AM

Code	Description	Part Number	Supplier	•	Price SGD
2102	R/SILL PANEL	6M21U10130AA		R	920.00 ×
2581	REAR BUMPER	6M2117866EA		Bue Cra	390.00
2592	R/R BUMPER CORNER	6M2117864AAXWA	V	dis	95.00 ✓
2616	R/BRACKET MOUNTING	6M2117A881AF			50.00 ?
2618	R/R BUMPER BRACKET	AM2117E850AK			70.00 1
3566	R/PROTECTION FOIL	6M2123726AD			0.00 2
9182	R/R WHEEL HUB/BRG	AG9C2B664AAA		2. Annual Company of the Section Company of the Com	320.00 ?
1000	R/R DR OUT HANDLE	CHROME 1		SCR	420,00 🧪
1003	R/R SPORT RIM	RIM		οD	800.00 🗸
f: OEM Parts	Savings				0.00
n: Non-OEM Parts	Subtotal				5,230.00
u: Used parts	Addition(+10.00%))			523.00
	Total				5,753.00

Extras		
Code	Description	Price SGD
1001 1002	WHEEL ALIGNMENT WHEEL ALIGNMENT ' REVERSE SENSOR Total Extras	80.00* 60 SCR 220.00* 200 300.00

Claim Reference:

Assessment number: 190296

Version: 1810

Date calculated: 08/07/2019 8:56 AM

Full Report Registration: SLD7744C

Printed: 08/07/2019 8:57 AM

Final Calculation

	SGD	SGD
Parts	5,230.00	
Addition $(+10.00\%)$	523.00	
Total Parts		5,753.00
Labour Time Base 10 WU/h		
Total 180.0 WU X 45.00 SGD/h	810.00	
Total of Labour		810.00
Total Of Extras		300.00
Paint Work Time Base 10 WU/h		
Labour Cost 95.0 WU X 45.00 SGD/h	427.50	
Total Paint Including Material		427.50
Repair Cost Excludes GST	_	7,290.50
GST (+7.0%)		510.34
Repair Cost Included GST		7,800.84

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: