

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/III19010808/DGA3S2**Date:** 16/01/2020REFERENCE

Handling Insurer:	India International Insurance Pte Ltd	Policy No:	MCOM0015
Claimant Vehicle No :	SHA4370E	Insured Vehicle No :	SHC3873S
Date of Loss:	15/06/2019	Nature of Claim:	TP
		Claim No:	MCT19060356

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHA4370E		
Make & Model:	HYUNDAI I40, 1.7 D CRDI F/L ABS AIRBAG 4DR (A)	Engine No:	D4FDGU695224
Reg. Date:	22/12/2016 (Man. Year: 2016)	Chassis No:	KMHLB41UMHU097295
Colour:	Blue	Odometer:	442502 km
Engine Capacity:	1685 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Hankook 5 mm	Rear Left Side:	Hankook 5 mm
Front Right Side:	Hankook 5 mm	Rear Right Side:	Hankook 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	26,888.80	18,348.16	8,540.64	31.76
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,500.00	2,560.00	2,940.00	53.45
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	32,388.80	20,908.16	11,480.64	35.45
Approved Total (Overridden) (S\$)		16,700.00		
(S\$)	32,388.80	16,700.00	15,688.80	48.44
+ GST 7.00/7.00% (S\$)	2,267.22	1,169.00	1,098.22	48.44
Nett Amount (S\$)	34,656.02	17,869.00	16,787.02	48.44
+ Loss of Use (14.0 x S\$40.00/day) (S\$)		560.00		
+ Car Rental (14.0 x S\$112.67/day) (S\$)		1,577.38		
Nett Liability (S\$)		20,006.38		
Global Sum Settlement (S\$)		20,000.00		

INSPECTION

Date of Assignment:	17/06/2019	Chunni Motor Work Pte Ltd (HQ) Blk 10 Ang Mo Kio Industrial Park 2A, #03-19 AMK Autopoint Singapore 568047
Date Inspected:	18/06/2019 Inspected At:	
Estimated Period of Repair:	11.0 days	

Adjuster: BRYAN TANI**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 16 Jan 2020)

Parts: 143 HYUNDAI I40 1.7 D CRDI F/L ABS AIRBAG 4DR (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SHA4370E)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Buckled	2,265.90 FL	*2,265.90 FL
2	2		*BONNET HINGE (LH/RH)	Bent	82.00 FL	*82.00 FL
3	1		*BONNET LOCK	Bent	36.90 FL	*36.90 FL
4	1		*BONNET INSULATOR	Bent / Crumpled	196.50 FL	*196.50 FL
5	10		*BONNET INSULATOR CLIPS	Necessary	8.40 FL	*8.40 FL
6	1		*RADIATOR GRILLE	Broken	1,110.10 FL	*1,110.10 FL
7	1		*RADIATOR GRILLE H EMBLEM	Necessary	120.30 FL	*120.30 FL
8	1		*FRONT BUMPER COVER	Broken	1,052.20 FL	*1,052.20 FL
9	1		*FRONT BUMPER SPONGE	Torn	99.20 FL	*99.20 FL
10	1		*FRONT BUMPER REINFORCEMENT	Buckled	402.10 FL	*402.10 FL
11	1		*FRONT BUMPER GRILLE (RH)	Bent	93.60 FL	*93.60 FL
12	1		*FRONT BUMPER GRILLE AIRDUCT (RH)	Not Necessary	26.20 FL	*- FL
13	1		*FRONT BUMPER LIP	Not Necessary	54.90 FL	*- FL
14	2		*FRONT BUMPER BRACKET TOP (LH/RH)	Not Necessary	44.80 FL	*- FL
15	1		*FRONT BUMPER BRACKET (LH/RH)	O/s Broken / N/s Not Necessary	49.20 FL	*24.60 FL
16	1		*HEADLAMP SUPPORT TOP COVER	Not Necessary	222.60 FL	*- FL
17	1		*HEADLAMP SUPPORT PANEL ASSY	Broken / Bent	907.40 FL	*907.40 FL
18	2		*HEADLAMP (LH/RH)	Broken / Mtg Broken	2,776.00 FL	*2,776.00 FL
19	1		*HEADLAMP HALOGEN BULB (RH)	Not Necessary	14.40 FL	*- FL
20	1		*RADIATOR	Bent	698.30 FL	*698.30 FL
21	1		*RADIATOR FAN BLADE, COWLING, MOTOR ASSY	Broken	792.95 FL	*792.95 FL
22	2		*RADIATOR BRACKET (RH/LH)	Not Necessary	13.00 FL	*- FL
23	1		*RADIATOR HOSE UPPER	Not Necessary	105.80 FL	*- FL
24	1		*RADIATOR HOSE LOWER	Not Necessary	52.70 FL	*- FL
25	1		*RADIATOR EXPANSION TANK	Broken	28.30 FL	*28.30 FL
26	2		*RADIATOR GUARD	Not fitted	40.00 FL	*- FL
27	2		*HORN UNIT (LH/RH)	Not Necessary	147.60 FL	*- FL
28	1		*HORN WIRE	Not Necessary	156.50 FL	*- FL
29	2		*FRONT FENDER (LH/RH)	Dented	1,326.00 FL	*1,326.00 FL
30	1		*FRONT FENDER APRON PANEL (RH)	Buckled	637.00 FL	*637.00 FL
31	1		*FRONT FENDER SHIELD (LH/RH)	O/s Torn / N/s Not Necessary	349.80 FL	*174.90 FL
32	1		*AIRCON CONDENSER	Bent	927.50 FL	*927.50 FL
33	1		*AIRCON SUCTION & LIQUID HOSE	Bent	624.00 FL	*624.00 FL
34	1		*AIRCON DISCHARGE HOSE	Bent	162.60 FL	*162.60 FL
35	1		*AIRCON COMPRESSOR	Not Necessary	2,578.00 FL	*- FL
36	1		*WIPER PANEL TOP GARNISH	Broken	222.60 FL	*222.60 FL
37	1		*WIPER CONTAINER	Damaged / Broken	61.90 FL	*61.90 FL
38	1		*WIPER CONTAINER MOTOR	Damaged	75.00 FL	*75.00 FL
39	1		*RH FRONT WHEEL RIM	Not Necessary	325.30 FL	*- FL
40	1		*RH FRONT WHEEL HUB CAB	Not Necessary	107.10 FL	*- FL
41	1		*RH FRONT WHEEL BEARING	Damaged	540.50 FL	*540.50 FL
42	1		*RH FRONT SHOCK ABSORBER (ASSY)	Distorted	342.20 FL	*342.20 FL
43	1		*RH FRONT SHOCK ABSORBER MOUNTING	Not Necessary	108.80 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
44	1		*RH FRONT DRIVE SHAFT	Distorted	1,030.80 FL	*1,030.80 FL
45	1		*RH RACK & PINION ASSY	Damaged	1,191.30 FL	*1,191.30 FL
46	1		*RH STG TIE END	Distorted	62.60 FL	*62.60 FL
47	1		*RH STABILIZER BAR	Not Necessary	252.30 FL	*- FL
48	1		*RH STABILIZER BAR BUSH	Not Necessary	16.40 FL	*- FL
49	1		*RH STABILIZER BAR LINK	Not Necessary	61.10 FL	*- FL
50	1		*RH STABILIZER BRACKET	Not Necessary	24.00 FL	*- FL
51	1		*RH FRONT SUSPENSION LOWER ARM	Distorted	529.30 FL	*529.30 FL
52	1		*RH KNUCKLE ARM	Distorted	552.00 FL	*552.00 FL
53	1		*ENGINE UNDER COVER	Torn	334.60 FL	*334.60 FL
54	1		*ENGINE CROSSMEMBER	Distorted	2,094.40 FL	*2,094.40 FL
55	1		*INTER COOLER	Bent	1,032.50 FL	*1,032.50 FL
56	2		*INTER COOLER MOUNTING	Not Necessary	25.90 FL	*- FL
57	1		*HOSE B TO INTER COOLER	Not Necessary	229.70 FL	*- FL
58	1		*HOSE C TO INTER COOLER INLET	Not Necessary	294.50 FL	*- FL
59	1		*PIPE TO INTER COOLER	Not Necessary	167.05 FL	*- FL
60	1		*PIPE TO INTER COOLER OUTLET	Not Necessary	244.55 FL	*- FL
61	1		*ACTUATOR - SWIRL CONTROL	Not Necessary	814.60 FL	*- FL
62	1		*ELECTRIC POWER STEERING	Not Necessary	3,641.00 FL	*- FL
63	1		*FRONT NUMBER PLATE	Dislodged	25.00 FS	*25.00 FS
64	1		*FRONT NO PLATE TRIM COVER	Broken	30.00 FS	*30.00 FS
65	2		*FRONT FENDER ADVERTISEMENT LOGO (LH/RH)	Necessary	200.00 FS	*200.00 FS
66	2		*FRONT DOOR COMFORT LOGO (LH/RH)	Not Necessary	150.00 FS	*- FS
67	2		*FRONT DOOR ADVERTISEMENT LOGO (LH/RH)	Not Necessary	200.00 FS	*- FS
68	1		*FRONT TYRE	Not Necessary	216.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	33,405.75	22,871.45
- List Item Discount on L Items 20.00/20.00% (\$\$)	6,516.95	4,523.29
Total Parts (\$\$)	26,888.80	18,348.16

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING.	New	1,600.00	1,000.00
2	SPRAY PAINTING CHARGE.	New	1,500.00	800.00
3	WIRING CHARGE.	New	100.00	30.00
4	TUFF KOTE.	New	150.00	40.00
5	TOWING CHARGE.	New	50.00	0.00
6	FRONT CHASSIS ALIGNMENT CHARGE.	New	400.00	0.00
7	REMOVE / REFIX UNDERCARRIAGE (FRT)	New	200.00	150.00
8	FRT WHEEL ALIGNMENT.	New	120.00	60.00
9	REMOVE / REFIX AIRCON & REFILL GAS.	New	150.00	80.00
10	REMOVE / REFIX GEARBOX / ENGINE	New	550.00	250.00
11	RE-SET FRT ABS SYSTEM. }	New	200.00	150.00
12	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE. }	New	480.00	0.00
Gross Labour Cost (\$\$)			5,500.00	2,560.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >