

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG19011407/EBA3Q2**Date:** 09/07/2020REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1800122248
Claimant
Vehicle No : SMG5561Z **Insured Vehicle No :** GR1288C
Date of Loss: 24/06/2019 Nature of Claim: TP Claim No: 5703728577SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMG5561Z**
Make & Model: RENAULT FLUENCE, 1.5 D DCI 110 (A) Engine No: K9KN837D197225
Reg. Date: 28/07/2015 (Man. Year: 2015) Chassis No: VF1LZLF0E53194188
Colour: Grey Odometer: 108172 km
Engine Capacity: 1461 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R17 Rear Tyre Size: 205/55 R17
Front Left Side: Pirelli 7 mm Rear Left Side: Pirelli 7 mm
Front Right Side: Pirelli 7 mm Rear Right Side: Pirelli 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	20,781.00	12,926.70	7,854.30	37.80
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,130.00	2,350.00	780.00	24.92
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	23,911.00	15,276.70	8,634.30	36.11
Approved Total (Overridden) (S\$)		10,000.00		
(S\$)	23,911.00	10,000.00	13,911.00	58.18
+ GST 7.00/7.00% (S\$)	1,673.77	700.00	973.77	58.18
Nett Amount (S\$)	25,584.77	10,700.00	14,884.77	58.18
+ Loss of Use (12.0 x S\$60.00/day) (S\$)		720.00		
Nett Liability (S\$)		11,420.00		
Global Sum Settlement (S\$)		11,400.00		

INSPECTION

Date of Assignment: 26/06/2019
Date Inspected: 26/06/2019 Inspected At: Green Forest Automobile Pte Ltd (Kaki Bukit)
8 Kaki Bukit Avenue 4, #05-25,,
Premier@Kaki Bukit
Singapore 415875
Estimated Period of Repair: 10.0 days

Adjuster: CHEN TSUE YEE

Manager: CHUA ZHEN LI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BOOT LID	Dented	2,350.00 F	*1,800.00 FL
2	1		*BOOT LID EMBLE LOGO	Necessary	95.00 F	*95.00 FL
3	1		*BOOT LID FLUENCE LOGO	Not Necessary	75.00 F	*- FL
4	1		*REAR BOOT LID NUMBER PLATE	Not Necessary	50.00 F	*- FL
5	1		*REAR BOOT LID NUMBER PLATE GARNISH	Broken	600.00 F	*600.00 FL
6	10		*REAR BOOT LID NUMBER PLATE GARNISH CLIPS	Necessary	80.00 F	*30.00 FL
7	1		*REAR BOOT LID WINDSCREEN SEAL	Necessary	250.00 F	*250.00 FL
8	1		*REAR BOOT LID INNER LOCK	Bent	350.00 F	*350.00 FL
9	1		*REAR BOOT LID INNER TRIM BOARD	Crushed	650.00 F	*650.00 FL
10	1		*REAR BOOT LID INNER RUBBER	Crushed	250.00 F	*250.00 FL
11	1		*REAR BOOT LID SHOCK ABSORBER -RH	Not Necessary	188.00 F	*- FL
12	1		*REAR TAIL LAMP -LED	N/S Not Necessary / O/S Broken	1,900.00 F	*552.00 FL
13	4		*REAR TAIL LAMP CLIPS	Necessary (2 PCS ONLY)	32.00 F	*16.00 FL
14	1		*REAR BUMPER	Broken	1,850.00 F	*1,020.00 FL
15	1		*REAR BUMPER CENTRE MOLDING	Not Necessary	380.00 F	*- FL
16	1		*REAR BUMPER LOWER COVER	Not Necessary	458.00 F	*- FL
17	1		*REAR BUMPER SIDE REFLECTOR	N/S Not Necessary /O/S Broken	376.00 F	*188.00 FL
18	2		*REAR BUMPER SIDE BRACKET	Broken	200.00 F	*200.00 FL
19	1		*REAR BUMPER REINFORCEMENT	Broken	500.00 F	*500.00 FL
20	2		*REAR BUMPER REINFORCEMENT BRACKET	Not Necessary	400.00 F	*- FL
21	4		*REAR BUMPER REVERSE SENSOR	Broken (1 PCS ONLY)	1,000.00 F	*200.00 FL
22	10		*REAR BUMPER CLIPS	Necessary	60.00 F	*30.00 FL
23	1		*REAR BUMPER TOWING COVER	Not Necessary	78.00 F	*- FL
24	1		*REAR END PANEL	Dented	900.00 F	*900.00 FL
25	1		*REAR END PANEL TOP GARNISH	Broken	300.00 F	*300.00 FL
26	4		*REAR END PANEL TOP GARNISH CLIPS	Necessary	34.00 F	*15.00 FL
27	1		*REAR FENDER -RH	Dented	1,750.00 F	*1,750.00 FL
28	1		*REAR FENDER INNER TRIM BOARD -RH	Not Necessary	665.00 F	*- FL
29	1		*REAR FENDER INNER TRIM BOARD CLIPS-RH	Not Necessary	60.00 F	*- FL
30	1		*REAR AXLE ASSY	Bent	4,250.00 F	*4,167.00 FL
31	1		*REAR TYRE -RH (50%)	Torn	300.00 F	*150.00 FL
32	1		*REAR RIM -RH	Cut	350.00 F	*350.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$) 20,781.00 14,363.00
- List Item Discount on L Items 0.00/10.00% (\$\$) 0.00 1,436.30

Total Parts (\$\$) 20,781.00 12,926.70

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE & INSTALL REAR WINDSCREEN	New	120.00	100.00
2	GUM	New	50.00	40.00
3	REMOVE & REFIX REAR RH UNDERCARRIAGE & AXLE ASSY	New	380.00	200.00
4	WHEEL ALIGNMENT (COMPUTER)	New	120.00	60.00
5	REMOVE & REFIX REAR PETROL TANK	New	120.00	0.00
6	TUFF KOTE	New	120.00	30.00
7	TO REMOVE & INSTALL REAR REVERSE SENSOR	New	120.00	20.00
8	TOWING CHARGES	New	100.00	0.00
9	PANEL BEATING	New	1,000.00	1,000.00
10	SPRAY PAINTING	New	1,000.00	900.00
Gross Labour Cost (\$\$)			3,130.00	2,350.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >