



Registration No. GBF 3335J

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	FRT BUMPER UPPER	1	CRACKED	\$ 264.00	\$ 264.00	
1.2	FRT BUMPER LOWER	1	CUT	\$ 252.00	\$ 252.00	
1.3	ENGINE UNDER COVER COMPLETE	1	CUT	\$ 84.00	\$ 84.00	
1.4	FRT BUMPER CLIPS	10	NECESSARY	\$ 2.40	\$ 24.00	
1.5	FRT BUMPER RETAINER LH	1	DEFORMED	\$ 26.40	\$ 26.40	
1.6	ENGINE UNDER COVER CLIPS	10	NECESSARY	\$ 2.40	\$ 24.00	
1.7	REAR BUMPER	1	CUT	\$ 258.00	\$ 258.00	
1.8	LHF TYRE 215/70/16R SOR 5 CAT B	1	CUT	\$ 244.20	\$ 244.20	
1.9	LHF METEL RIM 16"	1	BENT	\$ 216.00	\$ 216.00	
1.10	LHF S/ABSORBER	1	NOT NECESSARY	\$ 264.00		
1.11	LHF LOWER ARM	1	BENT	\$ 234.00	\$ 234.00	
1.12	LHF KNUCKLE ARM	1	BENT	\$ 288.00	\$ 288.00	
1.13	LHF TIE ROD	1	NOT NECESSARY	\$ 66.00		
1.14	LHF TIE ROD END	1	NOT NECESSARY	\$ 50.40		
1.15	LHF WHEEL HUB	1	BENT	\$ 252.00	\$ 252.00	
1.16	LHF WHEEL BEARING	1	NECESSARY			
1.17	LHF ANTI ROLL BAR LINK	1	NOT NECESSARY	\$ 66.00		
1.18	RHF LOWER ARM	1	BENT	\$ 234.00	\$ 234.00	
1.19	RHF KNUCKLE ARM	1	NOT NECESSARY	\$ 288.00		
1.20	RHF TIE ROD	1	NOT NECESSARY	\$ 66.00		
1.21	RHF TIE ROD END	1	NOT NECESSARY	\$ 50.40		
1.22	RHF WHEEL HUB	1	NECESSARY	\$ 252.00	\$ 252.00	
1.23	RHF WHEEL BEARING	1	NECESSARY			
1.24	RHF ANTI ROLL BAR LINK	1	NOT NECESSARY	\$ 66.00		
1.25	ENGINE CROSS MEMBER	1	BENT	\$ 312.00	\$ 312.00	
1.26	ENGINE CROSS MEMBER END 62210-4H401	1	BENT	\$ 900.00	\$ 900.00	
1.27	RHF LIFT SPRING ASSY	1	NOT NECESSARY	\$ 2,220.00		
1.28	REAR AXLE ASSY	1	NOT NECESSARY	\$ 3,900.00		

1.29	FUEL TANK ASSY	1	CUT	\$ 2,220.00	\$ 2,220.00	
1.30	LHF FENDER INNER SHIELD	1	MISSING	\$ 90.00	\$ 90.00	
1.31	LHF FENDER INNER SHIELD CLIP	8	NECESSARY	\$ 2.40	\$ 19.20	
1.32	LHF RIM CAP 16"	1	CUT	\$ 96.00	\$ 96.00	
1.33	SUPPORT PANEL TOP GARNISH	1	CRACKED	\$ 42.00	\$ 42.00	
	LABOUR DESCRIPTION					
1	SCOPE OF REPAIRS					
1.1	TO REPLACE AND RESPRAY FRT BUMPER					5
1.2	TO REPLACE AND RESPRAY REAR BUMPER					5
1.3	TO REFIX SENSOR AND DRILL SENSOR HOLE ON NEW BUMPER					0.5
1.4	TO REPAIR UNDER CARRIAGE					6
1.5	TO REPLACE ENGINE CROSS MEMBER 2 SETS					4
1.6	TO REPLACE RHF UNDERCARRIAGE					2
1.7	TO REPLACE LHF UNDER CARRIAGE					2
1.8	TO REPLACE RHR LIFT SPRING ASSY					2
1.9	TO REPLACE REAR AXLE					3
1.10	TO REPLACE FUEL TANK					2
1.11	TO SEND VEHICLE ALIGNMENT					1
COSTING		TOTAL PARTS COST			\$6,331.80	
		TOTAL MAN-HOUR				32.5

Registration No. GBF 3335J


Vehicle Inspected By



XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

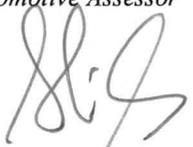

ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.