

ASS. REC. BY:

REF: CS/MS919012259/RIV/362

Serial Instruction:

SURVIVOR: Rasul ASSIGNMENT (Office)

From (Person): Mr Azian Binte of MGS Date/Time: 11.7.19 10.30am

Estimated Cost: Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLB 42595 Insured:

at Workshop in/s Shu Fatt Auto Tel: 62730119

of Block 1009 Bukit Merah Lane 3 #01-90

Policy No: 804285476M7 Claim No: 599096

Sum Insured: Excess: \$500.00

Make of Veh: D.O.A. 05.07.19
(Client's Record)

CA / REV / REP. / REV 24 HRS

Date/Time: 11.7.19 10.58am Person Contacted: Connie

H.O.D. Endorsement:

Vehicle: IN/OUT

Date/Time Action/Instruction (✓) Estimate

SLB 42595-X

12/7/19 Revert via merimen

12/7/19 Rece approved \$5372 from Ming Shao by merimen

12/7/19 Informed Pat c/A ex \$500 by email


19/8/19 Final fig \$5450.31 confirmed by email (Red 4744.59, 4790) (NO LS)

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Impact Vehicle No: **SLB 42595**
 at Workshop n/s: **SHU FATT AUTO**
 of **1009, BUKIT MEKAT LWS # 01-90**
 Insured: **MSIH**
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: **500**
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

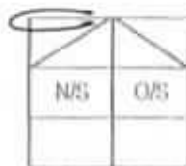

Bal. or Market Value: **58K**
 IDAG Accident Rpt: Consistent? : Yes or No
 GIA / P/L Soon: Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lum Sum: _____ % J Val: Yes or No

CA / **REV** / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: **SLB 42595** Yr Reg: **2016 / APR**
 Type: **M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /**
 Truck / Trailer or

Make: **Honda Jazz 1.5 VTI R** n.s. **1498**

Colour: **Red** A/C: Insured / Std / NI / NA

Sp. Reading: **043305** T/Factor: Insured / Std / NI / NA

Eng/No: _____

C/No: **JHMGK58506X 202137**

Gen. Cond: Good / Fair / Poor / Burnt

Steering: **Worder** / Jammed / Leaked / Burnt or

Brake: **Worder** / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: _____ R: _____

185/55R16

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

DUNLOP

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

05/07/19

D.O.I.

11/07/19

Survey hold at

SHU FATT

Des. of Damages: Fit / Rear / O/S / N/S / UIC / Rooftop or

FAS N/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

RECEIVED 20 AUG 2019

[Signature]
 19/8/2019

Date/Time, File Pass in?

☐ : Proli. Report
☐ : Final Report

Days Of Repair: **6**

Resurvey No. of Trip: **2**

Date/Time, File Return in?

20/8 - typist

Report Format: **Merimen**

Lump Sum / I.B.I.: (\$) **5450-31**

Add Fee: ☐ : Site Insp (\$)

☐ : Interview (\$)

☐ : Tech. Invs (\$)

☐ : Weekend (\$)

Survey Fee:

Transportation:

G + H3, 34

Photos

Others

TOTAL

200

11

211

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	10 Jul 2019 14:01 Sendback Est	10 Jul 2019 14:48 S\$9,969.40	11 Jul 2019 10:30 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured:	TAN YINGYI, ID: S8605664Z, Tel: +6596516214, Email: yingyi.tan15@gmail.com								
Vehicle Reg. No.:	SLB4259S	Date of Loss:	05/07/2019 23:00 - :59 [38 Months and 28 Days From LTA Reg Date (Man Yr)]						
Claim Type:	OD / 599096	Policy/Cover Note No.:	80428547QMY (Comprehensive) Coverage: 07/04/2019 - 06/04/2020						
		Excess:	S\$500.00						
Repairer:	Shu Fatt Auto Works (HQ) Block 1009 Bukit Merah Lane 3, #01-90, 159723 Bukit Merah - Tel: 62730119								
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Nor Azian Binte Noordin - 6594 2558]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 12/07/2019]								
Driver/Custodian:	TAN YINGYI (33 / Female), NRIC: S8605664Z, Tel: +6596516214 Email: yingyi.tan15@gmail.com								
Adj Asg. Remarks:	Car in. Survey & revert. Please contact us ASAP if you cannot attend this assignment.								
ASSOCIATED MAIL RECEIVED									
			View All	Compose Case Mail					
There are no mail for this case.									
ALL ASSOCIATED TASKS									
		View All	Search Tasks	Create New Task	Complete				
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

View Received Message

This mail is associated with :

SLB4259S (599096)

OD

Jul 5 2019 11:00PM

[TAN YINGYI]

Shu Fatt Auto Works

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From MSIG Insurance (Singapore) Pte. Ltd. (MSIG_SG), sent on 20/08/2019 14:05 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (\$5450.31) - SLB4259S - Claim Handler: Nor Azlan Binte Noordin

Approved:5450.31:CHECK ITEMS TO BE VERIFIED AND CONFIRMED.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Nor Azlan Binte Noordin

Date: 19 Aug 2019

Preliminary Advice

Vehicle No	: SLB4259S	Accident Date	: 05/07/2019
Make	: HONDA JAZZ	Policy No.	: 80428547QMY
Assignment Date	: 11/07/2019	Excess	: S\$500.00
Date of Inspection	: 11/07/2019	Est. Duration of Repair	: 6.00
Inspection At	: SHU FATT AUTO WORKS (HQ) BLOCK 1009 BUKIT MERAH LANE 3, #01-90 SINGAPORE 159723		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	10,194.90 (incl.supplementary \$225.50)
Revised Amount	:S\$	5,450.31 (incl.supplementary \$225.50)
Check Items (Estimated)	:S\$	0.00
Total	:S\$	5,450.31

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	58,000.00
COE / PARF Rebate	:S\$	39,037.00
Salvage Value	:S\$	
Margin for Repair	:S\$	18,963.00

Remarks

(X) The vehicle is economical for repair.

() The above survey was conducted on a 'without prejudice' basis.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Tuesday, 23 July 2019 10:04 AM
To: Pat-Shu Fatt Auto Works; Rasul (LKKAUTO); SUR
Subject: RE: SLB 4259 S - supplementary

Dear Pat,

Insurance approved supplementary.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Pat-Shu Fatt Auto Works <shufatt@singnet.com.sg>
Sent: Monday, 22 July 2019 12:52 PM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>; Rasul (LKKAUTO) <Rasul@lkkauto.com>
Subject: RE: SLB 4259 S - supplementary

Dear Veron / Rasul,

Supplementary submitted in Merimen..pending approval.

Thanks & regards,

Pat

Shu Fatt Auto Works

From: Veron Chen (LKKAUTO) [<mailto:veronchen@lkkauto.com>]
Sent: Wednesday, 17 July, 2019 9:29 AM
To: Rasul (LKKAUTO); Pat-Shu Fatt Auto Works
Subject: RE: SLB 4259 S - supplementary

Dear Pat,

Please submit supplementary in merimen.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Rasul (LKKAuto)

Sent: Wednesday, 17 July 2019 9:22 AM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; Pat-Shu Fatt Auto Works <shufatt@singnet.com.sg>

Subject: RE: SLB 4259 S - supplementary

Hi Pat,

Aside to Veron kindly assist


Best Regards,

Rasul | Assessor

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Rasul@lkkauto.com | fax: 6841-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

 

Auto
Consultants
Pte Ltd

Save the Earth. Print only when necessary.

From: Pat-Shu Fatt Auto Works [<mailto:shufatt@singnet.com.sg>]

Sent: Tuesday, 16 July, 2019 2:36 PM

To: Rasul (LKKAuto)

Subject: SLB 4259 S - supplementary

Dear Rasul,

Reference to your re-survey yesterday, we will be submitting a supplementary for :-

1. Left wing bracket
2. Left front inner s-member reinforcement
3. Left front outer s-member reinforcement
4. Resonator

Thanks & regards,

Pat

Shu Fatt Auto Works

View Received Message

This mail is associated with :

SLB4259S (599096)

OD

Jul 5 2019 11:00PM

[TAN YINGYI]

Shu Fatt Auto Works

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From MSIG Insurance (Singapore) Pte. Ltd. (MSIG_SG), sent on 23/07/2019 10:00 AM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$5597.50) - SLB4259S - Claim Handler: Nor Azian Binte Noordin

Approved:5597.50:CHECK ITEMS TO BE VERIFIED AND CONFIRMED.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Nor Azian Binte Noordin

Date: 22 Jul 2019

Preliminary Advice

Vehicle No	: SLB4259S	Accident Date	: 05/07/2019
Make	: HONDA JAZZ	Policy No.	: 80428547QMY
Assignment Date	: 11/07/2019	Excess	: S\$500.00
Date of Inspection	: 11/07/2019	Est. Duration of Repair	: 6.00
Inspection At	: SHU FATT AUTO WORKS (HQ) BLOCK 1009 BUKIT MERAH LANE 3, #01-90 SINGAPORE 159723		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	10,194.90 (incl.supplementary \$225.50)
Revised Amount	:S\$	5,597.50 (incl.supplementary \$225.50)
Check Items (Estimated)	:S\$	918.50
Total	:S\$	6,516.00

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	58,000.00
COE / PARF Rebate	:S\$	39,037.00
Salvage Value	:S\$	
Margin for Repair	:S\$	18,963.00

Remarks

(X) The vehicle is economical for repair.

(X) Kindly approved on the supplementary

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Friday, 12 July 2019 5:07 PM
To: SUR; Pat-Shu Fatt Auto Works
Subject: SLB 4259S-DOA: 5/7/2019 (MSIG OD)

Dear Pat,

As instructed by our client , please proceed to repair the **insured vehicle SLB 4259S on part by part (Excess S500/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

View Received Message

This mail is associated with :

SLB4259S (599096)

OD

Jul 5 2019 11:00PM

[TAN YINGYI]

Shu Fatt Auto Works

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From MSIG Insurance (Singapore) Pte. Ltd. (MSIG_SG), sent on 12/07/2019 16:40 PM.

To LKK_HQ

Subject Alert - Adj Mandate Approved (S\$5372.00) - SLB4259S - Claim Handler: Nor Azian Binte Noordin

Approved:5372.00:CHECK ITEMS TO BE VERIFIED AND CONFIRMED.

DOCUMENTS SUMMARY

There are no documents.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Nor Azian Binte Noordin

Date: 12 Jul 2019

Preliminary Advice

Vehicle No	: SLB4259S	Accident Date	: 05/07/2019
Make	: HONDA JAZZ	Policy No.	: 80428547QMY
Assignment Date	: 11/07/2019	Excess	: S\$500.00
Date of Inspection	: 11/07/2019	Est. Duration of Repair	: 6.00
Inspection At	: SHU FATT AUTO WORKS (HQ) BLOCK 1009 BUKIT MERAH LANE 3, #01-90 SINGAPORE 159723		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front n/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	9,969.40
Revised Amount	:S\$	5,372.00
Check Items (Estimated)	:S\$	918.50
Total	:S\$	6,290.50

Lump Sum Repair	:S\$	
-----------------	------	--

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	58,000.00
COE / PARF Rebate	:S\$	39,037.00
Salvage Value	:S\$	
Margin for Repair	:S\$	18,963.00

Remarks

(X) The vehicle is economical for repair.

() The above survey was conducted on a 'without prejudice' basis.

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	5664Z
Vehicle Details	
Vehicle No.:	SLB42595
Vehicle to be Exported:	No
Intended Deregistration Date:	12 Jul 2019
Vehicle Make:	HONDA
Vehicle Model:	JAZZ 1.5 VTIR CVT ABS D/AIRBAG 2WD
Primary Colour:	Red
Manufacturing Year:	2016
Engine No.:	L15B31020834
Chassis No.:	JHMGK5850GX202137
Maximum Power Output:	96.0 kW (128 bhp)
Open Market Value:	\$16,645.00
Original Registration Date:	07 Apr 2016
First Registration Date:	07 Apr 2016
Transfer Count:	0
Actual ARF Paid:	\$11,645.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	06 Apr 2026
PARF Rebate Amount:	\$8,733.00
Intended COE Rebate Details	
COE Expiry Date:	06 Apr 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$45,000.00
COE Rebate Amount:	\$30,304.00
Total Rebate Amount:	\$39,037.00

The information contained herein is correct as at 12 Jul 2019

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	06/07/2019 13:18
Date Of Accident	05/07/2019 23:00
Exact Location Of Accident	ALONG DELTA ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLB4259S
Insured/Policyholder	
Name Of Registered Owner	TAN YINGYI
NRIC No	S8605664Z
Email Address	YINGYI.TAN15@GMAIL.COM
Mobile Phone No	(LOCAL) +65-96516214
Alternative Phone No	OTHERS-96516214

Vehicle Particulars

Manufacturer	HONDA
Model	JAZZ-1.5 VTIR CVT (A)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	80428547
Cover Note Number	

Driver

Name of Driver	TAN YINGYI
NRIC No	S8605664Z
Date Of Birth	15/02/1986
Occupation	INDOOR
Date Of Driving Pass	11/04/2005
Driving Experience	14 YEARS AND 2 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-96516214
Fax Number	
Contact Number	OTHERS-96516214
EMail Address	YINGYI.TAN15@GMAIL.COM

Address	7 KIM TIAN ROAD #33-07 HIGHLINE RESIDENCES
Postcode	168592
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

ON 05/07/19 AT ABOUT 2300HRS, I WAS TRAVELLING ON THE 2ND LANE ALONG DELTA ROAD TOWARDS BT TIMAH. THERE WAS MERGING LANE BETWEEN LANE 1 AND 2. AND I SAW THE BUS AND VEHICLE C MOVING TOWARDS THE MERGING LANE. SO I DECIDED TO FILTER OUT. I WAS IN THE MIDST OF FILTERING WHEN VEHICLE B BRAKED. I WAS UNABLE TO STOP IN TIME AND COLLIDED INTO VEHICLE B. WHEN I ALIGHTED FROM MY VEHICLE, I REALIZED THAT IT WAS A CHAIN COLLISION INVOLVING A TOTAL OF 3 VEHICLES, MY VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. NO ONE WAS INJURED.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLE3709B
Vehicle Make/Model/Colour	TOYOTA / SIENTA
Details Of Properties	VEH B
Vehicle Category	PRIVATE CAR
Name of Driver	ABDUL RAHIM BIN ABDUL WAHID
NRIC/Passport Number	S16353801
Contact Number	
Address	
Postcode	
Insurance Company Name	

Nature Of Damage

No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	GT808Z
Vehicle Make/Model/Colour	TOYOTA / HIACE
Details Of Properties	VEH C
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	LENG PENG KHENG
NRIC/Passport Number	S1520886D
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.


Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Sketch Plan #2

SKETCH PLAN

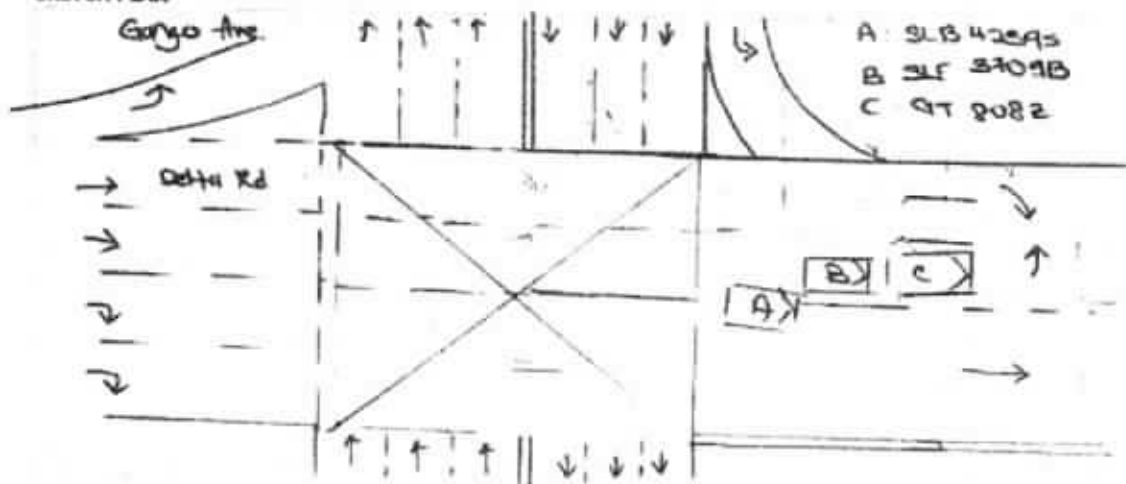

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 5/11/19 at about 2300 hrs I was travelling the 2nd lane along Delta Rd towards Bt Merah. There was a merging lane between lane 1 and 2. And I saw the driver and veh C, moving towards the merging lane. So I decided to flicker out. I was in the midst of flicking when veh B braked. I was unable to stop in time and collided into veh B. When I righted from my vehicle I realized there is was a chain collision involving a total of 3 vehicles. My vehicle sustained damage to the front portion as we was injured.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/TIN No.:

Shu Fatt Auto Works
Singapore
159723

Claim Reference:
Assessment number: SF089
Version: 1810
Date calculated: 10/07/2019 2:30 PM

Full Report
Registration: SLB4529S
Printed: 10/07/2019 2:30 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	Shu Fatt	Currency:	SGD
Claim Reference:		Date of Incident:	05/07/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	HONDA		
Model:	JAZZ (GK3/GK5/GK7)		
Sub Model:	BASE MODEL		
Model Sheet Number:	35 CJ 01		
Registration:	SLB4529S		
VIN number:			
Odometer:			
Model Specs			
FROM MODEL 2016	AUTO AIR CON	FOG LAMPS	DRL HEADLAMPS
CHROME D/MIRROR CVR	1.5 LTR 88KW	PRODUCT THAILAND	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD		

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
NO NUMBER	RUST PROOFING BODY SHELL PART		2.0	10.00
NO NUMBER	FRONT BUMPER CARRIER RUST PROTECT PROOF		1.0	5.00
8101A2 ZAX	RENEW FRONT BUMPER		11.0	55.00
	INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS			
8101B1)	R + R FRONT BUMPER SUPPORT		1.0	5.00
7121A0)	R + R LEFT HEADLAMP		4.0	20.00
7121B6)	R + R RIGHT HEADLAMP		4.0	20.00
812100	RENEW BONNET		10.0	50.00
	INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE			
8121B6	R + R L/BONNET HINGE		4.0	20.00
8121B7	R + R R/BONNET HINGE		4.0	20.00
8131H3	R + R R/F WHEEL ARCH TRIM		4.0	20.00

Shu Fatt Auto Works Singapore 159723

Claim Reference:

Assessment number: SF089

Version: 1810

Date calculated: 10/07/2019 2:30 PM

Full Report

Registration: SLB4529S

Printed: 10/07/2019 2:30 PM

Code	Description	WU	Price SGD
8131A7	R + R RIGHT FRONT WHEELHOUSE SHELL	3.0	15.00
8131B1	R + R LOWER ENGINE PROTECTION	3.0	15.00
NO NUMBER	R + R LEFT FRONT WING	5.0	25.00
	INCLUDES: R + R LEFT FRONT INNER WING COVER		
NO NUMBER	RENEW FRONT PANEL CPL	15.0	75.00
NO NUMBER	RENEW L/F SIDEMEMBER CLOSING PANEL	5.0	25.00
NO NUMBER	RENEW R/F SIDEMEMBER CLOSING PANEL	5.0	25.00
NO NUMBER	RENEW L/FRT SIDE MEMBER	22.0	110.00
NO NUMBER	RENEW L/F WHEELHOUSE REINFORCEMENT	20.0	100.00
NO NUMBER	RENEW L/F UPPER WHEELHOUSE REINFORCEMENT	25.0	125.00
8151A0	RENEW LEFT FRONT DOOR	33.0	165.00
	INCLUDES: R + R DOOR, CONVERT OR RENEW ALL ATTACHED PARTS AS NECESSARY		
831120	WINDSCREEN R + R	30.0	150.00
	INCLUDES: SCREEN WIPER ARM, COWL COVER AND MOULDINGS REMOVE AND REFIT		
710100	R + R BATTERY	3.0	15.00
114100)	R + R RADIATOR CPL WITH ATTACHED PARTS	14.0	70.00
1211D5	R + R AIR FILTER HOUSING	4.0	20.00
616100)	R + R AIR CONDITIONING CONDENSER	4.0	20.00
620020	REFILL + VENT AIR CONDITIONING	7.0	35.00
0742	R/F WING REPAIR	30.0*	150.00
1120	R/F WHEELHOUSE REINF REPAIR	30.0*	150.00
1168	R/F UP W-HOUSE REINF REPAIR	30.0*	150.00
0340	FRT BUMPER SUPPORT CAVITY PROTECTION		
Labour Cost		Hrs	WU
Panel / Mechanical Labour		33.00	330.0
Total of Labour			1,650.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT BUMPER SUPPORT NEW PART PAINTING	8.0
	BONNET NEW PART PAINTING	16.0
	L/F WING NEW PART PAINTING	10.0
	FRONT PANEL CPL SURFACE PAINT	6.0
	L/F WHEELHOUSE REINF SURFACE PAINT	4.0

Shu Fatt Auto Works
Singapore
159723

Claim Reference:
 Assessment number: SF089
 Version: 1810
 Date calculated: 10/07/2019 2:30 PM

Full Report
 Registration: SLB4529S
 Printed: 10/07/2019 2:30 PM

Paint Work	SYSTEM AZT	Time Basis 10WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	L/F UP W-HOUSE REINF SURFACE PAINT	4.0
	L/F SIDE MEMBER SURFACE PAINT	5.0
	L/S-MEMB CLOSING PNL SURFACE PAINT	4.0
	R/S-MEMB CLOSING PNL SURFACE PAINT	4.0
	LEFT FRONT DOOR NEW PART PAINTING	16.0
	FRONT BUMPER NEW PART PAINT K1R	12.0
	R/F WING REPAIR PAINTING >50%	13.0
	L/R DOOR REPAIR PAINTING >50%	23.0
	R/F WHEELHOUSE REINF SURFACE PAINT	4.0
	R/F UP W-HOUSE REINF SURFACE PAINT	4.0

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT NEW PART PAINTING	11.35
0471	BONNET NEW PART PAINTING	46.96
0741	L/F WING NEW PART PAINTING	19.09
1009	FRONT PANEL CPL SURFACE PAINT	12.70
1119	L/F WHEELHOUSE REINF SURFACE PAINT	4.48
1167	L/F UP W-HOUSE REINF SURFACE PAINT	4.48
1203	L/F SIDE MEMBER SURFACE PAINT	5.98
1305	L/S-MEMB CLOSING PNL SURFACE PAINT	1.25
1306	R/S-MEMB CLOSING PNL SURFACE PAINT	1.25
1481	LEFT FRONT DOOR NEW PART PAINTING	45.41
0283	FRONT BUMPER NEW PART PAINT K1R	56.09
0742	R/F WING REPAIR PAINTING >50%	9.88
1781	L/R DOOR REPAIR PAINTING >50%	30.42
1120	R/F WHEELHOUSE REINF SURFACE PAINT	4.48
1168	R/F UP W-HOUSE REINF SURFACE PAINT	4.48

Labour Cost - Paint

	Factor	50.00 SGD/h	Hrs	WU	Price SGD
	Time Paint			133.0	
	Preparation Main Work Metal		2.50	25.0	125.00
	Preparation Comp. Work Plastic		0.50	5.0	25.00
	Total	10 WU/h	16.30	163.0	815.00

Shu Fatt Auto Works Singapore 159723

Claim Reference:

Assessment number: SF089

Version: 1810

Date calculated: 10/07/2019 2:30 PM

Full Report

Registration: SLB45295

Printed: 10/07/2019 2:30 PM

Material Cost - Paint

New Part Painting
New Part Painting - Plastic K1R
Repair Painting
Surface-/Blend Paint
Material-constant Metal Preparation
Material-constant Plastic
Total

Price SGD
122.81
56.09
40.30
39.10
28.60
9.00
295.90

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01/01	Price SGD
0283	FRONT BUMPER	71101T5LT10ZZ	71101T5LT10ZZ	380.00	✓
0317	L/F OUT BUMPER BRKT	71198T5A000	71198T5A000	8.00	✓
0318	R/F OUT BUMPER BRKT	71193T5A000	71193T5A000	8.00	✓
0319	L/F UPP BUMPER BRKT	71190T5A000	71190T5A000	18.00	✓
0340	FRT BUMPER SUPPORT	71130T5LT00ZZ	71130T5LT00ZZ	160.00	✓
0343	FRONT BUMPER SPOILER	71110T5A000	71110T5A000	125.00	✓
0350	FRT BUMPER CLAMP KIT	91505TM8003	91505TM8003	30.00	✓
0351	FRT LWR BUMP GRILLE	71102T5A000	71102T5A000	38.00	✓
0410	GRILLE	71120T5AU00	71120T5AU00	220.00	✓
0471	BONNET	60100T5LT00ZZ	60100T5LT00ZZ	260.00	✓
0475	L/BONNET HINGE	60170T5A000ZZ	60170T5A000ZZ	25.00	✓
0476	R/BONNET HINGE	60120T5A000ZZ	60120T5A000ZZ	25.00	✓
0481	BONNET INSULATION	74141T5LT00	74141T5LT00	70.00	✓
0501	L/BONNET SEAL	74192T5A000	74192T5A000	55.00	✓
0502	R/BOONET SEAL	74142T5A000	74142T5A000	55.00	✓
0503	L/F BONNET GASKET	74122T5A000	74122T5A000	55.00	✓
0504	R/F BONNET GASKET	74121T5A000	74121T5A000	55.00	✓
0561	L/F HEADLAMP	33150T5AJ01	33150T5AJ01	750.00	✓
0637	L/F FOG LAMP	33950TY0003	33950TY0003	210.00	✓
0639	L/DAYT RUNNING LAMP	33250T5AG01	33250T5AG01	160.00	✓
0643	L/F BUMPER COVER	71108T5AJ00	71108T5AJ00	35.00	✓
0741	L/F WING	60261T5HH10ZZ	60261T5HH10ZZ	155.00	✓
0789	L/F WING CLAMP KIT	934050601608	934050601608	20.00	✓
0841	L/WHEELHOUSE SHELL	74150T5LT00	74150T5LT00	85.00	✓
1009	FRONT PANEL CPL	60400T5LT01ZZ	60400T5LT01ZZ	310.00	✓
1119	L/F WHEELHOUSE REINF	04684T5LT00ZZ	04684T5LT00ZZ	230.00	✓
1167	L/F UP W-HOUSE REINF	60710T5LP00ZZ	60710T5LP00ZZ	180.00	✓
1203	L/F SIDE MEMBER	60911T5NM00ZZ	60911T5NM00ZZ	480.00	✓
1305	L/S-MEMB CLOSING PNL	60946T5A300ZZ	60946T5A300ZZ	25.00	✓
1306	R/S-MEMB CLOSING PNL	60846T5A300ZZ	60846T5A300ZZ	25.00	✓
1398	R/COWL PANEL TRIM	74147T5A000	74147T5A000	200.00	✓

Shu Fatt Auto Works Singapore 159723

Claim Reference:

Assessment number: SF089

Version: 1810

Date calculated: 10/07/2019 2:30 PM

Full Report

Registration: SLB4529S

Printed: 10/07/2019 2:30 PM

Code	Description	Part Number	Supplier	Price SGD
1419	L/WINDSCREEN MLDG	73162T5AJ02	X ^{an}	280.00
1481	LEFT FRONT DOOR	67050T5LY00ZZ	repair	460.00
1655	L/F UPP MOULDING SET	67364T5A003	? X	70.00
1661	L/F WINDOW MOULDING	72450T5HH01	? X	75.00
8780	ENGINE INSULATION	74110T5HH00	X	155.00
1000	grille clips	grille clips	an X	20.00
1001	low bump clips	low bump clips	an X	30.00
1002	running light	running light	? X	160.00
1003	eng cover clips	eng cover clips	X	25.00
1004	wiper gar clips	wiper gar clips	X	28.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings	0.00
Subtotal	5,755.00
Addition(+10.00%)	575.50
Total	6,330.50

Extras

Code	Description	Price SGD
1005	number plate number plate	55.00*
1006	coolant coolant	18.00* ✓ nee
1007	lh tyre lh tyre	280.00*
1008	repair wiring repair wiring	60.00*
1009	tyre replacement tyre balance	60.00*
1010	anti rust anti rust	120.00*
1011	alignment alignment	120.00*
1012	reset ecu reset ecu	150.00*
	Total Extras	863.00

UK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Rasul
Hp 90010068
6 days
P/P
EXCESS: 500
REVERT
11/07/19 @ 1630

Resurvey before paint

Shu Fatt Auto Works
Singapore
159723

Claim Reference:
Assessment number: SF089
Version: 1810
Date calculated: 10/07/2019 2:30 PM

Full Report
Registration: SLB4529S
Printed: 10/07/2019 2:30 PM

Final Calculation

	SGD	SGD
Parts	5,755.00	
Addition(+10.00%)	575.50	
Total Parts		6,330.50
Labour Time Base 10 WU/h		
Total 330.0 WU X 50.00 SGD/h	965 1,650.00	
Total of Labour		1,650.00
Additional Costs		
Rustproofing		
Rate 3.0 WU X 50.00 SGD/h	15.00	
Total Of Additional Costs		15.00
Total Of Extras		863.00
Paint Work Time Base 10 WU/h		
Labour Cost 163.0 WU X 50.00 SGD/h	7140 815.00	
Material Cost	268.90 295.90	
Total Paint Including Material		1,110.90
Repair Cost Excludes GST	10,194.90	9,969.40
GST (+7.00%)		697.86
Repair Cost Included GST		10,667.26

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS



樹發汽車修理廠 SHU FATT AUTO WORKS

BLOCK 1009 BUKIT MERAH LANE 3 #01-90 SINGAPORE 159723 TEL: 6273 0119 FAX: 6270 7065
Co. Reg. No. 09062400M GST Reg. No. 09-062400-M

(SUPPLEMENTARY)

INSURER: **MSIG Insurance (Singapore) Pte. Ltd. (HQ)**

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	WSK/JW/SF-SLB4259S
Policy No:	80428547QMY	Date of Loss:	05/07/2019
Vehicle Reg. No.:	SLB4259S	Driveable?	
Driver Age/Info:	33 / FEMALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	TAN YINGYI	Contact No:	+6596516214
Driver:	TAN YINGYI		
Make/Model:	HONDA JAZZ, 1.5 VTIR CVT (A)	Vehicle Reg. Date:	07/04/2016
Vehicle Colour:	RED		
Engine No:	L15B31020834	Chassis No:	JHMGK5850GX202137
Odometer:	43305 KM		
Paint Type:			
Total Loss?	NO		
Est. Duration of Repair (day)	8		
Description of Accident/Loss	SLB4259S INVOLVED IN AN ACCIDENT WITH OTHER VEHS		
Present Location:	SHU FATT AUTO WORKS (HQ)		

COST OF CLAIMS	Amount
Parts	225.50
Miscellaneous Items	0.00
Labour	0.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (\$\$)	225.50
+ GST 7.00% (\$\$)	15.79
Nett Amount (\$\$)	241.29
+ Previous Estimates (\$\$)	10,132.26
Claim Total (\$\$)	10,373.55

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS**Reference****Part Source:** MRM-SG **Version:** 1.0 (Last Synchronised: 22 Jul 2019)**Parts:** 144 HONDA JAZZ 1.5 VTIR CVT (A) (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** Shu Fatt Auto Works/SLB4259S/22/07/2019 12:50**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*Left front wing bracket <i>bt</i>	0.00	0.00	*40.00 F ✓
2	1		*Resonator <i>csa</i>	0.00	0.00	*85.00 F ✓
3	1		*Left front wheelhouse panel <i>bt</i>	0.00	0.00	*40.00 F ✓
4	1		*Left inner wheelhouse panel <i>bt</i>	0.00	0.00	*40.00 F ✓
Sub Total (S\$)						205.00
+ Margin on L,N Items 10.00% (S\$)						20.50
Total Parts (S\$)						225.50

F=Franchise part.

Shu Fatt Auto Works/SLB4259S/22/07/2019 12:50. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

There are no labour items selected.

Shu Fatt Auto Works/SLB4259S/22/07/2019 12:50, Not valid without Reference section.

Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

Shu Fatt Auto Works
Singapore
159723

Claim Reference:
Assessment number: SF089
Version: 1810
Date calculated: 06/08/2019 5:01 PM

Finalised
Supplementary
Full Report
Registration: SLB 4259 S
Printed: 06/08/2019 5:01 PM

Summary Information

Claim Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	Shu Fatt	Currency:	SGD
Claim Reference:		Date of Incident:	05/07/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle Manufacturer:	HONDA		
Model:	JAZZ (GK3/GK5/GK7)		
Sub Model:	BASE MODEL		
Model Sheet Number:	35 CJ 01		
Registration:	SLB 4259 S		
VIN number:			
Odometer:			
Model Specs			
FROM MODEL 2016	AUTO AIR CON	FOG LAMPS	DRL HEADLAMPS
CHROME D/MIRROR CVR	1.5 LTR 88KW	PRODUCT THAILAND	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD		

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h WU Price SGD
8101A2 ZAX	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS	11.0	55.00
8101B1)	R + R FRONT BUMPER SUPPORT	1.0	5.00
7121A0)	R + R LEFT HEADLAMP	4.0	20.00
7121B6)	R + R RIGHT HEADLAMP	4.0	20.00
812100	RENEW BONNET INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE	10.0	50.00
8131H3	R + R R/F WHEEL ARCH TRIM	4.0	20.00
8131A7	R + R RIGHT FRONT WHEELHOUSE SHELL	3.0	15.00
NO NUMBER	R + R LEFT FRONT WING INCLUDES: R + R LEFT FRONT INNER WING COVER	5.0	25.00

Shu Fatt Auto Works Singapore 159723

Claim Reference:

Assessment number: SF089

Version: 1810

Date calculated: 06/08/2019 5:01 PM

Full Report

Registration: SLB 4259 S

Printed: 06/08/2019 5:01 PM

Code	Description	WU	Price SGD
NO NUMBER	RENEW FRONT PANEL CPL	15.0	75.00
NO NUMBER	RENEW L/F WHEELHOUSE REINFORCEMENT	20.0	100.00
NO NUMBER	RENEW L/F UPPER WHEELHOUSE REINFORCEMENT	25.0	125.00
NO NUMBER	RENEW LEFT FRONT WHEELHOUSE CLOSING	6.0	30.00
NO NUMBER	RENEW LEFT FRONT WHEELHOUSE CLOSING	6.0	30.00
710100	R + R BATTERY	3.0	15.00
114100)	R + R RADIATOR CPL WITH ATTACHED PARTS	14.0	70.00
1211D5	R + R AIR FILTER HOUSING	4.0	20.00
616100)	R + R AIR CONDITIONING CONDENSER	4.0	20.00
620020	REFILL + VENT AIR CONDITIONING	7.0	35.00
NN	Resonator R&R / NEW PARTS - this part zero on item.	2.0*	10.00
1203	L/F SIDE MEMBER REPAIR	15.0*	75.00
1305	L/S-MEMB CLOSING PNL REPAIR	10.0*	50.00
1481	LEFT FRONT DOOR REPAIR	20.0*	100.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		19.30	193.0
Total of Labour			965.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	BONNET NEW PART PAINTING	16.0
	L/F WING NEW PART PAINTING	10.0
	FRONT PANEL CPL SURFACE PAINT	6.0
	L/F WHEELHOUSE REINF SURFACE PAINT	4.0
	L/F WHEELHOUSE PANEL SURFACE PAINT	4.0
	L/INN W-HOUSE PANEL SURFACE PAINT	4.0
	L/F UP W-HOUSE REINF SURFACE PAINT	4.0
	L/F SIDE MEMBER SURFACE PAINT	5.0
	L/S-MEMB CLOSING PNL SURFACE PAINT	4.0
	LEFT FRONT DOOR NEW PART PAINTING	16.0
	FRONT BUMPER NEW PART PAINT K1R	12.0
	L/R DOOR REPAIR PAINTING >50%	23.0
	R/S-MEMB CLOSING PNL SURFACE PAINT	4.0
	spray painting L/Wing bracket - spray painting not provided in quotation. But part needs spray painting.	6.0*

Shu Fatt Auto Works

Singapore

159723

Claim Reference:

Assessment number: SF089

Version: 1810

Date calculated: 06/08/2019 5:01 PM

Full Report

Registration: SLB 4259 S

Printed: 06/08/2019 5:01 PM

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	46.96
0741	L/F WING NEW PART PAINTING	19.09
1009	FRONT PANEL CPL SURFACE PAINT	12.70
1119	L/F WHEELHOUSE REINF SURFACE PAINT	4.48
1121	L/F WHEELHOUSE PANEL SURFACE PAINT	1.25
1123	L/INN W-HOUSE PANEL SURFACE PAINT	1.25
1167	L/F UP W-HOUSE REINF SURFACE PAINT	4.48
1203	L/F SIDE MEMBER SURFACE PAINT	5.98
1305	L/S-MEMB CLOSING PNL SURFACE PAINT	1.25
1481	LEFT FRONT DOOR NEW PART PAINTING	45.41
0283	FRONT BUMPER NEW PART PAINT K1R	56.09
1781	L/R DOOR REPAIR PAINTING >50%	30.42
1306	R/S-MEMB CLOSING PNL SURFACE PAINT	1.25

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	50.00 SGD/h		
Time Paint		118.0	
Preparation Main Work Metal	2.50	25.0	125.00
Preparation Comp. Work Plastic	0.50	5.0	25.00
Total	10 WU/h	148.0	740.00

Material Cost - Paint

	Price SGD
New Part Painting	111.46
New Part Painting - Plastic K1R	56.09
Repair Painting	30.42
Surface-/Blend Paint	32.64
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	268.21

Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01/01	Price SGD
0283	FRONT BUMPER	71101T5LT10ZZ			380.00
0317	L/F OUT BUMPER BRKT	71198T5A000			8.00
0319	L/F UPP BUMPER BRKT	71190T5A000			18.00
0350	FRT BUMPER CLAMP KIT	91505TM8003			30.00
0410	GRILLE	71120T5AU00			220.00

Shu Fatt Auto Works
Singapore
159723

Claim Reference:

Assessment number: SF089

Version: 1810

Date calculated: 06/08/2019 5:01 PM

Full Report

Registration: SLB 4259 S

Printed: 06/08/2019 5:01 PM

Code	Description	Part Number	Supplier	Price SGD
0471	BONNET	60100T5LT00ZZ		260.00
0561	L/F HEADLAMP	33150T5AJ01		750.00
0637	L/F FOG LAMP	33950TY0003		210.00
0639	L/DAYT RUNNING LAMP	33250T5AG01		160.00
0643	L/F BUMPER COVER	71108T5AJ00		35.00
0741	L/F WING	60261T5HH10ZZ		155.00
0745	L/F WING BRACKET	60690T5A300ZZ		40.00
0789	L/F WING CLAMP KIT	934050601608		25.00
0841	L/WHEELHOUSE SHELL	74150T5LT00		85.00
1009	FRONT PANEL CPL	60400T5LT01ZZ		310.00
1119	L/F WHEELHOUSE REINF	04684T5LT00ZZ		70.00
1121	L/F WHEELHOUSE PANEL	60945T5LT00ZZ		40.00
1123	L/INN W-HOUSE PANEL	60944T5LT00ZZ		40.00
1167	L/F UP W-HOUSE REINF	60710T5LP00ZZ		60.00
1014	Resonator	Resonator		85.00
f: OEM Parts				Savings 0.00
n: Non-OEM Parts				Subtotal 2,981.00
u: Used parts				Addition(+10.00%) 298.10
Total				3,279.10

Extras

Code	Description	Price SGD
1006	coolant coolant	18.00*
1010	anti rust anti rust	80 120.00*
1012	reset ecu reset ecu	100 150.00*
Total Extras		288.00

Shu Fatt Auto Works
Singapore
159723

Claim Reference:
Assessment number: SF089
Version: 1810
Date calculated: 06/08/2019 5:01 PM

Full Report
Registration: SLB 4259 S
Printed: 06/08/2019 5:01 PM

Final Calculation

	SGD	SGD
Parts	2,981.00	
Addition(+10.00%)	298.10	
Total Parts		3,279.10
Labour Time Base 10 WU/h		
Total 193.0 WU X 50.00 SGD/h	965.00	
Total of Labour		965.00
Total Of Extras		288.00
Paint Work Time Base 10 WU/h		
Labour Cost 148.0 WU X 50.00 SGD/h	740.00	
Material Cost	268.21	
Total Paint Including Material		1,008.21
Repair Cost Excludes GST		5,540.31
GST (+7.00%)		387.82
Repair Cost Included GST		5,928.13

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSHIELD GLASS
Dept Direct: 6417 9781 / 6745 9835



Dept Direct: 6305 9610

Dept Direct: 6305 9611

Dept Direct: 6417 9782



Dept Direct: 6417 9794

Dept Direct: 6417 9795

Dept Direct: 6417 9796

Dept Direct: 6417 9797

Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

SHU FATT AUTO WORKS
BLK 1009 #01-90 BUKIT MERAH LANE 3
S(159723)

SINGAPORE 159723
TEL : 62730119 FAX : 62707065
ATTN : PAT/ JULIA

TAX INVOICE : AR201907-07740
DATE : 15/07/2019
CUSTOMER ID : SHU001
VEH REG. NO. : SLB4259S
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 2
CURR. : SGD

SO STOCKID	DESCRIPTION	Stk Loc	QTY	U/PRICE	AMOUNT
1. H04711-T5A-000ZZ GK5	(283) FR BUMPER	PA PL4-A1-12	1	380.00	380.00
2. H71198-T5A-000 GK3 PI GK8	(317) SPACER FR LH	PA PL1-L1-02B	1	8.00	8.00
3. H91505-TM8-003 GM2	(350) CLIPS	PA PL1-M1-09N	12	2.50	30.00
4. H71120-TAS-003 GK5	(410) FR GRILLE (COMPLETE)	PA PL1-M1-03A	1	220.00	220.00
5. H60100-T5L-T00ZZ GK5	(421) BONNET	PA PL1-A1-FRT	1	260.00	260.00
6. H33150-T5A-J21 GK5	(561) HEADLAMP LH	PA PL1-J1-050	1	750.00	750.00
7. H33950-TY0-003/33951-TY 0-305 GK5 GP7	FOG LAMP LH (622)	PA PL1-P1-12A	1	210.00	210.00

CONTINUE NEXT PAGE

[P] 15/07/2019 11:57:19

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

ORIGINAL

[B] 15/07/2019 11:43:04AM



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710

TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 8417 8791 / 8748 8828



Dept Direct: 8306 9010

Dept Direct: 8306 9011

Dept Direct: 8417 8792



Dept Direct: 8417 8794

Dept Direct: 8417 8796

Dept Direct: 8417 8798

Dept Direct: 8417 8799

Wiper blade: NWB (Nippon Wiper blade), Sliiper (Made in Korea),

Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

SHU FATT AUTO WORKS
BLK 1009 #01-90 BUKIT MERAH LANE 3
S(159723)

SINGAPORE 159723
TEL: 62730119 FAX: 62707065
ATTN: PAT/ JULIA

TAX INVOICE : AR201907-0774
DATE : 15/07/2019
CUSTOMER ID : SHU00
VEH REG. NO. : WSA SLB4259
TERMS : 30 day
PO NO. :
PAGE NO. : Page 2 of 2
CURR. : SGI

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
8	H33650-T5A-003	(639) LIGHT ASSY L.FR.POSITION	PA PL1-A1-12C	1	160.00	160.00
9	H60261-T5H-H10ZZ GK5	FENDER FR LH (744)	PA PLZ-1A	1	155.00	155.00
10	H60690-T5A-300ZZ GK3 PI GG7	(745) BRACKET COMPL FR.FENDER	PA PL1-L1-11S	1	40.00	40.00
11	H91501-TR0-003 FB1	CLIP INNER FENDER (789)	PA PL1-L1-10J	10	2.50	25.00
12	H71130-T5A-000ZZ GK3 GK5JAZZ	REINFORCEMENT	PA PL1-H1-09B	1	180.00	180.00
13	H60400-T5B-300ZZ/310ZZ GK5	SUPPORT PANEL (1009)	PA PL1-P1-010	1	310.00	310.00
14	H71190-T5A-000 GK3 PI	(219) BRACKET L.FR BUMPER 3/4	PA PL1-N1-11E	1	18.00	18.00

SUB-TOTAL : 2,746.00
ADD GST 7.00 % 192.22

E. & O.E

TOTAL AMOUNT SGD : 2,938.22

[P] 15/07/2019 11:57:19

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

[E] 15/07/2019 11:43:04AM

JAE Auto Pte. Ltd.

Sales Executive: LONG

This is computer generated document.

No signature is required.



* A A 2 0 1 9 0 7 - 0 7 7 4 0 *

ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Bik 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672
TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

HYUNDAI BLADE
Dept Direct: 6417 9701 / 9746 9838



Dept Direct: 6308 9810

Dept Direct: 6308 9811

Dept Direct: 6417 9702



Dept Direct: 6417 9704

Dept Direct: 6417 9706

Dept Direct: 6417 9708

Dept Direct: 6417 9710

Wiper blade: NWB (Nippon Wiper blade), Silper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

SHU FATT AUTO WORKS
BLK 1009 #01-90 BUKIT MERAH LANE 3
S(159723)

SINGAPORE 159723
TEL : 62730119 FAX : 62707065
ATTN : PAT/ JULIA

TAX INVOICE : AR201907-08074
DATE : 15/07/2019
CUSTOMER ID : SHU001
VEH REG. NO. : K259 SLB4259S
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1.	H04684-T5A-300ZZ GK8	(1119) EXTENSION, L. FR W/H	PA PL1-H1-09B	1	70.00	70.00
2.	H60710-T5A-B00ZZ GP7-120	(1167) WHEELHOUSE COMP, LH FR	PA PL1-J1-08B	1	60.00	60.00
3.	H60944-T5L-T00ZZ GK5	(1153) PLATE, L. SIDE FRAME GUSSET	PA PL1-L1-08E	1	40.00	40.00
4.	H60945-T5L-T00ZZ GK5	(1121) GUSSET, L. FR. SIDE FRAME	PA PL1-L1-07H	1	40.00	40.00

SUB-TOTAL : 210.00
ADD GST 7.00 % 14.70

E & O R

TOTAL AMOUNT SGD : 224.70

[P] 15/07/2019 16:09:42

[E] 15/07/2019 4:08:15PM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive: LONG

This is computer generated document.

No signature is required.



* AR201907-08074 *

ORIGINAL

Goods Received in Good Order

[Signature]

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

60 JALAN LAM HUAT #B1-05/06 CARROS CENTRE
SINGAPORE 737869 TEL: 63625226 FAX: 63626977

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 9791 / 6745 9658



Dept Direct: 6417 9794

Dept Direct: 6417 9798

Dept Direct: 6417 9796

Dept Direct: 6417 9797

Wiper blade: NWB (Nippon Wiper blade), Siliper (Made in Korea),
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

SHU FATT AUTO WORKS
BLK 1009 #01-90 BUKIT MERAH LANE 3
S(159723)

SINGAPORE 159723
TEL: 62730119 FAX: 62707065
ATTN: PAT/ JULIA

TAX INVOICE : AR201907-07754
DATE : 15/07/2019
CUSTOMER ID : SHU001
VEH REG. NO. : ~~W259~~ SLB4259S
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. H71108-T5A-N00 GK5	FOG GARNISH LH (643)	U1 HL2-E2-B	1	35.00	35.00
2. H74150-T5L-T00 GK5	FENDER SHIELD LH (841)	U1 HL2-N18	1	85.00	85.00

SUB-TOTAL : 120.00
ADD GST 7.00 % 8.40

E. & O.E

TOTAL AMOUNT SGD : 128.40

[P] 15/07/2019 11:56:50AM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

[E] 15/07/2019 11:51:51AM

JAE Auto Pte. Ltd.

Sales Executive : LONG



* AR201907-07754 *

This is computer generated document.

No signature is required.

ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710

TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSHIELD GLASS
Dept Direct: 6417 8791 / 8748 9629



Dept Direct: 6417 8794

Dept Direct: 6417 8795

Dept Direct: 6417 8796

Dept Direct: 6417 8

Wiper blade: NWB (Nippon Wiper blade), Silpor (Made in Korea)

Forch (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

SHU FATT AUTO WORKS

BLK 1009 #01-90 BUKIT MERAH LANE 3

S(159723)

SINGAPORE 159723

TEL: 62730119 FAX: 62707065

ATTN: PAT/ JULIA

TAX INVOICE : AR201907-08587
DATE : 16/07/2019
CUSTOMER ID : SHU001
VEH REG. NO. : SLB4291S
TERMS : 30 days
PO NO. : 4259
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ STOCKID	DESCRIPTION	Stk Loc	QTY	U/PRICE	AMOUNT
1. H17230-5R0-J01 GK3 PI GG7	CHAMBER ASSY RESONATOR	PA PL1-N1-111	1	85.00	85.00

SUB-TOTAL : 85.00
ADD GST 7.00 % 5.95

E & O E TOTAL AMOUNT SGD : 90.95

[P] 16/07/2019 14:35:17

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

[E] 16/07/2019 2:33:02PM

JAE Auto Pte. Ltd.

Sales Executive: LONG

This is computer generated document.

No signature is required.



ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date

Veron Chen (LKKAUTO)

From: Denise Tay (LKKAUTO)
Sent: Monday, 19 August 2019 12:27 PM
To: Veron Chen (LKKAUTO)
Subject: FW: Audatex - Labour differences on SLB4259S
Attachments: SLB 4259 S_19082019 (2).pdf

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Tun Tomy, SG <Tomy.Tun@audatex.com>
Sent: Monday, 19 August 2019 12:19 PM
To: Pat-Shu Fatt Auto Works <shufatt@singnet.com.sg>; Denise Tay (LKKAUTO) <denisetay@lkkauto.com>
Cc: Yusoff Tawffiek, SG <Tawffiek.Yusoff@audatex.com>; Chay WeiKang, SG <WeiKang.Chay@audatex.com>
Subject: Audatex - Labour differences on SLB4259S

Dear both,

Regarding Veh SLB4259S, there are some labour differences between Shu Fatt estimate and LKK adjusted estimate. Based on the conversation, the adjustment was only done on special nett items without any other parts change. We noticed the difference and we are looking into it urgently.

To expedite the matter for both parties, I seek permission from LKK, Denis to allow me to do some manual adjustment on Labour Difference. There are 16WU different and I have included them under labour section.

I hope it will speed up the whole process while we are investigating the case. Please see attached adjusted report.

Thank you for your support and understating. Feel free to reach me for any queries / assistant.

Best Regards,

Tomy

Sales Support Associate | Audatex Singapore Pte Ltd

7 Temasek Boulevard | Level 44 Suntec Tower 1 | Singapore 038987

M: +65 9456 7628 W: www.audatex.com.sg



Global knowledge. Local focus

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Finalised

Claim Reference:
Assessment number: SF089
Version: 1810
Date calculated: 19/08/2019 2:25 PM

Full Report
Registration: SLB 4259 S
Printed: 19/08/2019 2:25 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	MSIG Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:		Date of Incident:	05/07/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	HONDA		
Model:	JAZZ (GK3/GK5/GK7)		
Sub Model:	BASE MODEL		
Model Sheet Number:	35 CJ 01		
Registration:	SLB 4259 S		
VIN number:			
Odometer:			
Model Specs			
FROM MODEL 2016	AUTO AIR CON	FOG LAMPS	DRL HEADLAMPS
CHROME D/MIRROR CVR	1.5 LTR 88KW	PRODUCT THAILAND	TWO COAT METALLIC
PREPARE OFF VEHICLE	CLEAR COAT HARD		

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
Assessment number: SF089
Version: 1810
Date calculated: 19/08/2019 2:25 PM

Full Report
Registration: SLB 4259 S
Printed: 19/08/2019 2:25 PM


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

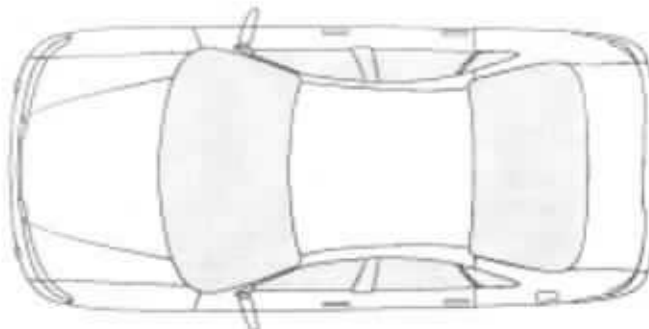

Labour

Code	Description	Time Base 10 WU/h	Price = 50.00 SGD/h	
			WU	Price SGD
8101B1)	R + R FRONT BUMPER SUPPORT		1.0	5.00
NO NUMBER	R + R LEFT HEADLAMP		2.0	10.00
NO NUMBER	R + R RIGHT HEADLAMP		2.0	10.00
NO NUMBER	RENEW BONNET		5.0	25.00
	INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE			
8131H3	R + R R/F WHEEL ARCH TRIM		4.0	20.00
8131A7	R + R RIGHT FRONT WHEELHOUSE SHELL		3.0	15.00
NO NUMBER	R + R LEFT FRONT WING		5.0	25.00
	INCLUDES: R + R LEFT FRONT INNER WING COVER			
NO NUMBER	RENEW FRONT PANEL CPL		20.0	100.00
NO NUMBER	RENEW L/F WHEELHOUSE REINFORCEMENT		20.0	100.00
NO NUMBER	RENEW L/F UPPER WHEELHOUSE REINFORCEMENT		25.0	125.00
NO NUMBER	RENEW LEFT FRONT WHEELHOUSE CLOSING		6.0	30.00
NO NUMBER	RENEW LEFT FRONT WHEELHOUSE CLOSING		6.0	30.00

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
 Assessment number: SF089
 Version: 1810
 Date calculated: 19/08/2019 2:25 PM

Full Report
 Registration: SLB 4259 S
 Printed: 19/08/2019 2:25 PM

Code	Description	WU	Price SGD
710100	R + R BATTERY	3.0	15.00
NO NUMBER	R + R RADIATOR CPL WITH ATTACHED PARTS	3.0	15.00
1211D5	R + R AIR FILTER HOUSING	4.0	20.00
NO NUMBER	R + R AIR CONDITIONING CONDENSER	3.0	15.00
620020	REFILL + VENT AIR CONDITIONING	7.0	35.00
NN	FRONT BUMPER R&R / NEW PARTS	11.0*	55.00
NN	Resonator R&R / NEW PARTS	2.0*	10.00
1015	Adjusted Labor Diff	16.0*	80.00
1203	L/F SIDE MEMBER REPAIR	15.0*	75.00
1305	L/S-MEMB CLOSING PNL REPAIR	10.0*	50.00
1481	LEFT FRONT DOOR REPAIR	20.0*	100.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		19.30	193.0
Total of Labour			965.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	BONNET NEW PART PAINTING	16.0
	L/F WING NEW PART PAINTING	10.0
	FRONT PANEL CPL SURFACE PAINT	6.0
	L/F WHEELHOUSE REINF SURFACE PAINT	4.0
	L/F WHEELHOUSE PANEL SURFACE PAINT	4.0
	L/INN W-HOUSE PANEL SURFACE PAINT	4.0
	L/F UP W-HOUSE REINF SURFACE PAINT	4.0
	L/F SIDE MEMBER SURFACE PAINT	5.0
	L/S-MEMB CLOSING PNL SURFACE PAINT	4.0
	LEFT FRONT DOOR NEW PART PAINTING	16.0
	FRONT BUMPER NEW PART PAINT K1R	12.0
	L/R DOOR REPAIR PAINTING >50%	23.0
	R/S-MEMB CLOSING PNL SURFACE PAINT	4.0
	spray painting L/Wing bracket	6.0*

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	46.96
0741	L/F WING NEW PART PAINTING	19.09
1009	FRONT PANEL CPL SURFACE PAINT	12.70

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
 Assessment number: SF089
 Version: 1810
 Date calculated: 19/08/2019 2:25 PM

Full Report
 Registration: SLB 4259 S
 Printed: 19/08/2019 2:25 PM

Paint Material Per Part

Code	Description	Price SGD
1119	L/F WHEELHOUSE REINF SURFACE PAINT	4.48
1121	L/F WHEELHOUSE PANEL SURFACE PAINT	1.25
1123	L/INN W-HOUSE PANEL SURFACE PAINT	1.25
1167	L/F UP W-HOUSE REINF SURFACE PAINT	4.48
1203	L/F SIDE MEMBER SURFACE PAINT	5.98
1305	L/S-MEMB CLOSING PNL SURFACE PAINT	1.25
1481	LEFT FRONT DOOR NEW PART PAINTING	45.41
0283	FRONT BUMPER NEW PART PAINT K1R	56.09
1781	L/R DOOR REPAIR PAINTING >50%	30.42
1306	R/S-MEMB CLOSING PNL SURFACE PAINT	1.25

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	50.00 SGD/h		
Time Paint		118.0	
Preparation Main Work Metal	2.50	25.0	125.00
Preparation Comp. Work Plastic	0.50	5.0	25.00
Total	10 WU/h	148.0	740.00

Material Cost - Paint

	Price SGD
New Part Painting	111.46
New Part Painting - Plastic K1R	56.09
Repair Painting	30.42
Surface-/Blend Paint	32.64
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	268.21

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Supplier	Price SGD
0283	FRONT BUMPER	71101T5LT10ZZ		380.00
0317	L/F OUT BUMPER BRKT	71198T5A000		8.00
0319	L/F UPP BUMPER BRKT	71190T5A000		18.00
0350	FRT BUMPER CLAMP KIT	91505TM8003		30.00
0410	GRILLE	71120T5AU00		220.00
0471	BONNET	60100T5LT00ZZ		260.00
0561	L/F HEADLAMP	33150T5AJ01		750.00
0637	L/F FOG LAMP	33950TY0003		210.00

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:

Assessment number: SF089

Version: 1810

Date calculated: 19/08/2019 2:25 PM

Full Report

Registration: SLB 4259 S

Printed: 19/08/2019 2:25 PM

Code	Description	Part Number	Supplier	Price SGD
0639	L/DAYT RUNNING LAMP	33250T5AG01		160.00
0643	L/F BUMPER COVER	71108T5AJ00		35.00
0741	L/F WING	60261T5HH10ZZ		155.00
0745	L/F WING BRACKET	60690T5A300ZZ		40.00
0789	L/F WING CLAMP KIT	934050601608		25.00
0841	L/WHEELHOUSE SHELL	74150T5LT00		85.00
1009	FRONT PANEL CPL	60400T5LT01ZZ		310.00
1119	L/F WHEELHOUSE REINF	04684T5LT00ZZ		70.00
1121	L/F WHEELHOUSE PANEL	60945T5LT00ZZ		40.00
1123	L/INN W-HOUSE PANEL	60944T5LT00ZZ		40.00
1167	L/F UP W-HOUSE REINF	60710T5LP00ZZ		60.00
1014	Resonator	Resonator		85.00
f: OEM Parts				Savings 0.00
n: Non-OEM Parts				Subtotal 2,981.00
u: Used parts				Addition(+10.00%) 298.10
Total				3,279.10

Extras

Code	Description	Price SGD
1006	coolant coolant	18.00*
1010	anti rust anti rust	80.00*
1012	reset ecu reset ecu	100.00*
Total Extras		198.00

LKK Auto Consultants
#01-25 Paya Ubi Industrial Park,
51 Ubi Avenue 1
408933

Claim Reference:
Assessment number: SF089
Version: 1810
Date calculated: 19/08/2019 2:25 PM

Full Report
Registration: SLB 4259 S
Printed: 19/08/2019 2:25 PM

Final Calculation

	SGD	SGD
Parts	2,981.00	
Addition(+10.00%)	298.10	
Total Parts		3,279.10
Labour Time Base 10 WU/h		
Total 193.0 WU X 50.00 SGD/h	965.00	
Total of Labour		965.00
Total Of Extras		198.00
Paint Work Time Base 10 WU/h		
Labour Cost 148.0 WU X 50.00 SGD/h	740.00	
Material Cost	268.21	
Total Paint Including Material		1,008.21
Repair Cost Excludes GST		5,450.31
GST (+7.00%)		381.52
Repair Cost Included GST		5,831.83

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Veron Chen (LKKAUTO)

From: Pat-Shu Fatt Auto Works <shufatt@singnet.com.sg>
Sent: Monday, 19 August 2019 4:21 PM
To: Veron Chen (LKKAUTO)
Subject: RE: SLB 4259 S - finalised

Dear Veron,

COR confirmed.

Thanks & regards,
Pat
Shu Fatt Auto Works

From: Veron Chen (LKKAUTO) [mailto:veronchen@lkkauto.com]
Sent: Monday, 19 August, 2019 2:38 PM
To: Pat-Shu Fatt Auto Works; Rasul (LKKAUTO); SUR
Subject: RE: SLB 4259 S - finalised

Dear Pat,

Finalise amount \$5450.31 before excess \$500 @ 6 working days.

Please check and confirm

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAUTO)
Sent: Wednesday, 14 August 2019 4:26 PM
To: Pat-Shu Fatt Auto Works <shufatt@singnet.com.sg>; Rasul (LKKAUTO) <Rasul@lkkauto.com>; SUR <sur@lkkauto.com>
Subject: RE: SLB 4259 S - finalised

Dear Pat,

Finalise amount \$5397.61 before excess \$500 @ 6 working days.

Please check and confirm

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Pat-Shu Fatt Auto Works <shufatt@singnet.com.sg>

Sent: Tuesday, 6 August 2019 5:14 PM

To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; Rasul (LKKAuto) <Rasul@lkkauto.com>

Subject: SLB 4259 S - finalised

Dear Veron,

Please see attached Audatex finalised report, supplier invoice.
Cost of repair: \$5540.31 before GST and EXCESS.

Thanks & regards,

Pat

Shu Fatt Auto Works

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	10 Jul 2019 14:01 Sendback Est	10 Jul 2019 14:48 \$9,969.40	11 Jul 2019 10:30 Edit Adj Rpt	\$5,450.31 Edit Estimates	\$5,450.31 View Rpt		Pending for Survey Report Cancel Case
Supp #1	17 Jul 2019 09:40	22 Jul 2019 12:50 \$225.50	22 Jul 2019 12:50			(Combined)	Combined with Main Uncombine Suppl.

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	--------------------------

CLAIM SUBFOLDER DETAILS

Insured:	TAN YINGYI, ID: S8605664Z, Tel: +6596516214, Email: yingyi.tan15@gmail.com		
Vehicle Reg. No.:	SLB4259S	Date of Loss:	05/07/2019 23:00 - :59 [38 Months and 28 Days From LTA Reg Date (Man Yr)]
Claim Type:	OD / 599096	Policy/Cover Note No.:	80428547QMY (Comprehensive) Coverage: 07/04/2019 - 06/04/2020
		Excess:	\$500.00
Repairer:	Shu Fatt Auto Works (HQ) Block 1009 Bukit Merah Lane 3, #01-90, 159723 Bukit Merah - Tel: 62730119		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Nor Azian Binte Noordin - 6594 2558]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD RASUL] ... [Final Rpt due 10/08/2019]		
Driver/Custodian:	TAN YINGYI (33 / Female), NRIC: S8605664Z, Tel: +6596516214 Email: yingyi.tan15@gmail.com		
Adj Asg. Remarks:	Car in. Survey & revert. Please contact us ASAP if you cannot attend this assignment.		

ASSOCIATED MAIL RECEIVED
[View All](#)
[Compose Case Mail](#)

- MSIG_SG (20/08/2019): Alert - Adj Mandate Approved (\$5450.31) - SLB4259S - Claim Handler: Nor Azian B...
- MSIG_SG (23/07/2019): Alert - Adj Mandate Approved (\$5597.50) - SLB4259S - Claim Handler: Nor Azian B...
- MSIG_SG (12/07/2019): Alert - Adj Mandate Approved (\$5372.00) - SLB4259S - Claim Handler: Nor Azian B...

ALL ASSOCIATED TASKS
[View All](#)
[Search Tasks](#)
[Create New Task](#)
[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

SLB4259S (599096)

OD

Jul 5 2019 11:00PM

[TAN YINGYI]

Shu Fatt Auto Works

Upload Documents		Upload Photos	Compose New Letter	View View in Browser v	
Assessment Reports				1 per page v	☒
No	Finalized On	Shu Fatt Auto Works (HQ)		Thumbnail	Print
1	10/07/19 14:48	Repairer Estimates		Load HTM	
2	22/07/19 12:50	Repairer Estimates Suppl. #1		Load HTM	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	12/07/19 13:24	Adjuster Immediate Advice		Load HTM	
2	22/07/19 13:25	Adjuster Immediate Advice		Load HTM	
3	19/08/19 16:42	Adjuster Immediate Advice		Load HTM	
Photos/Images				3 per page v	☒
No	Finalized On	Formteam Accident Services Taskforce Pte Ltd (HQ)		Thumbnail	Print
1	07/07/19 03:12	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
2	07/07/19 03:12	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
3	07/07/19 03:12	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
4	07/07/19 03:12	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
5	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
6	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
7	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
8	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
9	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
10	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
11	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
12	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
13	07/07/19 03:13	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
14	07/07/19 03:13	Driving License [Linked Accident Report Documents]		Load JPG	☒
No	Finalized On	Shu Fatt Auto Works (HQ)		Thumbnail	Print
1	10/07/19 14:05	1		Load JPG	☒
2	10/07/19 14:05	2		Load JPG	☒
3	10/07/19 14:05	3		Load JPG	☒
4	10/07/19 14:05	4		Load JPG	☒
5	10/07/19 14:05	5		Load JPG	☒
6	10/07/19 14:05	6		Load JPG	☒
7	10/07/19 14:05	7		Load JPG	☒
8	10/07/19 14:05	8		Load JPG	☒
9	10/07/19 14:05	9		Load JPG	☒
10	10/07/19 14:05	10		Load JPG	☒
11	10/07/19 14:05	11		Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	Shu Fatt Auto Works (HQ)	Thumbnail	Print
12	10/07/19 14:05	12	 Load JPG	☒
13	10/07/19 14:05	13	 Load JPG	☒
14	10/07/19 14:05	14	 Load JPG	☒
15	10/07/19 14:05	15	 Load JPG	☒
16	10/07/19 14:05	16	 Load JPG	☒
17	10/07/19 14:05	17	 Load JPG	☒
18	10/07/19 14:05	18	 Load JPG	☒
19	10/07/19 14:05	19	 Load JPG	☒
20	10/07/19 14:05	20	 Load JPG	☒
21	10/07/19 14:05	21	 Load JPG	☒
22	10/07/19 14:05	22	 Load JPG	☒
23	10/07/19 14:05	23	 Load JPG	☒
24	10/07/19 14:05	24	 Load JPG	☒
25	10/07/19 14:05	25	 Load JPG	☒
26	10/07/19 14:05	26	 Load JPG	☒
27	10/07/19 14:05	27	 Load JPG	☒
28	10/07/19 14:05	tyre make	 Load JPG	☒
29	10/07/19 14:05	tyre make	 Load JPG	☒
30	10/07/19 14:05	tyre size	 Load JPG	☒
31	10/07/19 14:05	Chassis Number	 Load JPG	☒
32	10/07/19 14:05	Odometer Reading	 Load JPG	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	15/07/19 09:42	General View	 Load JPG	☒
2	15/07/19 09:42	General View	 Load JPG	☒
3	15/07/19 09:42	General View	 Load JPG	☒
4	15/07/19 09:42	General View	 Load JPG	☒
5	15/07/19 09:42	General View	 Load JPG	☒
6	15/07/19 09:42	General View	 Load JPG	☒
7	15/07/19 09:42	General View	 Load JPG	☒
8	15/07/19 09:42	General View	 Load JPG	☒
9	15/07/19 09:42	General View	 Load JPG	☒
10	15/07/19 09:42	General View	 Load JPG	☒
11	15/07/19 09:42	General View	 Load JPG	☒
12	15/07/19 09:42	General View	 Load JPG	☒
13	15/07/19 09:42	General View	 Load JPG	☒
14	15/07/19 09:42	General View	 Load JPG	☒
15	15/07/19 09:42	General View	 Load JPG	☒
16	15/07/19 09:42	General View	 Load JPG	☒
17	15/07/19 09:42	General View	 Load JPG	☒
18	15/07/19 09:42	General View	 Load JPG	☒
19	15/07/19 09:42	General View	 Load JPG	☒
20	15/07/19 09:42	General View	 Load JPG	☒
21	15/07/19 09:42	General View	 Load JPG	☒
22	15/07/19 09:42	General View	 Load JPG	☒
23	15/07/19 09:42	General View	 Load JPG	☒
24	15/07/19 09:42	General View	 Load JPG	☒
25	15/07/19 09:42	General View	 Load JPG	☒
26	15/07/19 09:42	General View	 Load JPG	☒
27	15/07/19 09:42	General View	 Load JPG	☒
28	15/07/19 09:42	General View	 Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	Shu Fatt Auto Works (HQ)	Thumbnail	Print
29	15/07/19 09:42	General View	 Load JPG	☒
30	15/07/19 09:42	General View	 Load JPG	☒
31	15/07/19 09:42	General View	 Load JPG	☒
32	15/07/19 09:42	General View	 Load JPG	☒
33	15/07/19 09:42	General View	 Load JPG	☒
34	15/07/19 09:42	General View	 Load JPG	☒
35	15/07/19 09:42	General View	 Load JPG	☒
36	15/07/19 09:42	General View	 Load JPG	☒
37	15/07/19 09:42	General View	 Load JPG	☒
38	15/07/19 09:42	General View	 Load JPG	☒
39	15/07/19 09:42	General View	 Load JPG	☒
40	15/07/19 09:42	General View	 Load JPG	☒
41	15/07/19 09:42	General View	 Load JPG	☒
42	15/07/19 09:43	General View	 Load JPG	☒
43	15/07/19 09:43	General View	 Load JPG	☒
44	15/07/19 09:43	General View	 Load JPG	☒
45	15/07/19 09:43	General View	 Load JPG	☒
46	15/07/19 09:43	General View	 Load JPG	☒
47	15/07/19 09:43	General View	 Load JPG	☒
48	15/07/19 09:43	General View	 Load JPG	☒
49	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
50	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
51	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
52	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
53	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
54	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
55	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
56	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
57	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
58	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
59	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
60	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
61	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
62	22/07/19 13:12	Reinspection Photo	 Load JPG	☒
63	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
64	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
65	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
66	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
67	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
68	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
69	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
70	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
71	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
72	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
73	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
74	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
75	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
76	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
77	22/07/19 13:13	Reinspection Photo	 Load JPG	☒
78	22/07/19 13:13	Reinspection Photo	 Load JPG	☒

Assessment Reports				1 per page	☒
No	Finalized On	Shu Fatt Auto Works (HQ)		Thumbnail	Print
79	22/07/19 13:13	Reinspection Photo		Load JPG	☒
80	22/07/19 13:13	Reinspection Photo		Load JPG	☒
81	22/07/19 13:13	Reinspection Photo		Load JPG	☒
82	22/07/19 13:13	Reinspection Photo		Load JPG	☒
83	22/07/19 13:13	Reinspection Photo		Load JPG	☒
84	22/07/19 13:13	Reinspection Photo		Load JPG	☒
85	22/07/19 13:13	Reinspection Photo		Load JPG	☒
86	22/07/19 13:13	Reinspection Photo		Load JPG	☒
87	22/07/19 13:13	Reinspection Photo		Load JPG	☒
88	22/07/19 13:13	Reinspection Photo		Load JPG	☒
89	22/07/19 13:13	Reinspection Photo		Load JPG	☒
90	22/07/19 13:13	Reinspection Photo		Load JPG	☒
91	22/07/19 13:13	Reinspection Photo		Load JPG	☒
92	22/07/19 13:13	Reinspection Photo		Load JPG	☒
93	22/07/19 13:13	Reinspection Photo		Load JPG	☒
94	22/07/19 13:13	Reinspection Photo		Load JPG	☒
95	22/07/19 13:13	Reinspection Photo		Load JPG	☒
96	22/07/19 13:13	Reinspection Photo		Load JPG	☒
97	22/07/19 13:13	Reinspection Photo		Load JPG	☒
98	22/07/19 13:13	Reinspection Photo		Load JPG	☒
99	22/07/19 13:13	Reinspection Photo		Load JPG	☒
Documentation				1 per page	☒
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print
1	10/07/19 16:00	Valid DL		Load PDF	
2	10/07/19 16:00	Valid Road Tax		Load PDF	
3	10/07/19 16:29	COE / PARF Value		Load PDF	
No	Finalized On	Shu Fatt Auto Works (HQ)		Thumbnail	Print
1	10/07/19 14:08	Certificate of Insurance		Load PDF	
2	10/07/19 14:08	parf value enquiry		Load PDF	
3	10/07/19 14:08	Driver's Driving License		Load PDF	
4	10/07/19 14:47	Audatex Report		Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	12/07/19 13:10	MARK ESTIMATE		Load PDF	
2	22/07/19 13:19	SUPPLEMENTARY		Load PDF	
3	03/09/19 17:00	Parts Invoice		Load PDF	

Linked Accident Report Documents

Assessment Reports				View	View in Browser
No	Finalized On	Formteam Accident Services Taskforce Pte Ltd (HQ)		Thumbnail	Print
1	04/09/19 01:45	Accident Statement		Load HTM	
Photos/Images				3 per page	☒
No	Finalized On	Formteam Accident Services Taskforce Pte Ltd (HQ)		Thumbnail	Print
1	07/07/19 03:12	Accident Photo		Load JPG	☒
2	07/07/19 03:12	Accident Photo		Load JPG	☒
3	07/07/19 03:12	Accident Photo		Load JPG	☒
4	07/07/19 03:12	Accident Photo		Load JPG	☒
5	07/07/19 03:13	Accident Photo		Load JPG	☒
6	07/07/19 03:13	Accident Photo		Load JPG	☒
7	07/07/19 03:13	Accident Photo		Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	Formteam Accident Services Taskforce Pte Ltd (HQ)	Thumbnail	Print
8	07/07/19 03:13	Accident Photo	 Load JPG	☒
9	07/07/19 03:13	Accident Photo	 Load JPG	☒
10	07/07/19 03:13	Accident Photo	 Load JPG	☒
11	07/07/19 03:13	Accident Photo	 Load JPG	☒
12	07/07/19 03:13	Accident Photo	 Load JPG	☒
13	07/07/19 03:13	Accident Photo	 Load JPG	☒
14	07/07/19 03:13	Driving License	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Formteam Accident Services Taskforce Pte Ltd (HQ)	Thumbnail	Print
1	07/07/19 03:11	Sketch Plan	 Load JPG	☒
2	07/07/19 03:11	Sketch Plan #2	 Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)			
Show Remarks To: ☐ Repairer ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way, #21-01 SGX Centre 2
Singapore 068807

Our File No: CS/MSG19012259/R1VF3E2

Date: 04/09/2019

REFERENCE

Insured/Claimant:	TAN YINGYI	Policy No:	80428547QMY	Claim No:	599096
Date of Loss:	05/07/2019	Nature of Claim:	OD		

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLB4259S	Engine No:	L15B31020834
Make & Model:	HONDA JAZZ, 1.5 VTIR CVT (A)	Chassis No:	JHMGK5850GX202137
Reg. Date:	07/04/2016 (Man. Year: 2016)	Odometer:	43305 km
Colour:	Red		
Engine Capacity:	1498 cc		
Market Value/New Car Price:	S\$58,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/55 R16	Rear Tyre Size:	185/55 R16
Front Left Side:	Dunlop 6 mm	Rear Left Side:	Dunlop 6 mm
Front Right Side:	Dunlop 6 mm	Rear Right Side:	Dunlop 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	6,556.00	3,279.10	3,276.90	49.98
Miscellaneous Items	863.00	198.00	665.00	77.06
Labour	2,775.90	1,973.21	802.69	28.92
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	10,194.90	5,450.31	4,744.59	46.54
- Excess (S\$)	500.00	500.00	0.00	0.00
(S\$)	9,694.90	4,950.31	4,744.59	48.94
+ GST 7.00/7.00% (S\$)	678.65	346.52	332.13	48.94
Nett Amount (S\$)	10,373.55	5,296.83	5,076.72	48.94

INSPECTION

Date of Assignment:	11/07/2019	Present Location:	Shu Fatt Auto Works (HQ)
Date Inspected:	11/07/2019	Inspected At:	Shu Fatt Auto Works (HQ) Block 1009 Bukit Merah Lane 3, #01-90 Singapore 159723
Estimated Period of Repair:	6.0 days		

Adjuster: MOHD RASUL

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 04 Sep 2019)
Parts:	144	HONDA JAZZ 1.5 VTIR CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLB4259S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*BONNET (WCP)	Bent	260.00 F	*260.00 F
2	1	NA	*BONNET INSULATION (WCP)	Serviceable	70.00 F	*- F
3	1	NA	*eng cover clips (WCP)	Not Necessary	25.00 F	*- F
4	1	NA	*ENGINE INSULATION (WCP)	Not Necessary	155.00 F	*- F
5	1	NA	*FRONT BUMPER (WCP)	Torn	380.00 F	*380.00 F
6	1	NA	*FRONT BUMPER SPOILER (WCP)	Serviceable	125.00 F	*- F
7	1	NA	*FRONT PANEL CPL (WCP)	Bent	310.00 F	*310.00 F
8	1	NA	*FRT BUMPER CLAMP KIT (WCP)	Necessary	30.00 F	*30.00 F
9	1	NA	*FRT BUMPER SUPPORT (WCP)	Serviceable	160.00 F	*- F
10	1	NA	*FRT LWR BUMP GRILLE (WCP)	Serviceable	38.00 F	*- F
11	1	NA	*GRILLE (WCP)	Scratched	220.00 F	*220.00 F
12	1	NA	*grille clips (WCP)	Not Necessary	20.00 F	*- F
13	1	NA	*L/BONNET HINGE (WCP)	Serviceable	25.00 F	*- F
14	1	NA	*L/BONNET SEAL (WCP)	Not Necessary	55.00 F	*- F
15	1	NA	*L/DAYT RUNNING LAMP (WCP)	Scratched	160.00 F	*160.00 F
16	1	NA	*L/F BONNET GASKET (WCP)	Not Necessary	55.00 F	*- F
17	1	NA	*L/F BUMPER COVER (WCP)	Deformed	35.00 F	*35.00 F
18	1	NA	*L/F FOG LAMP (WCP)	Cracked	210.00 F	*210.00 F
19	1	NA	*L/F HEADLAMP (WCP)	Broken	750.00 F	*750.00 F
20	1	NA	*L/F OUT BUMPER BRKT (WCP)	Necessary	8.00 F	*8.00 F
21	1	NA	*L/F SIDE MEMBER (WCP)	Repair	480.00 F	*- F
22	1	NA	*L/F UPP BUMPER BRKT (WCP)	Necessary	18.00 F	*18.00 F
23	1	NA	*L/F UPP MOULDING SET (WCP)	Not Necessary	70.00 F	*- F
24	1	NA		Bent	180.00 F	*60.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
			*L/F UP W-HOUSE REINF (WCP)			
25	1	NA	*L/F WHEELHOUSE REINF (WCP)	Bent	230.00 F	*70.00 F
26	1	NA	*L/F WINDOW MOULDING (WCP)	Not Necessary	75.00 F	*- F
27	1	NA	*L/F WING (WCP)	Buckled	155.00 F	*155.00 F
28	1	NA	*L/F WING CLAMP KIT (WCP)	Necessary	20.00 F	*25.00 F
29	1	NA	*L/S-MEMB CLOSING PNL (WCP)	Serviceable	25.00 F	*- F
30	1	NA	*L/WHEELHOUSE SHELL (WCP)	Cut	85.00 F	*85.00 F
31	1	NA	*L/WINDSCREEN MLDG (WCP)	Not Necessary	280.00 F	*- F
32	1	NA	*LEFT FRONT DOOR (WCP)	Repair	460.00 F	*- F
33	1	NA	*low bump clips (WCP)	Not Necessary	30.00 F	*- F
34	1	NA	*R/BONNET HINGE (WCP)	Serviceable	25.00 F	*- F
35	1	NA	*R/BOONET SEAL (WCP)	Not Necessary	55.00 F	*- F
36	1	NA	*R/COWL PANEL TRIM (WCP)	Serviceable	200.00 F	*- F
37	1	NA	*R/F BONNET GASKET (WCP)	Not Necessary	55.00 F	*- F
38	1	NA	*R/F OUT BUMPER BRKT (WCP)	Serviceable	8.00 F	*- F
39	1	NA	*R/S-MEMB CLOSING PNL (WCP)	Serviceable	25.00 F	*- F
40	1	NA	*running light (WCP)	Not Necessary	160.00 F	*- F
41	1	NA	*wiper gar clips (WCP)	Not Necessary	28.00 F	*- F
Supplementary #1						
42	1		*Left front wing bracket (WCP)	Bent	40.00 F	*40.00 F
43	1		*Resonator (WCP)	Cracked	85.00 F	*85.00 F
44	1		*Left front wheelhouse panel (WCP)	Bent	40.00 F	*40.00 F
45	1		*Left inner wheelhouse panel (WCP)	Bent	40.00 F	*40.00 F
F=Franchise part.						
Sub Total (\$\$)					5,960.00	2,981.00
+ Margin on L,N Items 10.00/10.00% (\$\$)					596.00	298.10
Total Parts (\$\$)					6,556.00	3,279.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	alignment	120.00	0.00
2	1	anti rust	120.00	80.00
3	1	coolant (NECESSARY)	18.00	18.00
4	1	Left front tyre (NOT NECESSARY)	280.00	0.00
5	1	Number plate (NOT NECESSARY)	55.00	0.00
6	1	Repair wiring	60.00	0.00
7	1	reset ecu	150.00	100.00
8	1	tyre replacement tyre balance	60.00	0.00
Sub Total (S\$)			863.00	198.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	815.00	740.00
2	Total Paint Materials	New	295.90	268.21
3	Total Panel/Mechanical Labour	New	1,650.00	965.00
4	Additional Total	New	15.00	0.00
Gross Labour Cost (S\$)			2,775.90	1,973.21

Report was unsubmitted during this print-out.

< END OF ESTIMATES >