



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

NTUC INCOME INSURANCE CO-OPERATIVE LTD INV No. AC2003622
73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSE INV Date 04/05/2020
SINGAPORE 189556 Reference CS/INC19013080/Gqd3n2
ATTN: ERIC TANG Code INC



PROFESSIONAL SERVICE FEE

Vehicle No. SMC 7382G
Insured Veh. FBE 9525T
Claim No. MT/1054600-002
Policy No.
Accident Date 17/07/2019
Inspection Date 24/07/2019

Description	Total
Damage Assessment	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD
73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556

Ref: CS/INC19013080/Gqd3n2

Date: 04-05-2020



ATTN: ERIC TANG

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	FBE 9525T	Veh. Inspected	SMC 7382G
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1054600-002	Excess (\$)	0.00
Assign From	CYNTHIA ANG	Assign Date	24/07/2019

2. Vehicle Particulars & Condition

Make & Model	KIA CARENS 1.7	c.c	1685
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	KNAHU815VJ7211506	Colour	GREY
Odometer	106931 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	GRENLANDER	6 mm
L/H Front Tyre	205/55 R16	GRENLANDER	6 mm
R/H Rear Tyre	205/55 R16	GRENLANDER	6 mm
L/H Rear Tyre	205/55 R16	GRENLANDER	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	17/07/2019	Inspect Date / Time	24/07/2019 (04:00 PM)
Survey held at	THIAM HENG HUAT PTE LTD 176 SIN MING DRIVE #05-14 SINGAPORE 575721		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMC 7382G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT DOOR O/S	TO REPAIR SEE LABOUR	1,525.00	-
1	FRONT DOOR UPPER HINGE O/S	NOT NECESSARY	62.00	-
1	FRONT DOOR LOWER HINGE O/S	NOT NECESSARY	62.00	-
1	FRONT DOOR WEATHERSTRIP O/S	NOT NECESSARY	189.00	-
1	FRONT DOOR INNER LOCK O/S	NOT NECESSARY	296.00	-
1	FRONT DOOR WINDOW CHANNEL O/S	NOT NECESSARY	124.00	-
1	FRONT DOOR WINDOW CHANNEL CHROME MOULDING O/S	NOT NECESSARY	95.00	-
4	FRONT DOOR STOPPER O/S @\$12.00	NOT NECESSARY	48.00	-
1	FRONT DOOR CHECKER O/S	NOT NECESSARY	59.00	-
1	FRONT DOOR ROCKER PANEL STEP GARNISH O/S	NOT NECESSARY	78.00	-
1	ROCKER PANEL O/S	TORN	1,269.00	867.00
	LESS 10% DISCOUNT		-380.70	-86.70
			3,426.30	780.30
<u>SPECIAL NETT ITEMS</u>				
10	FRONT DOOR INNER TRIM BOARD CLIPS O/S @\$5.50 (SN)	NOT NECESSARY	55.00	-
1	ROCKER PANEL SEALANT O/S (SN)	NOT NECESSARY	100.00	-
1	SUNDRIES (SN)	NOT NECESSARY	50.00	-
			205.00	-
<u>LABOUR</u>				
	TO DISMANTLE/RENEW THE ACCIDENT DAMAGED PORTION.TO PANEL BEAT,RESHAPE,STRAIGHTEN, ORIENTATE AND ALIGN REPAIR/REPLACEMENT PARTS.INCLUSIVE OF THE REPAIR OF FRONT DOOR O/S.		1,000.00	400.00
	TO DISCONNECT O/S FRONT DOOR WIRE HARNESS AND ELECTRICAL COMPONENT TO FACILITATE REPAIRS,RECONNECT AND CHECK FUNCTIONS OF POWER WINDOWS.	NOT NECESSARY	50.00	-
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY O/S FRONT DOOR,O/S ROCKER PANEL AND OTHER AFFECTED AREA/PANEL.		1,000.00	250.00

Report Ref No. CS/INC19013080/Gqd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR.		100.00	60.00
			2,150.00	710.00
GRAND TOTAL			5,781.30	1,490.30
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				1,200.00

Report Ref No. CS/INC19013080/Gqd3n2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 7382G

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMC 7382G

RE-INSPECTION

