

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC4/AIG19013429/KBA3Q2

**Date:** 16/07/2020

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 0999994322

**Claimant**  
**Vehicle No :** SKX8109L **Insured Vehicle No :** SMJ1793G

Date of Loss: 29/07/2019 Nature of Claim: TP Claim No: 5285486777SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SKX8109L</b>		
Make & Model:	MAZDA 3, 1.5 L 4-DOOR SEDAN SP.6EAT (A)	Engine No:	P520337433
Reg. Date:	29/12/2015 (Man. Year: 2015)	Chassis No:	JM6BM42A8G0328556
Colour:	Metallic Black	Odometer:	60390 km
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	205/60R16	Rear Tyre Size:	205/60R16
Front Left Side:	Bridgestone 8 mm	Rear Left Side:	Bridgestone 8 mm
Front Right Side:	Bridgestone 8 mm	Rear Right Side:	Bridgestone 8 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	10,246.92	6,653.92	3,593.00	35.06
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,220.00	1,850.00	370.00	16.67
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (\$\$)</b>	<b>12,466.92</b>	<b>8,503.92</b>	<b>3,963.00</b>	<b>31.79</b>
<b>+ GST 7.00/7.00% (\$\$)</b>	872.68	595.27	277.41	31.79
<b>Nett Amount (\$\$)</b>	<b>13,339.60</b>	<b>9,099.19</b>	<b>4,240.41</b>	<b>31.79</b>
<b>+ Loss of Use (2.0 x S\$60.00/day) (\$\$)</b>		120.00		
<b>+ Car Rental (6.0 x S\$90.00/day) (\$\$)</b>		540.00		
<b>+ Doc/Search Fee (\$\$)</b>		8.00		
<b>Nett Liability (\$\$)</b>		<b>9,767.19</b>		

### INSPECTION

Date of Assignment: 30/07/2019

Date Inspected: 31/07/2019 Inspected At:

10 ANG MO KIO IND PARK 2A #01-04

ANG MO KIO AUTOPOINT .  
SINGAPORE 568047

Repairer: Cheng Hoe Motor Pte Ltd  
(Yishun)

Estimated Period of Repair: 6.0 days

---

**Adjuster:** KENNETH KONG**Manager:** CHUA ZHEN LI

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Bent	1,082.00 FL	*1,082.00 FL
2	1		*FRONT BUMPER REINFORCEMENT	Bent	593.00 FL	*593.00 FL
3	1		*FRONT BUMPER REINFORCEMENT COVER	Cracked	165.00 FL	*165.00 FL
4	1		*FRONT BUMPER TOW HOOK COVER	Missing	29.00 FL	*29.00 FL
5	1		*FRONT BUMPER RH HEADLAMP NOZZLE COVER	Missing	85.00 FL	*85.00 FL
6	2		*FRONT BUMPER LOWER TRIANGLE GARNISH	Missing	58.80 FL	*58.80 FL
7	1		*FRONT BUMPER LOWER CENTRE GARNISH	Cracked	88.00 FL	*88.00 FL
8	1		*FRONT BUMPER SIDE RETAINER	O/S Distorted	39.80 FL	*19.90 FL
9	6		*FRONT BUMPER CLIP	Necessary	28.80 FL	*28.80 FL
10	6		*FRONT BUMPER RIVET PIN	Necessary	35.40 FL	*35.40 FL
11	1		*FRONT BUMPER RH FOG LAMP	Cracked	368.00 FL	*368.00 FL
12	1		*FRONT BUMPER RH FOG LAMP BRACKET	Cracked	37.00 FL	*37.00 FL
13	1		*FRONT BUMPER RH FOG LAMP COVER	Dented	45.00 FL	*45.00 FL
14	1		*FRONT BUMPER RH FOG LAMP RIM	Cut	111.00 FL	*111.00 FL
15	1		*FRONT GRILLE	Serviceable	610.00 FL	*- FL
16	1		*FRONT GRILLE LOGO	Serviceable	46.00 FL	*- FL
17	1		*FRONT GRILLE TOP COVER	Serviceable	351.00 FL	*- FL
18	1		*FRONT GRILLE RH MOULDING	Serviceable	184.00 FL	*- FL
19	6		*FRONT GRILLE RIVET	Not Necessary	35.40 FL	*- FL
20	1		*FRONT GRILLE RH INNER BRACKET	Serviceable	22.00 FL	*- FL
21	1		*HEADLAMP RH	Broken	2,366.00 FL	*2,366.00 FL
22	1		*HEADLAMP RH WIPER NOZZLE	Cracked	242.00 FL	*242.00 FL
23	1		*HEADLAMP RH WIPER NOZZLE CLIP	Necessary	31.00 FL	*31.00 FL
24	1		*FRONT RH FENDER	Bent	349.00 FL	*349.00 FL
25	1		*FRONT RH FENDER STAY	Bent	41.20 FL	*41.20 FL
26	1		*FRT RH FENDER INNER SHIELD	Torn	135.00 FL	*135.00 FL
27	1		*FRONT RH FENDER INNER SPLASH SHIELD	Cracked	30.50 FL	*30.50 FL
28	6		*FRONT RH FENDER INNER SHIELD CLIP	Necessary	28.80 FL	*28.80 FL
29	1		*FRONT RH FENDER SIDE PANEL	Repair	132.00 FL	*- FL
30	1		*FRT SUPPORT PANEL	Cracked	492.00 FL	*492.00 FL
31	1		*FRONT TOP PANEL	Repair	147.00 FL	*- FL
32	1		*FRT BRACE PANEL	Repair	39.90 FL	*- FL
33	1		*FRONT SUPPORT PANEL RH LOWER SIDE GARNISH	Cracked	38.70 FL	*38.70 FL
34	1		*WIPER WASHER TANK	Dented	151.40 FL	*151.40 FL
35	1		*WIPER WASHER MOTOR	Serviceable	72.00 FL	*- FL
36	1		*WIPER WASHER HOSE	Torn	19.80 FL	*19.80 FL
37	1		*FRONT LOWER ENGINE UNDER COVER (OUTER)	Cracked	99.00 FL	*99.00 FL
38	1		*FRONT LOWER ENGINE UNDER COVER (INNER)	Cracked	300.00 FL	*300.00 FL
39	1		*FRONT RH SHOCK ABSORBER	Bent	360.00 FL	*360.00 FL
40	1		*FRONT RH KNUCKLE ARM	Serviceable	402.00 FL	*- FL
41	1		*FRONT RH KNUCKLE BEARING	Serviceable	568.00 FL	*- FL
42	1		*FRONT RH LOWER ARM	Serviceable	508.00 FL	*- FL
43	1		*FRONT RH STAY LINKAGE	Serviceable	67.30 FL	*- FL
44	1		*AIR-CON CONDENSER	Serviceable	1,116.00 FL	*- FL
45	1		*FRONT BUMPER RH SIGNAL LAMP ASSY	Cut	164.00 FL	*164.00 FL
46	1		*FRONT SUPPORT PANEL TOP GARNISH	Serviceable	152.00 FL	*- FL
47	1		*UNIT COOLANT	Necessary	35.00 FS	*20.00 FS
48	1		*RH HEADLAMP ECU	Cracked	698.10 FL	*698.10 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

**Sub Total (\$\$) 12,799.90 8,312.40**  
**- List Item Discount on L Items 20.00/20.00% (\$\$) 2,552.98 1,658.48**

**Total Parts (\$\$) 10,246.92 6,653.92**

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Report was unsubmitted during this print-out.						

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b><u>Labour Items</u></b>				
1	TOWING (BY OWNER)-BILL ATTACH	New	70.00	70.00
2	REMOVE AND REFIX AIRCON ,CHECK ,VACUUM & REFILL GAS	New	100.00	100.00
3	REMOVE & REFIX FRT BUMPER & ATTACHMENTS ,GRILLE ,FRT RH FENDER ,FRT SUPPORT PANEL ,KNOCKING & REPAIR FRT RH FENDER PANEL & REALIGN BONNET THE SAME	New	700.00	600.00
4	PUTTY & RESPRAY FRT BUMPER & REINFORCEMENT ,BONNET ,FRT RH FENDER & INNER PANEL ,FRT RH DOOR & ALL AFFECTED AREAS	New	950.00	850.00
5	REMOVE & REFIX FRT RH UNDERCARRIAGE & REALIGN THE SAME	New	180.00	80.00
6	TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT	New	60.00	60.00
7	RUSTPROOFING	New	60.00	30.00
8	REMOVE & REFIX FRT RH RIM ,BALANCING & REALIGN THE SAME	New	100.00	60.00
<b>Gross Labour Cost (\$\$)</b>			<b>2,220.00</b>	<b>1,850.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >