

ASS. REC. BY:

REF:

CS/FCI/9014018/R1v d3/n2

Special Instruction:

Survey: Rasul

ASSIGNMENT (Office)

From (Person): Joonne Yong of FCI Date/Time: 9.8am @ 12/8/19

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SLH 9709X Insured: SHD 68779

at Workshop m/s Performance Tel: 6319 0174

of 303 Alexandra Road

Policy No: Claim No: D19005136 MFSTH

Sum Insured: Excess:

Make of Veh: D.O.A. 6/8/2019
(Client's Record)

CA / REV / REP. / REV 24 HRS (DS)

H.O.D. Endorsement:

Date/Time: 10.12am @ 13/8/19 Person Contacted: Caroline Vehicle IN / OUT

Date/Time	Action/Instruction
	SLH 9709X-X
	SHD 68779-X
27/8/19	Email preli revised to FCI
9/10/19	Final fig \$ 2057 confirmed by email (Ref 1865.65, 4890)

ASS. REC. BY:

REF:

FCI

105W

ASSIGNMENT

From:

Date:

28/8/19

Estimated Cost:

OD / ☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SLH 9709X

at Workshop m/s

performance

of

303 Almond Road

Insured:

Policy No.

Claims No.

Sum Insured:

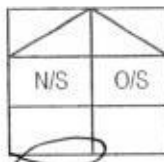
Excess:

(Client's Record)

Make of Veh:

Before 12pm
Inthiran

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.:

Yes or No

Lum Sum:

%

3 Val.:

Yes or No

CA / REV / REP. / 24 HRS

(DS)

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No:

SLH 9709X

Yr Regn:

2016 / NOV

Type: ☒ Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

B.M.W 116D

C.C

1496

Colour:

BLACK

A/C:

Insured / Std / NI / NA

Sp. Reading

41988

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WDA 1V72040V725242

Gen. Cond: Good / ☒ Fair / Poor / BurntSteering: ☒ Inorder / Jammed / Leaked / Burnt orBrake: ☒ Inorder / Jammed / Leaked / Burnt orModi: Nil / ☒ S/Rim / STD A/Rim or

Tyre Size:

F:

205/55R16

R:

1.

☒ BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

06/08/19

D.O.I.

26/08/19

Survey held at

Performance

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

RECEIVED 09 OCT 2019

Date/Time, File Pass to?



: Preli. Report

1)



: Final Report

Date/Time, File Return to?

2) q/w - typist

Report Format:

CWS

Lump Sum / L.B.B. (\$)

2057

Days Of Repair:

3

Resurvey No. of Trip:

1

Add Fee:



: Site Insp (\$)



: Interview (\$)



: Tech. Invs (\$)



: Weekend (\$)

Survey Fee:

Transportation:

S + RS, SI

Fines:

Offices:

TOTAL

130

50

50

16

246



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI19014018/R1vd3n2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 09-10-2019	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHD 6877G	Veh. Inspected	SLH 9709X	
Policy No.		Coverage (\$)	0.00	
Claim No.	D19005136MFSH	Excess (\$)	0.00	
Assign From	JOANNE YONG	Assign Date	13/08/2019	
2. Vehicle Particulars & Condition				
Make & Model	BMW 116D	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	WBA1V72040V725242	Colour	BLACK	
Odometer	41988	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/55 R16	BRIDGESTONE	6 mm	
L/H Front Tyre	205/55 R16	BRIDGESTONE	6 mm	
R/H Rear Tyre	205/55 R16	BRIDGESTONE	6 mm	
L/H Rear Tyre	205/55 R16	BRIDGESTONE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	06/08/2019	Inspection Date	26/08/2019	
Survey held at	PERFORMANCE MOTORS LTD 303 ALEXANDRA ROAD SINGAPORE 159941			
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days		

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLH 9709X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER PRIMED (RFC)(SN)	TO REPAIR SEE LABOUR	1,015.00	-
1	REAR PDC HOLDER SET (SN)	SERVICEABLE	24.60	-
1	(DG/SL) ADHESIVE SET K6 (SN)	SERVICEABLE	53.05	-
1	SUNDRIES (SN)	NECESSARY	80.00	40.00
1	REAR NUMBER PLATE (ADDITIONAL)(SN)	SCRATCHED	83.00	83.00
			1,255.65	123.00
	<u>LABOUR</u>			
	TO REPLACE REAR BUMPER AND ATTACHMENTS.		1,275.00	850.00
	PAINTING REAR BUMPER.		1,038.00	934.00
	TO CHECK ELECTRICAL WIRING SYSTEMS AND LIGHTINGS AT THE REAR SECTION FOR PROPER FUNCTION.		177.00	150.00
	TO REMOVE OLD PDC ASSEMBLY, REPLACE DAMAGED PARTS AND RECONNECT TO NEW BUMPER INCLUDING CONDUCT CHECKS FOR PROPER FUNCTION.	NOT NECESSARY	177.00	-
			2,667.00	1,934.00
	GRAND TOTAL		3,922.65	2,057.00
	RECOMMENDED COST OF REPAIRS			2,057.00

Report Ref No. CS/FCI19014018/R1vd3n2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

ADRIAN LING WAI PING**B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI**

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report in whole or in part, does so at his or her own risk.