Surveyor Smon	ASSIGNME		11. 16 17 574 19
From (Person): Iran Can	of Ing of M	529	Date/Time: 14.2.19 17074.m
Estimated Cost:		Bill to:	
To Inspect Vehicle No:			Insured: 'YP 2102 X
at Workshop m/s N-51	<b>butomotive</b>		Tel: 68420051 Ah Young 84821
of kaki Bull Autohul	2 kg/s Bull Ma		
Policy No: A287 23700 M	cc	Claim No:	601003
Sum Insured:		Excess:	
1 ( ) ( ) ( )			
Make of Veh:			D.O.A. 24.1.19
(Client's Record)	np		D.O.A. 24.1.19
(Client's Record)  CA / REV / REP. / REV 2-2	HRS W	ai Tinh	H.O.D. Endorsement:
(Client's Record)	HRS	zi Ting	H.O.D. Endorsement:
(Client's Record)  CA / REV / REP. / REV 24  Date/Time: 19.3. 19 (0.5)	Person Contacted:	zi Ting	H.O.D. Endorsement:
(Client's Record)  CA / REV / REP. / REV 2-  Date/Time: 19.3. 4 (0.5)  Date/Time Action/Instruction	Person Contacted:		H.O.D. Endorsement:  Vehicle IN OUT
CA / REV / REP. / REV 24  Date/Time: 19.8. 19 (0.5)  Date/Time Action/Instruction  GB H C458)	Person Contacted:	zų.	Vehicle IN POUT  DOA - 24/07/2019
CA / REV / REP. / REV 24  Date/Time: 19.8. (0.5)  Date/Time Action/Instruction  GB H C458)	Person Contacted: on ( V ) Estimate 1 - AAI INC 190131561 - NAI INC 190131561	Z4 Z4	H.O.D. Endorsement:  Vehicle IN LOUT  DOA - 24/04/2019  DOA - 24/04/2019
CA / REV / REP. / REV 2-Date/Time: 19.8. 19 (0.5)  Date/Time: Action/Instruction  GB H C458)  VP 210-X  VM 8119 @ 2.18 M	Person Contacted: on ( V ) Estimate 1 - AAI INC 190131561 - NAI INC 190131561	Z4 Z4	Vehicle IN POUT  DOA - 24/07/2019

Wilm



MSIG Insurance (Singapore Pte. Ltd) (Co. Reg. No 200412212G)

4 Shenton Way. #27-01, SGX Centre 2, Singapore 068807

Tel +65 6827 7888, Fax +65 6827 7800

www.msig.com.sg

# **Inspection Report**

Executive Claims Services

Vehicle Reg No Make Model Passenger capacity Paint colour & code Paint type  Vehicle Extras: In-built camera Modification  Tyre Condition: Front right Front left Rear right  General Data: Date of assignment Inspection location  Cost Details: Repairer Parts Supplementary Miscellaneous Body Labour Paint labour Paint labour Paint labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Repair Authorised  Find # 10							
Vehicle Details:  Vehicle Reg No  Make  Model  Passenger capacity Paint colour & code Paint type  Vehicle Extras: In-built camera Modification  Tread mm  Size  Condition  Tread mm  Size  Condition  Tread mm  Size  Condition  Tread mm  Front right  Front right  Front right  Front left Rear left Rear left Date of ac.ident Date of ac.ident Date of assignment Inspection location  Cost Details: Repairer  Repairer  Adjuster  Painting Process:  Prepare off vehicle Painting off vehicle Neither (default)  Inspection location  Cost Details: Repairer  Adjuster  Panel repair calculator used Yes / No  Margin Repair / Fast-line  Others:  Repair Authorised	Type of Survey:	OD - Excess	7	Vehicle Data:			
Vehicle Details:  Vehicle Reg No  Make  Model  Passenger capacity  Paint colour & code  Paint type  Vehicle Extras:  In-built camera  Modification  Tyre Condition:  Tread mm  Size  Condition  Tread mm  Size  Condition  Tread mm  Size  Condition  Trear left  4 Bridgeslowe  Date of accident  Date of inspection  Date of assignment  Inspection location  Cost Details:  Repairer  Parts  Supplementary  Miscellaneous  Body  Paint  Paint labour  Paint labour  Paint labour  Paint material  TOTAL  Total less excess  Estimated days for repair  Repair Authorised  Engine No VIN No  Engine No VIN No  Engine Ro Ves / No  Handbrake  Footbrake  Footbrake  Seviceable  Yes / No  Handbrake  Footbrake  F	6	TP Without Prejuc	dice	Odometer reading	21165 km		
Vehicle Reg No Make Model Passenger capacity Paint colour & code Paint type  Vehicle Extras: In-built camera Modification  Tyre Condition: Front right Front left Rear right  General Data: Date of assignment Inspection location  Cost Details: Repairer Parts Supplementary Miscellaneous Body Labour Paint labour Paint labour Paint labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Repair Authorised  Find # 10 # 10 # 10 # 10 # 10 # 10 # 10 # 1				Engine No			
Make Model Model Dyna 3:0 Passenger capacity Paint colour & code Paint type  Vehicle Extras: In-built camera Modification  Tread mm Size Steering Body Paint  Tyre Condition: Front right Front left Rear left Rear right  General Data: Date of fassignment Inspection location Date of assignment Inspection location  Cost Details: Repairer Paint material TOTAL Towing Excess Repair Authorised  Reason(s)  Margin Repair / Fast-line Others:  Repairer Authorised  Publice Condition: Seviceable Yes / No Handbrake Footbrake Footbrake Seviceable Yes / No Handbrake Footbrake Footbrake Seviceable Yes / No Handbrake Footbrake Footbrake Footbrake Footbrake Seviceable Yes / No  Paint indurate Paint material TOTAL Lump / Global Sum Reason(s) Margin Repair / Fast-line Others:	Vehicle Details:			VIN No			
Model Passenger capacity Paint colour & code Paint type Paint type Paint type  Vehicle Extras: In-built camera Modification  Tyre Condition: Front right Front left Rear left Rear left Date of accident Date of assignment Inspection location  Cost Details: Repaire Adjuster Paint labour Paint material TOTAL Towing Excess Externs Repair Authorised  Repair Authorised  Repair Authorised  Vehicle Condition: Seviceable Yes / No Handbrake Footbrake Steering Body Paint Handbrake Footbrake Steering Body Paint Handbrake Footbrake Steering Body Paint Paint material Front left Rear left Paint material Frepair calculator used Yes / No  Margin Repair / Fast-line Others:	Vehicle Reg No	GBH 6	458 H	Engine capacity			
Model Passenger capacity Paint colour & code Paint type Paint labour Paint material TOTAL Towing Excess Extimated days for repair  Pyes / No  Vehicle Condition: Seviceable Yes / No  Handbrake Footbrake Steering Paint type Paint labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  Others:	Make	Toyoto	1	Engine modification			
Passenger capacity Paint colour & code Paint type  Vehicle Extras: In-built camera Wes/ No Modification  Tread mm Size Steering Body Paint  Tyre Condition: Front right Front left Rear left Rear right  General Data: Date of ascident Date of inspection Date of inspection Date of inspection Inspection location  Cost Details: Repairer  Adjuster  Repair Adjuster  Repair (Rear is)  Seviceable Yes / No  Vehicle Condition: Seviceable Yes / No  Paint  Paint    Vehicle Condition: Seviceable Yes / No  Vehicle Condition: Seviceable Yes / No  Paint  Paint    Paint	Model	Dyna	3.0				
Paint type  Vehicle Extras: In-built camera No Modification  Tread mm Size Condition  Tread mm Size Condition  Tread mm Size Condition  Front right Front left Rear left Rear left Rear left Rear right  General Data: Date of ascident Date of inspection Date of inspection Date of inspection location  Cost Details: Repairer  Repairer  Adjuster  Painting Process: Prepare off vehicle Painting off vehicle Neither (default)  Remarks: Panel repair calculator used Yes / No  Miscellaneous Body Labour Paint labour Paint labour Paint material TOTAL TOWING Excess Total less excess Estimated days for repair  Repair Authorised  Handbrake Footbrake Steering Body  Reason(s)  Hargin Repair / Fast-line  Others:	Passenger capacity						
Vehicle Extras: In-built camera Wes/No Modification  Tread mm Size Condition  Front right Front left Rear left Rear right  General Data: Date of accident Date of inspection Date of inspection location  Cost Details: Repairer Parts Supplementary Miscellaneous Body Labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Footbrake Steering Body Body  Restring  Footbrake Steering Body Body Body Body Body Body Body Body	Paint colour & code	Silve	eri	Vehicle Condition:	Seviceable Yes / No		
Vehicle Extras: In-built camera Modification  Tyre Condition:  Tread mm  Size  Condition  Tread mm  Size  Condition  Front right Front left Rear left Rear right  General Data: Date of accident Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint dadays for repair  Others:  Repair Authorised	Paint type			Handbrake			
In-built camera Modification  Yes / No Yes / No No yes / No Yes / No No yes / No Yes / No No yes / No No yes / No No yes / No Yes / No No yes / No No				Footbrake			
Tyre Condition:  Tread mm  Size  Condition  Front right Front left Rear left Rear left Rear right  General Data: Date of accident Date of inspection Date of assignment Inspection location  Cost Details: Repairer Repairer Repairer Repairer Repair Adjuster Remarks:	Vehicle Extras:			Steering			
Tyre Condition:  Tread mm  Size  Condition  Front right  Front right  Rear left  Rear left  Rear right  General Data:  Date of accident  Date of inspection  Date of assignment  Inspection location  Cost Details:  Repairer  Adjuster  Parts  Supplementary  Miscellaneous  Body Panel Repair:  Panel repair calculator used  Yes / No  Remarks:  Paint labour  Paint labour  Paint labour  Paint material  TOTAL  Towing  Excess  Total less excess  Estimated days for repair  Others:  Condition  Condition  Size  Condition  Condition  Front right  Figure 45 / 15 / 12  Painting Process:  Prepare off vehicle  Painting off vehicle  Neither (default)  Neither (default)  Remarks:  Panel repair calculator used  Yes / No  Margin Repair / Fast-line  Others:	In-built camera	Yes No		Body			
Front right Front left Rear left Rear left Rear right  General Data: Date of accident Date of inspection Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  M 3 Bridgestone (95   75   15  Repaired Rearleft Rear left Rear le	Modification	Yes / No		Paint			
Front right Front left Rear left Rear left Rear right  General Data: Date of accident Date of inspection Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  M 3 Bridgestone (95   75   15   12   12   12   13   14   14   14   14   14   14   14							
Front right Front left Rear left Rear left Rear right  General Data: Date of accident Date of inspection Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  M 3 Bridgestone (95   75   15  Repaired Rearleft Rear left Rear le							
Front left Rear left Rear left Rear left Rear right  General Data:  Date of accident Date of inspection Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  Painting Process: Prepare off vehicle Painting off vehicle Neither (default)  Painting off vehicle Neither (default)  Panel Repair: Panel Repair: Panel repair calculator used Yes / No  Margin Repair / Fast-line  Others:	Tyre Condition:	Tread mm		Size	Condition		
Front left Rear left Rear left Rear left Rear right  General Data: Date of accident Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  Repair Authorised  Painting Process: Prepare off vehicle Painting off vehicle Neither (default)  Painting off vehicle Neither (default)  Painting off vehicle Neither (default)  Repair: Panel repair calculator used Yes / No  Remarks: Lump / Global Sum Reason(s)  Margin Repair / Fast-line  Others:	Front right	N 3	Bridgesto	ne 195 75 /15			
Rear right  General Data: Date of accident Date of inspection Date of assignment Inspection location  Cost Details: Pepairer Parts Supplementary Miscellaneous Body Labour Paint Iabour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Painting Process: Prepare off vehicle Painting off vehicle Neither (default)  Painting off vehicle Painting off vehicle Neither (default)  Repair: Panel repair calculator used Yes / No  Remarks: Lump / Global Sum  Reason(s)  Margin Repair / Fast-line  Others:	Front left	3			(26)		
Rear right  General Data: Date of accident Date of inspection Date of assignment Inspection location  Cost Details: Pepairer Parts Supplementary Miscellaneous Body Labour Paint Iabour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Painting Process: Prepare off vehicle Painting off vehicle Neither (default)  Painting off vehicle Painting off vehicle Neither (default)  Repair: Panel repair calculator used Yes / No  Remarks: Lump / Global Sum  Reason(s)  Margin Repair / Fast-line  Others:	Rear left	+	Bridgeston	e 155/12			
Date of accident Date of inspection Date of inspection Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Prepare off vehicle Painting off vehicle Neither (default)  Prepare off vehicle Painting off vehicle Neither (default)  Prepare off vehicle Painting off vehicle Neither (default)  Panel Repair: Panel repair calculator used Yes / No  Remarks:  Lump / Global Sum  Reason(s)  Margin Repair / Fast-line  Others:	Rear right	4					
Date of accident Date of inspection Date of inspection Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Prepare off vehicle Painting off vehicle Neither (default)  Prepare off vehicle Painting off vehicle Neither (default)  Prepare off vehicle Painting off vehicle Neither (default)  Panel Repair: Panel repair calculator used Yes / No  Remarks:  Lump / Global Sum  Reason(s)  Margin Repair / Fast-line  Others:				184 - 500			
Date of inspection Date of assignment Inspection location  Cost Details: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  Painting off vehicle Neither (default)  Painting off vehicle Neither (default)  Painting off vehicle Neither (default)  Neither (default)  Painting off vehicle Neither (default)	General Data:			7			
Date of assignment Inspection location  Cost Details: Repairer Adjuster Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  Repair Adjuster  Body Panel Repair: Panel repair calculator used Yes / No  Remarks: Lump / Global Sum  Reason(s)  Margin Repair / Fast-line  Others:		-	1-19	-			
Cost Details: Repairer Adjuster Body Panel Repair: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Estimated days for repair  Repair Adjuster Body Panel Repair: Panel repair calculator used Yes / No  Remarks:  Lump / Global Sum  Reason(s) Margin Repair / Fast-line  Others:		26-07					
Cost Details: Repairer Adjuster Body Panel Repair: Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Repair Authorised  Body Panel Repair: Panel repair calculator used Yes / No  Remarks:  Lump / Global Sum  Reason(s) Margin Repair / Fast-line Others:		25 - 6.	7-19	Neither (default)			
Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Panel repair calculator used Yes / No  Remarks:  Remarks:  Lump / Global Sum  Reason(s) Margin Repair / Fast-line Others:  Others:	Inspection location	N-	51	]			
Parts Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Panel repair calculator used Yes / No  Remarks:  Remarks:  Lump / Global Sum  Reason(s) Margin Repair / Fast-line Others:  Others:	Cost Details:	Renairer	Adjuster	Rody Panel Renairs			
Supplementary Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Yes / No  Remarks: Remarks:  Remarks:  Remarks:  Remarks:  Remarks:  Amagin Repair / Fast-line  Others:  Others:		Перинен	Aujustei				
Miscellaneous Body Labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Remarks:  Remarks:  Lump / Global Sum  Reason(s) Margin Repair / Fast-line Others:							
Body Labour Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Remarks:  Remarks:  Lump / Global Sum  Reason(s) Margin Repair / Fast-line  Others:  Repair Authorised	5755			1007110			
Paint labour Paint material TOTAL Towing Excess Total less excess Estimated days for repair  Remarks:  Lump / Global Sum  Margin Repair / Fast-line  Others:  Repair Authorised				1			
Paint material  TOTAL  Towing  Excess  Total less excess  Estimated days for repair  Repair Authorised  Lump / Global Sum  Reason(s)  Margin Repair / Fast-line  Others:				Remarks:			
TOTAL Towing Excess Total less excess Estimated days for repair  Repair Authorised  Lump / Global Sum Reason(s)  Margin Repair / Fast-line Others:				- Kemarks.			
Towing  Excess  Total less excess  Estimated days for repair  Repair Authorised  Reason(s) Margin Repair / Fast-line  Others:				Lumn / Global Sum			
Excess Total less excess Estimated days for repair  Repair Authorised  Reason(s) Margin Repair / Fast-line  Others:				- Lampy Global Sam			
Total less excess  Estimated days for repair  Others:  Repair Authorised				Reason(s)	Margin Repair / Fast-line		
Estimated days for repair  Others:  Repair Authorised				- """	Margin Nepali / Fast-lille		
Repair Authorised		pair		Others:			
				- Cancija			
	Repair Authorised						
	Date:						

# ...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBI	FOLDER TRA	CKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Sut	mitted	Ins Auth'ed	Status	
Main	25 Jul 2019 17:17		14 Aug 2019 17:07 Assign					New Assign Cancel Case	7
1	Main	Re	ference		Claim Details		Docume	nts	Show All
CLAIM SU	BFOLDER DI	ETAILS				[Create	ed by insurer1		
Insured: SINMAH POULTRY PROCESSING (S) PTE LTD, Co. Reg. No.: 199100209N									
Main Claimant:		OON FISHERY PT							
Vehicle Reg No.:	GBH645	58Н			Date of Loss:		019 03:00 - :59 oths and <b>11</b> Days	From LTA Reg Da	ite (Man Yr)]
Claim Type:	<b>TP</b> / 601	TP / 601003			Policy/Cover Note No.:				
Vehicle Reg No. (Insured):	YP2102X				Policy No. (Claimant):				
					Excess:				
Repairer:	N-51 Aut	omotive Pte Ltd (	kaki Bukit Aut	ohub) (HQ	) KAKI BUKIT AL	ЛТОНИВ 2	KAKI BVUKIT AVE	E 2 #01-18, 4179	921 Kaki Bukit -
Handling Insurer:	MSIG Ins	urance (Singapo	re) Pte. Ltd. (H	Q) - Tel: +6	65 6827 7888	[Handled	by Irene Tan Ge	ek Ing - 6594 25	41]
Adjuster:	LKK Auto	<b>Consultants Pte</b>	Ltd (HQ) - Tel:	6256-3561	[Imm.Adv	ice due	15/08/20191		
Adj Asg. Remarks:		on instruction, re-a						on SJE. Assign: I	HS. Contact: Zi
ASSOCIAT	ED MAIL RE	CEIVED						View All   Com	pose Case Mail
There are no	o mail for this	case.							THE STATE OF THE S
ALL ASSO	CIATED TAS		Group Subj	ect Han	dler Assign	View A	Search Tasks	Create New Ta	

#### Shiau Chan (LKKAuto)

From:

Shiau Chan (LKKAuto)

Sent:

Tuesday, 27 August 2019 2:18 PM

To:

Koh Kay Yong; SUR

Subject:

RE: GBH6458H after paint photo

Dear Ah Yong,

WITHOUT PREJUDICE

Confirm Lump Sum \$3,800.00 and 5 repair days.

Please note that the finalisation subject to insurer's approval.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: <u>siewsc@lkkauto.com</u> | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Koh Kay Yong <koh@n51.com.sg> Sent: Thursday, 22 August 2019 3:48 PM

To: SUR <sur@lkkauto.com>

Subject: GBH6458H after paint photo

Hi Shuai Chan,

COR \$3800.00 & 5 days to confirm

## Shiau Chan (LKKAuto)

From:

Koh Kay Yong <koh@n51.com.sg>

Sent:

Thursday, 22 August 2019 3:48 PM

To:

SUR

Subject:

GBH6458H after paint photo

Attachments:

PHOTO-2019-08-02-18-48-34.jpg; PHOTO-2019-08-02-18-48-34.jpg;

PHOTO-2019-08-02-18-48-34.jpg

Hi Shuai Chan, COR \$3800.00 & 5 days to confirm



MSIG Insurance (Singapore) PTE. LTG.
4 Shenton Way, #21-01, SGX Centre 2, Singapore 068807
Tel +65 6827 7888, Fax +65 6827 7800
www.msig.com.sg

# PRELIMINARY ADVICE

OD Claim / TP Claim

ottn:	Policy No Claim No	:
nsured Vehicle No : YP 2102x  TP Vehicle No : GBH 6458H  Make & Model : Toyota Dyna.		: N-51
Point of Impact / Damages:  Front Left		
Repairer's Estimate :\$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	ntion): \$ 6	\$ - '
Others:		

Surveyed By:

MSIG Insurance (Singapore) Pte. Ltd.

OD Claim Excess: \$ (Authorised / Revert)	(Without Prejudice)
Vehicle No GBH 6458H	
Part by Part / Lump Sum Repair	
Kindly arrange for surveyor to take befor	e / after painting photos
Number of Repair Days	
Surveyed by VICTOR SENG (H	p) 87747011
Date of Survey 26 - 07 - 19	
Victor _ Seng @ sg. msig-asic	n-com

# > Back to OneMotoring

**Enquire PARF/COE Rebate for Registered Vehicle** 

Vehicle Owner Particulars		
Owner ID Type:	Company	
Owner ID:	463M	
Vehicle Details		
Vehicle No.:	GBH6458H	
Vehicle to be Exported:	No	
Intended Deregistration Date:	05 Sep 2019	
Vehicle Make:	TOYOTA	
Vehicle Model:	DYNA 150 5MT	
Primary Colour:	Silver	
Manufacturing Year:	2018	
Engine No.:	1KD2810112	
Chassis No.:	JTFAT35Y00K210928	
Maximum Power Output:	-	
Open Market Value:	\$27,084.00	
Original Registration Date:	13 Aug 2018	
First Registration Date:	13 Aug 2018	
Transfer Count:	0	
Actual ARF Paid:	\$1,355.00	
Intended PARF Rebate Details		
PARF Eligibility:	No	
PARF Eligibility Expiry Date:	-	
PARF Rebate Amount:	\$0.00	
Intended COE Rebate Details		
COE Expiry Date:	12 Aug 2028	
COE Category:	C - Goods Vehicle & Bus	
COE Period(Years):	10	
QP Paid:	\$29,902.00	
COE Rebate Amount:	\$26,718.00	
Total Rebate Amount:	\$26,718.00	

The information contained herein is correct as at 05 Sep 2019

## > Back to OneMotoring

Vehicle Details			
Vehicle No. :	GBH6458H		
Vehicle Type :	B31 - Goods (Open) Lorry (Metal Body)/Picku	p	
Vehicle Attachment 1:	With Hood		
Vehicle Scheme :	Normal		
Vehicle Make :	TOYOTA		
Vehicle Model :	DYNA 150 5MT		
Chassis No.:	JTFAT35Y00K210928		
Propellant:	Diesel		
Engine No.:	1KD2810112		
Engine Capacity :	2982 cc		
Maximum Power Output:			
Maximum Laden Weight:	3500 kg		
Unladen Weight :	1760 kg		
Year Of Manufacture :	2018		
Original Registration Date :	13 Aug 2018		
Lifespan Expiry Date :	12 Aug 2038		
COE Category:	C - Goods Vehicle & Bus		
Quota Premium :	\$29,902.00		
COE Expiry Date :	12 Aug 2028		
Road Tax Expiry Date :	12 Feb 2020		
Inspection Due Date :	12 Aug 2020		
Intended Transfer Date:	05 Sep 2019		
CO2 Emission :	255.00 (g/km)		
CEV/VES Rebate Utilised Amount :			
CO Emission :	0.088000 (g/km)		
HC Emission :	0.003469 (g/km)		
NOx Emission :	0.106000 (g/km)		
PM Emission :	1.800000 (mg/km)		
	ed if road tax / lay-up has expired. Please use Enqui		
Road tax, including Over Payme Amount Payable	nt (if any), of a vehicle will follow the vehicle to the r	new registered owner when its owner	ership is being transferred.
•	Amount Before GST (S\$)	GST Amount (S\$)	Amount After G
Transfer Fee :	25.00	-	25.0
Total Amount Payable : Message			25.0

You may print this page for reference.

where applicable.

OK Print

This vehicle has a road tax Over Payment of \$10.00. This Over Payment may be used to offset Road Tax payable and Transfer Fees respectively,

# TwinCar AUTOMOTIVE PTE LTD

2 Kaki Bukit Ave 2

#01-17 / #01-18 /Heavy Vehicle #01-08 / Spray Painting #02-27 Singapore 417921 Tel No.: +65 6842 0051 Fax No.: +65 6741 0510

E-Mail: sales@n51.com.sg Company Reg. No.: 200714616M GST Registration No.: 200714616M

HONG SOON FISHERY PTE LTD 1 COLEMAN ST #03-10 THE ADELPHI SINGAPORE 179803

Contact: 97593168

#### **ESTIMATE**

Repair Code: CLM14637

Date in: 25/07/2019

Vehicle Num.: GBH6458H

Model: TOYOTA DYNA 150 5MT

Chassis/Eng#: JTFAT35Y00K210928/1KD2810112

#### Parts and Labour Assesment

FRONT BUMPER Cracked  FRONT BUMPER LH BRACKET Pended  I 182.90  FRONT BUMPER LH FOGLAMP COVER X II 131.00  FRONT BUMPER LH FOGLAMP COVER X II 131.00  FRONT GRILLE Cracked  I 561.72  FRONT GRILLE LOGO' EMBLEM rece  I 74.00  FRONT LH CORNER PANEL Cracked  I 282.10  FRONT LH CORNER PANEL BRACKET Mended  I 121.00  FRONT LH CORNER PANEL COVER MISSING  FRONT LH HEADLAMP Chip  I 760.00  FRONT LH SIDE MIRROR BRACKET Pended  I 578.10  FRONT LH SIDE MIRROR BRACKET ROUND COVER reached  I 781.20  FRONT LH SIDE MIRROR MOTOR Cracked  I 781.20  FRONT LH SIDE MIRROR MOTOR Cracked  I 781.20  FRONT LH SIDE MIRROR MOTOR BRACKET Cracked  I 189.10  FRONT LH SIDE MIRROR MOTOR BRACKET Cracked  I 189.10  FRONT PANEL DYNA' EMBLEM (mexce)  I 61.75  FRONT PANEL DYNA' EMBLEM (mexce)	Description of part	Qty	Unit Price	Amount
1   131.00   131.00	FRONT BUMPER / cracked	1	521.60	521.60
FRONT GRILLE / cracked 1 561.72 561.72  FRONT GRILLE 'LOGO' EMBLEM / rece 1 74.00 74.00  FRONT LH CORNER PANEL / cracked 1 282.10 282.10  FRONT LH CORNER PANEL BRACKET / perfect 1 61.00 61.00  FRONT LH CORNER PANEL COVER missing 1 61.00 61.00  FRONT LH HEADLAMP / Chip 1 760.00 760.00  FRONT LH SIDE MIRROR / cracked 1 578.10 578.10  FRONT LH SIDE MIRROR BRACKET / perfect 1 231.20 231.20  FRONT LH SIDE MIRROR BRACKET ROUND COVER / cracked 1 61.10 61.10  FRONT LH SIDE MIRROR MOTOR / cracked 1 781.20 781.20  FRONT LH SIDE MIRROR MOTOR / cracked 1 781.20 781.20  FRONT LH SIDE MIRROR MOTOR / cracked 1 189.10 189.10	FRONT BUMPER LH BRACKET Dented	1	182.90	182.90
FRONT GRILLE 'LOGO' EMBLEM / vect 1 74.00 74.00  FRONT LH CORNER PANEL / cracked 1 282.10 282.10  FRONT LH CORNER PANEL BRACKET / pended 1 121.00 121.00  FRONT LH CORNER PANEL COVER / m/551 mg 1 61.00 61.00  FRONT LH HEADLAMP / Chip 1 760.00 760.00  FRONT LH SIDE MIRROR / cracked 1 578.10 578.10  FRONT LH SIDE MIRROR BRACKET / pended 1 61.10 61.10  FRONT LH SIDE MIRROR BRACKET ROUND COVER / cracked 1 781.20 781.20  FRONT LH SIDE MIRROR MOTOR / cracked 1 781.20 781.20  FRONT LH SIDE MIRROR MOTOR / cracked 1 189.10 189.10	FRONT BUMPER LH FOGLAMP COVER X	1	131.00	131.00
1   282.10   282.10	FRONT GRILLE / cracked	1	561.72	561.72
1   121.00	FRONT GRILLE 'LOGO' EMBLEM / vere	1	74.00	74.00
FRONT LH CORNER PANEL COVER       1 61.00       61.00         FRONT LH HEADLAMP       Chi'p       1 760.00       760.00         FRONT LH SIDE MIRROR       Cracked       1 578.10       578.10         FRONT LH SIDE MIRROR BRACKET       Gentel       1 231.20       231.20         FRONT LH SIDE MIRROR BRACKET ROUND COVER       cracked       1 61.10       61.10         FRONT LH SIDE MIRROR MOTOR       cracked       1 781.20       781.20         FRONT LH SIDE MIRROR MOTOR BRACKET       cracked       1 189.10       189.10	FRONT LH CORNER PANEL / Cracker	1	282.10	282.10
FRONT LH HEADLAMP / Chi'p       1       760.00       760.00         FRONT LH SIDE MIRROR / Cracked       1       578.10       578.10         FRONT LH SIDE MIRROR BRACKET / Den Led       1       231.20       231.20         FRONT LH SIDE MIRROR BRACKET ROUND COVER / cracked       1       61.10       61.10         FRONT LH SIDE MIRROR MOTOR / cracked       1       781.20       781.20         FRONT LH SIDE MIRROR MOTOR BRACKET / cracked       1       189.10       189.10	FRONT LH CORNER PANEL BRACKET Jewes	1	121.00	121.00
FRONT LH SIDE MIRROR BRACKET Bendel 1 578.10 578.10  FRONT LH SIDE MIRROR BRACKET Bendel 1 231.20 231.20  FRONT LH SIDE MIRROR BRACKET ROUND COVER cracked 1 61.10 61.10  FRONT LH SIDE MIRROR MOTOR cracked 1 781.20 781.20  FRONT LH SIDE MIRROR MOTOR bracket cracked 1 189.10 189.10	FRONT LH CORNER PANEL COVER WISSING	1	61.00	61.00
FRONT LH SIDE MIRROR BRACKET Den Led  FRONT LH SIDE MIRROR BRACKET ROUND COVER cracked  1 61.10 61.10  FRONT LH SIDE MIRROR MOTOR (cracked)  1 781.20 781.20  FRONT LH SIDE MIRROR MOTOR BRACKET (cracked)  1 189.10	FRONT LH HEADLAMP Chip	1	760.00	760.00
FRONT LH SIDE MIRROR BRACKET ROUND COVER cracked 1 61.10 61.10  FRONT LH SIDE MIRROR MOTOR (cracked 1 781.20 781.20  FRONT LH SIDE MIRROR MOTOR BRACKET (cracked 1 189.10 189.10	FRONT LH SIDE MIRROR / cracked	1	578.10	578.10
FRONT LH SIDE MIRROR MOTOR / craeled 1 781.20 781.20 FRONT LH SIDE MIRROR MOTOR BRACKET / cracled 1 189.10 189.10		1	231.20	231.20
FRONT LH SIDE MIRROR MOTOR BRACKET / Cracles 1 189.10 189.10	FRONT LH SIDE MIRROR BRACKET ROUND COVER cracked	1	61.10	61.10
	FRONT LH SIDE MIRROR MOTOR (was lad	1	781.20	781.20
FRONT PANEL 'DYNA' EMBLEM / MELLC 1 61.75	FRONT LH SIDE MIRROR MOTOR BRACKET / CVALLED.	1	189.10	189.10
3 31.13	FRONT PANEL 'DYNA' EMBLEM / NECC	1	61.75	61.75
FRONT WINDSCREEN RUBBER X N N 1 380.30 380.30	FRONT WINDSCREEN RUBBER × NA	1	380.30	380.30

\*\*\* This is a computer-generated document which requires no signature.\*\*\*

20/07/2019 @ 1500 hs

20/07/2019 @ 1500 hs

The paint

Victor Sang Subject

Victor Sang Subject

Pre Subject

# TwinCar AUTOMOTIVE PTE LTD

2 Kaki Bukit Ave 2

#01-17 / #01-18 /Heavy Vehicle #01-08 / Spray Painting #02-27 Singapore 417921 Tel No.: +65 6842 0051 Fax No.: +65 6741 0510

E-Mail: sales@n51.com.sg Company Reg. No.: 200714616M GST Registration No.: 200714616M

HONG SOON FISHERY PTE LTD 1 COLEMAN ST #03-10 THE ADELPHI

SINGAPORE 179803

Contact: 97593168

#### **ESTIMATE**

Repair Code: CLM14637

Date in: 25/07/2019

Vehicle Num.: GBH6458H

Model: TOYOTA DYNA 150 5MT

Chassis/Eng#: JTFAT35Y00K210928/1KD2810112

	Subtotal before discount		4,978.07
Percentage discount 25%			1,244.52
	Sub-total 1	·	3,733.55
FRONT BUMPER CLIPS - SET	1	50.00	30 50.00
FRONT GRILLE CLIPS - SET / WELL	1	50.00	30 50.00
FRONT LH CORNER PANEL CLIPS - SET / VECC	1	30.00	20 30.00
FRONT LH DOOR COMPANY DETAIL STICKER / VELC	1	60.00	40.60.00
FRONT NUMBER PLATE NIA	1	25.00	25.00
	Subtotal before discount		215.00
Percentage discount 0%			0.00
	Sub-total 2	-	215.00
	Parts-total	? <u></u>	3,948.55
LABOUR			
To remove, reinstall electrical wiring harness, check lighting and rewire for p	arking sensor.		30 50.00
To remove, reinstall windscreen. (to FR)			100 120.00
To re-spray painting on the change bodyparts, repair portion, and where cons	istent to the accident.		650 850.00
To provide labour, workmanship to change the above damaged bodyparts, repalign body structure, body alignments and damaged consistent to the accident			500 650.00
To apply anti-rust chemical on repaired and replaced panel.		_	40 88.00
	Labour Total		1,750.00
	Parts & Labour Total		5,698.55

\*\*\* This is a computer-generated document which requires no signature.\*\*\*

Page 1 of 1

## ...CLAIM SUBFOLDER...(Pending for Survey Report)

LAIM SUB	FOLDER TRAC	CKING								
Case	Notified	Est Submitted	Adj Assigned	Adj	Rpt	Adj Submitte	d Ins Auth'e	ed	Status	
Main	25 Jul 2019 17:17		14 Aug 2019 17:07 Edit Adj Rpt		,800.00 lit Estimates	S\$3,800.00 View Rpt			Pending for Survey Report Cancel Case	
	Main	R	eference		Claim Detai	ls	Docum	ents		Show All
CLAIM SU	BFOLDER DE	TAILS				[Created	d by insurer]			
Insured:	SINMAH P	OULTRY PROCE	SSING (S) PTE L	D, Co.	Reg. No.: 1991	00209N				
Main Claimant:	LIONG SO	LIONG SOON FISHERY PTE LTD, Co. Reg. No.: 201207463M								
Vehicle Reg No.:	GBH645	8H			Date of Lo		19 03:00 - :59 hs and <b>11</b> Days	From LT	A Reg Date	(Man Yr)]
Claim Type	TP / 6010	003			Policy/Cov Note No.:		00MKC (Compre : 13/04/2019 -			
Vehicle Reg No. (Insured):	YP2102X	2X			Policy No. (Claimant)					
					Excess:					
Repairer:	N-51 Auto Tel:	motive Pte Ltd	(kaki Bukit Autol	ub) (HQ	) KAKI BUKIT	AUTOHUB 2 KA	AKI BVUKIT AVE	2 #01-1	18, 417921 1	(aki Bukit
Handling Insurer:	MSIG Inst	ırance (Singapo	ore) Pte. Ltd. (HQ	) - Tel: +	65 6827 7888	[Handled b	y Irene Tan Ge	ek Ing -	6594 2541]	
Adjuster:	15/08/20		Ltd (HQ) - Tel: 6	256-3561	[Handled b	y SIMON HO	LEONG CHUAN	(In	nm.Advic	e due
Adj Asg. Remarks:	As per Jaso Ting @ 684		assigned to LKK to	follow-up	this case, on	WP. Liab: Disp	ute(NR). Agree	on SJE. A	Assign: IHS.	Contact: Z
ASSOCIA	TED MAIL REG	CEIVED						View All	Compos	e Case Mai
There are r	no mail for this	case.								
ALL ASSO	CIATED TAS	ks⊟				View All	Search Tasks	Create	New Task	Complete
Due Dat		Type Task	Group Subje	ct Ha	ndler Ass	igned By	Completed	On	Created Or	Done

#### Claim Documents

\*GBH6458H (601003) [YP2102X] TP LIONG SOON FISHERY PTE LTD

Jul 24 2019 3:00AM
[SINMAH POULTRY PROCESSING (S) PTE LTD]
N-51 Automotive Pte Ltd (kaki Bukit Autohub)

Ass	essment Reports		1 per	page 🔻	V
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print
1	27/07/19 12:44	Accident Statement From:SC - Reg. No: YP2102X, Claimant: SINMAH POULTRY PROCESSING (S) PTE LTD	6	Load HTM	
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (Internal Surveyor)		Thumbnail	Prin
1	30/07/19 11:28	Adjuster Immediate Advice	6	Load HTM	
Pho	otos/Images		3 per	page 🔻	V
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (Internal Surveyor)		Thumbnail	Print
1	27/07/19 12:26	SURVEY PHOTO	6	Load JPG	V
2	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
3	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
4	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
5	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
6	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
7	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
8	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
9	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
10	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
11	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
12	27/07/19 12:26	SURVEY PHOTO	6	Load JPG	V
13	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
14	27/07/19 12:26	SURVEY PHOTO	6	Load JPG	V
15	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
16	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
17	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
18	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
19	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
20	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
21	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
22	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
23	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
24	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
25	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
26	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
27	27/07/19 12:26	SURVEY PHOTO	0	Load JPG	V
28	29/07/19 20:06	SURVEY PHOTO	6	Load JPG	V
29	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
30	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
31	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
32	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
33	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
34	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
35	29/07/19 20:06	SURVEY PHOTO	6	Load JPG	V
36	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
37	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V

Merimen e-Claims Page 2 of 2

Ass	essment Reports		1 per p	page 🗸	V
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print
38	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
39	29/07/19 20:06	SURVEY PHOTO	6	Load JPG	V
40	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
41	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
42	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
43	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
44	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
45	29/07/19 20:06	SURVEY PHOTO	8	Load JPG	V
46	29/07/19 20:06	SURVEY PHOTO	6	Load JPG	V
47	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
48	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
49	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
50	29/07/19 20:06	SURVEY PHOTO	0	Load JPG	V
Doc	cumentation		1 per	page 🗸	V
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print
1	25/07/19 17:19	PRI from TwinCar Automotive & GBH6458H E-file report	0	Load PDF	
2	26/07/19 10:07	Agree on SJE	0	Load PDF	
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (Internal Surveyor)		Thumbnail	Print
1	30/07/19 11:41	Preliminary Loss Advise	0	Load PDF	

#### **Documents Checklist**

DOCUMENTS CHECKLIST	Reset Save Print
There are no document checklists configured.	
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)	
	^
	~
Show Remarks To: Handling Insurer Note: Remarks are private unless you show it to other parties.	

#### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

Our File No:

CF/MSG19014361/CQF3E2

Date:

16/09/2019

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No:

A28723700MKC

Claimant Vehicle No:

GBH6458H

Insured Vehicle No:

YP2102X

Date of Loss:

24/07/2019

Nature of Claim:

TP

Claim No: 601003

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No:

**GBH6458H** 

Make & Model:

TOYOTA DYNA 150, 3.0 D (M)

Engine No:

1KD2810112

21165 km

Reg. Date:

13/08/2018 (Man. Year: 2018)

Chassis No: Odometer:

JTFAT35Y00K210928

Colour:

Silver

2982 cc

**Engine Capacity:** Market Value/New Car

Price:

N/A

Sum Insured (S\$):

Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:

Steering (Serviceable):

Yes Engine Modification:

Yes Footbrake (Serviceable):

Pre-accident Condition:

Yes

Handbrake (Serviceable):

**CONDITION OF TYRES** 

Front Tyre Size:

195/75 R15

Rear Tyre Size:

155 R12

Front Left Side:

Bridgestone 3 mm

Rear Left Side:

Bridgestone 4 mm

Front Right Side:

Bridgestone 3 mm

Rear Right Side:

Bridgestone 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,948.55	3,470.08	478.47	12.12
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,750.00	1,320.00	430.00	24.57
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	5,698.55	4,790.08	908.47	15.94
Approved Total (Overridden) (S\$)		3,800.00		
(S\$)	5,698.55	3,800.00	1,898.55	33.32
+ GST 7.00/7.00% (S\$)	398.90	266.00	132.90	33.32
Nett Amount (S\$)	6,097.45	4,066.00	2,031.45	33.32

INSPECTION

Date of Assignment:

14/08/2019

Date Inspected:

26/07/2019 Inspected At:

N-51 Automotive Pte Ltd (kaki Bukit

Autohub) (HQ)

KAKI BUKIT AUTOHUB 2 KAKI

**BVUKIT AVE 2 #01-18** Singapore 417921

Estimated Period of Repair:

5.0 days

Manager: SHIAU CHAN Adjuster: SIMON HO LEONG CHUAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

## REPAIR DETAILS

Referen	ce				
Part Source:		(Last Synchronised: 16 Sep 2019)			
Parts:	N/A	TOYOTA DYNA 150 3.0 D (M) (Model not available in database)			
Labour:	Repairer's	(Price-denominated Standard List)			
Print Code:	(Unsubmitted, no print-code for GBH6458H)				
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page				
Further Info	: Items/values r	ot in reference catalogue are prefixed with an asterisk *.			

# Recommended Parts

No.	Qty	Part No.	. Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Cracked	521.60 FL	*521.60 FL
2	1		*FRONT BUMPER LH BRACKET	Dented	182.90 FL	*182.90 FL
3	1		*FRONT BUMPER LH FOGLAMP COVER	Not Necessary	131.00 FL	*-FL
4	1		*FRONT GRILLE	Cracked	561.72 FL	*561.72 FL
5	1		*FRONT GRILLE LOGO EMBLEM	Necessary	74.00 FL	*74.00 FL
6	1		*FRONT LH CORNER PANEL	Cracked	282.10 FL	*282.10 FL
7	1		*FRONT LH CORNER PANEL BRACKET	Dented	121.00 FL	*121.00 FL
8	1		*FRONT LH CORNER PANEL COVER	Missing	61.00 FL	*61.00 FL
9	1		*FRONT LH HEADLAMP	Chipped	760.00 FL	*760.00 FL
10	1		*FRONT LH SIDE MIRROR BRACKET	Dented	231.20 FL	*231.20 FL
11	1		*FRONT LH SIDE MIRROR BRACKET ROUND COVER	Cracked	61.10 FL	*61.10 FL
12	1		*FRONT LH SIDE MIRROR MOTOR	Cracked	781.20 FL	*781.20 FL
13	1		*FRONT LH SIDE MIRROR MOTOR BRACKET	Cracked	189.10 FL	*189.10 FL
14	1		*FRONT PANEL DYNA EMBLEM	Necessary	61.75 FL	*61.75 FL
15	1		*FRONT WINDSCREEN RUBBER	Not Necessary	380.30 FL	*-FL
16	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
17	1		*SET FRONT GRILLE CLIPS	Necessary	50.00 FS	*30.00 FS
18	1		*SET FRONT LH CORNER PANEL CLIPS	Necessary	30.00 FS	*20.00 FS
19	1		*FRONT LH DOOR COMPANY DETAIL STICKER	Necessary	60.00 FS	*40.00 FS
20	1		*FRONT NUMBER PLATE	Not Necessary	25.00 FS	*-FS
21	1		*FRONT LH SIDE MIRROR	Cracked	578.10 FL	*578.10 FL
F=Fra	anchise	part. S=Spo	cNett. L=ListItemDisc.			
				Sub Total (S\$)		4,586.77
	- List Item Discount on L Items 25.00/25.00% (S\$)			1,244.52	1,116.69	
				Total Parts (S\$)	3,948.55	3,470.08

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

#### Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			
1	TO REMOVE, REINSTALL ELECTRICAL WIRING HARNESS, CHECK LIGHTING AND REWIRE FOR PARKING SENSOR	New	50.00	30.00
2	TO REMOVE, REINSTALL WINDSCREEN. (TO FR)	New	120.00	100.00
3	TO RE-SPRAY PAINTING ON THE CHANGE BODYPARTS, REPAIR PORTION, AND WHERE CONSISTENT TO THE ACCIDENT	New	850.00	650.00
4	TO PROVIDE LABOUR, WORKMANSHIP TO CHANGE THE ABOVE DAMAGED BODYPARTS, REPAIR, RECONSTRUCT AND RE-ALIGN BODY STRUCTURE, BODY ALIGNMENTS AND DAMAGED CONSISTENT TO THE ACCIDENT	E New	650.00	500.00
5	TO APPLY ANTI-RUST CHEMICAL ON REPAIRED AND REPLACED PANEL	New	80.00	40.00
	Gross Labou	r Cost (S\$)	1,750.00	1,320.00
	Report was unsubmitted during	ng this print-out.		

< END OF ESTIMATES >