

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AIG19014547/KDA3Q2

Date: 16/11/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100435873

Claimant
Vehicle No : SJG3658C **Insured Vehicle No :** SKA1860S

Date of Loss: 16/08/2019 Nature of Claim: TP Claim No: 5076093187SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJG3658C		
Make & Model:	HONDA CIVIC, 1.8 L (A)	Engine No:	R18A13035568
Reg. Date:	27/06/2008 (Man. Year: 2008)	Chassis No:	JHMF16308S216134
Colour:	Metallic Blue	Odometer:	183974 km
Engine Capacity:	1799 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55R16	Rear Tyre Size:	205/55R16
Front Left Side:	Michelin 8 mm	Rear Left Side:	Michelin 8 mm
Front Right Side:	Michelin 8 mm	Rear Right Side:	Michelin 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,787.28	4,763.60	4,023.68	45.79
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,870.00	1,510.00	1,360.00	47.39
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	11,657.28	6,273.60	5,383.68	46.18
Approved Total (Overridden) (S\$)		5,000.00		
(S\$)	11,657.28	5,000.00	6,657.28	57.11
+ GST 7.00/7.00% (S\$)	816.01	350.00	466.01	57.11
Nett Amount (S\$)	12,473.29	5,350.00	7,123.29	57.11
+ Car Rental (9.0 x S\$140.00/day + 7.00% GST) (S\$)		1,348.20		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		6,700.20		
Global Sum Settlement (S\$)		6,700.00		

INSPECTION

Date of Assignment: 20/08/2019

Date Inspected: 20/08/2019 Inspected At:

Chew Goon Motor (AMK)
Blk 10 Ang Mo Kio Industrial Park 2A,
#01-15/16 & 17, AMK Autopoint
Singapore 568047

Estimated Period of Repair: 6.0 days

Adjuster: KENNETH KONG**Manager:** CHAN JIA LE

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Bent	965.00 FL	*638.00 FL
2	12		*FRONT BUMPER CLIPS	Necessary	45.60 FL	*45.60 FL
3	1		*FRONT BUMPER BRACKET LH	Distorted	29.10 FL	*29.10 FL
4	1		*FRONT BUMPER TOP RETAINER LH	Distorted	32.00 FL	*32.00 FL
5	1		*FRONT BUMPER REINFORCEMENT	Bent	337.00 FL	*337.00 FL
6	1		*FRONT BUMPER LOWER RUBBER GUARD	Distorted	104.00 FL	*104.00 FL
7	1		*FRONT BUMPER FOG LAMP LH	Broken	250.40 FL	*250.40 FL
8	1		*FRONT BUMPER FOG LAMP BRACKET LH	Bent	110.00 FL	*110.00 FL
9	1		*FRONT BUMPER FOG LAMP COVER LH	Missing	125.00 FL	*125.00 FL
10	1		*FRONT BUMPER FOG LAMP LH	Serviceable	150.00 FL	*- FL
11	1		*FRONT BUMPER FOG LAMP WIRING HARNESS	Torn	378.00 FL	*378.00 FL
12	1		*FRONT BUMPER FOG LAMP SIDE AIR GRILLE	Missing	24.20 FL	*24.20 FL
13	1		*FRONT BUMPER CORNER RETAINER LH	Distorted	22.40 FL	*22.40 FL
14	1		*GRILLE (BLACK EDITION)	Mtg Cracked	285.00 FL	*285.00 FL
15	1		*GRILLE EMBLEM (TYPE R RED)	Necessary	110.00 FL	*110.00 FL
16	1		*GRILLE GARNISH	Repair	150.00 FL	*- FL
17	1		*HORN	Dented	125.00 FL	*125.00 FL
18	1		*ENGINE LOWER SPLASH GUARD	Cracked	175.00 FL	*175.00 FL
19	1		*HEADLAMP LH (HID)	Broken	965.00 FL	*965.00 FL
20	1		*HEADLAMP BULB (HID)	Cracked	245.00 FL	*245.00 FL
21	1		*HEADLAMP BULB BALLAST	Dented	580.00 FL	*580.00 FL
22	1		*HEADLAMP PANEL	Repair	490.00 FL	*- FL
23	1		*AIRCON CONDENSER	Serviceable	729.40 FL	*- FL
24	1		*RADIATOR	Serviceable	1,507.40 FL	*- FL
25	1		*AIR CLEANER RESONATOR	Cracked	370.00 FL	*370.00 FL
26	1		*AIR CLEANER RESONATOR HOSE	Dented	90.00 FL	*90.00 FL
27	1		*FRONT FENDER LH	Bent	566.00 FL	*566.00 FL
28	1		*FRONT FENDER SHIELD	Cracked	102.00 FL	*102.00 FL
29	10		*FRONT FENDER SHIELD CLIPS	Necessary	38.00 FL	*38.00 FL
30	1		*FRONT FENDER REINFORCEMENT	Repair	275.00 FL	*- FL
31	1		*FRONT FENDER TOP GARNISH CLIPS	Missing	3.80 FL	*3.80 FL
32	1		*SUPPORT PANEL TOP GARNISH	Cracked	110.00 FL	*110.00 FL
33	5		*SUPPORT PANEL TOP GARNISH CLIPS	Necessary	19.00 FL	*19.00 FL
34	1		*WIPER GARNISH END COVER LH	Cracked	75.00 FL	*75.00 FL
35	1		*FRONT SHOCK ABSORBER LH	Serviceable	348.50 FL	*- FL
36	1		*FRONT KNUCKLE ARM	Serviceable	295.00 FL	*- FL
37	1		*FRONT KNUCKLE ARM BEARING	Serviceable	112.30 FL	*- FL
38	1		*FRONT WHEEL HUB	Serviceable	355.00 FL	*- FL
39	1		*FRONT LOWER ARM	Serviceable	290.00 FL	*- FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$)	10,984.10	5,954.50
- List Item Discount on L Items 20.00/20.00% (\$)	2,196.82	1,190.90
Total Parts (\$)	8,787.28	4,763.60

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO PROVIDE TRANSPORTATION (TOWING)	New	80.00	50.00
2	TO CONDUCT REAR ELECTRICAL CHECK ,FOCUS HEADLAMP ETC	New	30.00	20.00
3	TO REMOVE/REFIT ,RADIATOR SYSTEM ,BLEED ,REFILL COOLANT	New	50.00	0.00
4	TO REMOVE/REFIT AIR CON CONDENSER & REFILL GAS	New	120.00	0.00
5	TO APPLY RUST PROOFING /RESEAL TUFF COATING TREATMENT TO RESPRAY /REPLACED /REPAIR PANEL	New	60.00	30.00
6	TO DISMANTLE /REPLACE FRONT UNDER CARRIAGE	New	250.00	0.00
7	TO CONDUCT COMPUTERIZE WHEEL ALIGNMENT TEST	New	80.00	60.00
8	LABOUR CHARGE -PANEL BEATING ,REPAIRING OF BONNET CHASSIS MEMBER ,SUPPORT ,TOP GANEL ,FRONT DOOR N/S CNT ,WELD FENDER REINFORCEMENT AND PARTS REPLACEMENT	New	1,000.00	550.00
9	TO RESPRAY AFFECTED AREAS	New	1,200.00	800.00
Gross Labour Cost (\$\$)			2,870.00	1,510.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >