

ASS. REC. BY:

KJL

CS/CTI 19014669/Hq f30x

Special Instruction:

Surveyor

Hock Ann

ASSIGNMENT (Office)

From (Person):

Tan Kah Long

of

CTI

Date/Time:

21.8.19 12.07 PM

Estimated Cost:

Bill to:

OD (TP) / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLA 43125

Insured:

GA 3808 U

at Workshop m/s:

Teamwork Garage

Tel:

68442475

of

5345 Ave 1 #01-24

Policy No:

DMCRSN30437719000

Claim No:

SNM19D203871C02

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

17.8.19

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

21.8.19 @ 12.00pm

Person Contacted:

Duren

Vehicle

IN OUT

Date/Time

Action/Instruction

(✓) Estimate

SLA 43125 - NA/IN/ 19/08/2019

D.O.A - 17/08/2019

GA 3808 U - NA/IN/ 19/08/2019

D.O.A - 17/08/2019

RES. REC. BY: H-ANIV

REF: CTI

ASSIGNMENT

From:

Date:

26/8/2019

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

SLQ 4312S

at Workshop m/s:

Teamwork Garage

of:

53 ubi Avenue 1 # 01-24

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

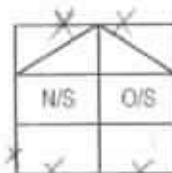

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

11

days

Res.:

Yes or No

Lump Sum:

25

%

3 Val:

Yes or No

CA / REV / REP. / 24 HRS

hp

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLQ 4312S

Yt Regn:

06/06/2016

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

T. LEXUS IS 200T (AT) cc 1998

Colour:

silver

A/C:

Insured / Std / NI / NA

Sp. Reading:

63002 km T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JTHBA1D2505028689

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 225/35/2R19

R: 255/30/2R19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Fut. Michelin / Ror. Michelin

Front:

Rear:

R/Bal:

6

mm

R/Bal:

6

mm

L/Bal:

6

mm

L/Bal:

6

mm

D.O.A:

17/8/19

D.O.A:

26/8/19

Survey held at

Teamwork Garage

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

MV - 97400

NV - 67937

NV - 29400

MV - 96-97

Remarks: This case workshop already discuss workshop
Finalised total Amount, Agree by Teamwork

(PER 8 21344.59, 64%)

Date/Time, File Pass to?

□

: Preli. Report

n 20/9 2019

□

: Final Report

Date/Time, File Return to?

3)

Add Fee:

□

: Site Insp (\$

□

: Interview (\$

□

: Tech. Insp (\$

□

: Weekend (\$

Report Format:

MER-TP

Lump Sum / L.P.:

11750

Days Of Repair:

COR = \$11750, 100R 11days (1st time)

Resurvey No. of Trip:

1

Survey Fee:

770

Transportation:

8 + RS, 31

Fines:

Given:

Total:

770

*Noted: not estimate work
(PRS) case

*Noted: This case workshop
handler Nathan required
Exchange rate Estimate

Hock Ann (LKK Auto)

From: Hock Ann (LKK Auto)
Sent: Thursday, 19 September, 2019 2:00 PM
To: claims@teamworkgarage.com; Darren
Cc: SUR
Subject: RE: SLQ4312S TOYOTA LEXUS FINALIZATION

'WITHOUT PREJUDICE'
SAVE AS TO COSTS

Dear letitia/darren,

Good day, o.k will be process base on finalized total amount COR \$ 11750 and DOR 11 days close.

Thnaks.

Best Regards,
Hock Ann | Assistant Automotive Assessor
LKK Auto Consultants
Phone: 6741 3061 | Email: HockAnn@lkkauto.com | fax: 6256-4315
Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: claims@teamworkgarage.com [mailto:claims@teamworkgarage.com]
Sent: Wednesday, 18 September, 2019 5:52 PM
To: Hock Ann (LKK Auto)
Cc: 'TEAMWORK GARAGE CLAIMS'
Subject: RE: SLQ4312S TOYOTA LEXUS FINALIZATION

Hi Hock Ann,

We confirm COR @ \$11750 and DOR 11 days

Thank you and have a nice day! ☺

Letitia
Teamwork Garage Pte Ltd
Blk 53 Ubi Avenue 1 #01-24 Paya Ubi Industrial Park
Singapore (408934)
Tel: 6844 2475 | Fax: 6844 2474

From: Darren [mailto:claims@teamworkgarage.com]
Sent: Friday, September 6, 2019 12:21 PM
To: HockAnn@lkkauto.com
Subject: SLQ4312S TOYOTA LEXUS FINALIZATION

Hi Hock Ann,

Based on estimate calculation:

COR @ \$16700

DOR @ Counter propose 13-14 days

Please revise and get back to us so that we can close the case asap

Darren

Teamwork Garage Pte Ltd

53 Ubi Avenue 1

#01-24 Paya Ubi Industrial Park

Singapore 408934

Tel: 68442475

Fax: 68442474



Pte Ltd

TeamWork Garage Pte Ltd

53 Ubi Avenue 1 #01-23/24 Spore 408934

Paya Ubi Industrial Park

Tel : 6844 2475

E-mail : claims@teamworkgarage.com

ROC number : 201015366H

REPAIR PERFORMA INVOICE

CHINA TAIPING SINGAPORE

Vehicle number	SLQ4312S
Make / Model	TOYOTA/LEXUS
Chassis number	JTHBA1D2505028689
Accident Date	17.08.19
File ref	1908-38

Qty	Particulars	Unit Price - SGD \$
<u>PARTS REPLACEMENT - LIST ITEMS</u>		
1	FRONT BUMPER ✓ Broken	1092.96 927.50 ✓
2	FRONT BUMPER REINTER L/H ✓ CRA R/H X SVC	278.54 74.70 ✓
1	FRONT BUMPER LOWER GRILLE ✓ CRA	323.96 223.50 ✓
1	TOW COVER ✓ CRA	61.64 ✓
1	FRONT GRILLE ASSY ✓ CRA	841.69 493.74 ✓
1	FRONT GRILLE EMBLEM ✓ acc	70.15 ✓
2	FRONT FOG LAMP L/H ✓ CRA R/H X SVC	1186.82 346.90 ✓
2	FRONT FOG LAMP COVER L/H ✓ CRA R/H X SVC	118.20 59.10 ✓
2	FRONT HEADLAMP L/H ✓ CRA R/H X SVC	5239.64 1614.15 ✓
1	BOOTLID ✓ BT	874.35 650.50 ✓
2	BOOTLID HINGE L/H ✓ DD R/H X SVC	730.94 220.30 ✓
1	BOOTLID LOCK ✓ Jm	555.80 385.40 ✓
1	BOOTLID LOCK STIRKER X SVC	177.68
1	BOOTLID GARNISH ✓ DD	433.55 200 ✓
1	BOOTLID EMBLEM LOGO ✓ acc	76.02 ✓
1	BOOTLID EMBLEM-LEXUS ✓ acc	79.81 ✓
1	BOOTLID EMBLEM - IS2500 ✓ acc	83.03 ✓
1	BOOTLID INNER LAMP LH ✓ CRA	783.27 450.50 ✓
1	REAR BUMPER ✓ CRA	1190.71 880.50 ✓
2	REAR BUMPER RETAINER ✓ acc	349.24 86.25 ✓
1	REAR BUMPER REINFORCEMENT ✓ DM	531.19 410.60 ✓
1	REAR BUMPER LOWER GARNISH L/H ✓ CRA	560.86 400.50 ✓
2	REAR BUMPER REFLECTOR L/H X SVC R/H X SVC X	375.36
1	END PANEL ✓ DD	970.72 811.90 ✓
1	END PANEL TOP GARNISH ✓ DM	435.39 250.80 ✓
1	SPARE TYRE TOP BOARD X SVC	86.83
1	REAR LH FENDER ✓ CR4	1401.51 1044.45 ✓
1	REAR LH TAILLAMP PANEL ✓ BT	323.84 180.30 ✓
1	REAR LH TAILLAMP ✓ CRA	864.57 680.50 ✓
1	REAR LH FENDER INNER TRIM ✓ CRA	776.25 350.50 ✓
1	REAR LH WHEELHOUSE PANEL R X SVC	756.59
1	REAR LH AIR VENT ✓ CRA	153.99 105.20 ✓

1	REAR EXHAUST SILENCER	X SVC	1961.33
1	REAR EXHAUST HEAT SHIELD	X SVC	318.55
2	EXHAUST MOUNTING	X SVC	80.50
1	REAR LH SHOCK ABSORBER	X SVC	391.46
1	REAR LH KNUCKEL ARM	X SVC	1001.42
1	REAR LH KNUCKLE BEARING	X SVC	702.77
1	REAR LH LOWER ARM	X SVC	521.99
1	REAR WINDSCREEN MOULDING	✓ nec	182.16 127.20 ✓
			26915.28
Less 25%			6728.82
Subtotal			20186.46
Balance			20186.46
<u>PARTS REPLACEMENT - SPECIAL NETT ITEM</u>			
1 SET	FRONT BUMPER CLIP	✓ nec	50.00 \$20
1 SET	FRONT GRILLE CLIP	✓ nec	60.00 \$20
1	FRONT NUMBER PLATE	✓ CR9 (with Humer)	80.00 \$40
1 SET	REAR BUMPER CLIP	✓ nec	50.00 \$20
1 SET	END PANEL TOP GARNISH CLIP	✓ nec	60.00 \$15
1 SET	FENDER INNER TRIM CLIP	✓ nec	60.00 \$15
1 SET	REAR NUMBER PLATE	X SVC	80.00
1 SET	WINDSCREEN SEALANT	(Rear) Nec ✓	150.00 \$30
			590.00
<u>LABOUR AND MISCELLANEOUS CHARGES</u>			
1	CHECK FRONT AND REAR WIRING AND LIGHTNING SYSTEM		120.00 \$40
2	REMOVE AND REFIT GARNISH ,LINING AND TRIM FOR REPAIR		200.00 \$50
3	CHECK WHEEL ALIGHMENT		200.00 X
4	REMOVE AND REPLACE FRONT UNDERCARRIAGE PARTS		200.00 X
5	MOUNT VEHICLE ON BENCH FOR CHASSIS REPLACEMENT		300.00 X
6	REMOVE AND REFIT FUEL TANK → 2/H		200.00 \$40
7	REMOVE AND RENEW FLOOR INSULATOR		150.00 X
8	REMOVE AND RENEW EXHAUST ASSY → 2/H only		150.00 \$40
9	REMOVE AND REFIT REAR WINDSCREEN		150.00 \$100
10	TRANSFER PARTS, ATTACHMENT FROM OLD BOOTLID TO NEW		150.00 \$30
11	PANEL BEATING ON AFFECTED PANEL	Rear 7ps + 1st 1ps	2600.00 \$1600
12	SPRAY PAINTING ON AFFECTED PANEL	Rear 5ps + 1st 1.5	2600.00 \$1400
13	APPLY ANTI RUST ON AFFECTED PANEL		150.00 \$40
			7170.00
GRANDTOTAL			27946.46

33094.59

33094.59

CHINA TAIPING SINGAPORE

Vehicle number	SLQ43125
Make / Model	TOYOTA/LEXUS
Chassis number	JTHBA1D2505028689
Accident Date	17.08.19
File ref	1908-38

Qty	Particulars	Unit Price - SGD \$
<u>PARTS REPLACEMENT - LIST ITEMS</u>		
1	FRONT BUMPER SPONGE ✓ C.R.A	145.20 100.50 ✓
2	FRONT BUMPER REINFORCEMENT X R SUC	388.40
1	FRONT BUMPER REINFORCEMENT INNER GUIDE ✓ C.R.A	201.30 144.30 ✓
1	FRONT BUMPER LH SIGNAL LAMP ✓ DM	688.30 480 ✓
1	FRONT BRAKE AIRDUCT ✓ HH DM	311.80 170.80 ✓
1	FRONT SUPPORT PANLE LOWER SIDE GARNISH L/H ✓ C.R.A	210.50 133.80 ✓
1	FRONT GRILLE LOWER GARNISH ✓ C.R.A	513.50 284.85 ✓
1	REAR RH TAILLAMP ✓ scratches outer housing	864.57 680.50 ✓
1	REAR RH BOOTLID LAMP ✓ scratches outer housing	783.27 450.50 ✓
1	BOOTLID INNER TRIM ✓ C.R.A	432.40 250.80 ✓
1	FRONT NUMBER PLATE BASE ✓ DM	90.00 50 ✓
1	BOOTLID HINGE COVER L/H X SUC	101.60
LKK Auto Consultants hence notify the Repairer of the following: • To resurvey before/after spray painting • To display damaged part(s) during resurvey • Parts prices are subject to confirmation • Third party survey is on a "Without Prejudice" basis • No illegal modification(s) is allowed • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company Acknowledged by Repairer Signature: Date:		parts : 14111.69 less : 25% 10583.76 spe nett : 760
		labour : 3340 = 14683.76 1/5 less 20% Total 1/5 amount 11747.10
		4730.84 Less 25% Subtotal 3548.13
		Balance 3548.13
<u>PARTS REPLACEMENT - SPECIAL NETT ITEM</u>		
2ps 1 SET	FRONT GRILLE SENSOR centre ✓ short	800.00 1300 ✓
1 SET 2ps	REAR REVERSE SENSOR L/H ✓ Broken C.R.A	800.00 300 ✓
Balance		5148.13

28/8/19

*L/S repair 11 day
 without perform
 8511887
 2.30pm 27/8/19 # resurvey after point #*

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	21 Aug 2019		21 Aug 2019 12:07 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All																				
CLAIM SUBFOLDER DETAILS		[Created by insurer]																						
Insured:																								
Main Claimant:		KOH CHIN SUN, ID: S1429529A																						
Vehicle Reg. No.:		SLQ4312S	Date of Loss:	17/08/2019 13:00 - :59																				
Claim Type:		TP / SNM19D203871C02	Policy/Cover Note No.:	DMCVSN30437719000																				
Vehicle Reg. No. (Insured):		GQ3808U	Policy No. (Claimant):	S105956486																				
		Excess:	S\$1,000.00																					
Repairer:		Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park, 408934 Ubi - Tel: 6844 2475																						
Handling Insurer:		China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Tan Kah Leong - 63896193]																						
Claimant's Insurer:		NTUC Income Insurance Co-operative Ltd (HQ) - Tel:																						
Adjuster:		LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 30/08/2019]																						
ASSOCIATED MAIL RECEIVED			View All	Compose Case Mail																				
There are no mail for this case.																								
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete <table border="1"> <thead> <tr> <th>Due Date</th> <th>Priority</th> <th>Type</th> <th>Task Group</th> <th>Subject</th> <th>Handler</th> <th>Assigned By</th> <th>Completed On</th> <th>Created On</th> <th>Done?</th> </tr> </thead> <tbody> <tr> <td colspan="10">No results.</td> </tr> </tbody> </table>					Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?	No results.									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?															
No results.																								

Nivitha (LKK Auto)

From: Tan Kah Leong <KahLeong.Tan@sg.cntaiping.com>
Sent: Wednesday, 21 August 2019 12:00 PM
To: Darren; assignments
Subject: RE: OUR REF: SNM19D203871-GQ3808U-TKL - FW: OUR REF : 1908-38 //YOUR REF : GQ3808U ACCIDENT INVOLVING GQ3808U AND SLQ4312S

WITHOUT PREJUDICE

Dear Darren,

We refer to your email of 21.08.2019.

We will be assigning M/s LKK Auto Consultants to survey your client's vehicle on a without prejudice basis.

Aside to LKK,

Please refer to the email below & proceed to survey the third party vehicle.

Thank you.

Regards

Tan Kah Leong
Assistant Executive
Claims Department

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road #15-00 Springleaf Tower Singapore 079909
DID: (65) 6389 6193 | F: (65) 6222 1033

W: www.sg.cntaiping.com | **FB:** www.facebook.com/chinataipingsg/

Disclaimer: This e-mail and any files transmitted with it is intended only for the named recipients and may contain confidential information. Any unauthorized disclosure, use or dissemination of this message, either in whole or partial, is prohibited. If you are not the intended recipient, please notify the sender immediately. Please delete the e-mail and any copies of it thereafter.

From: Darren [mailto:claims@teamworkgarage.com]
Sent: Wednesday, 21 August, 2019 11:52 AM
To: Tan Kah Leong <KahLeong.Tan@sg.cntaiping.com>
Subject: RE: OUR REF: SNM19D203871-GQ3808U-TKL - FW: OUR REF : 1908-38 //YOUR REF : GQ3808U ACCIDENT INVOLVING GQ3808U AND SLQ4312S

Hi Kahleong,

Please appoint LKK

Darren
Teamwork Garage Pte Ltd
53 Ubi Avenue 1
#01-24 Paya Ubi Industrial Park
Singapore 408934
Tel: 68442475
Fax: 68442474

From: Tan Kah Leong

Sent: Wednesday, 21 August 2019 11:24 AM

To: claims@teamworkgarage.com

Subject: RE: OUR REF: SNM19D203871-GQ3808U-TKL - FW: OUR REF : 1908-38 //YOUR REF : GQ3808U ACCIDENT INVOLVING GQ3808U AND SLQ4312S

Without Prejudice

Dear Shu Shan,

We refer to your email dated 21 August 2019.

We intend to conduct a pre-repair survey of the damage to your client's vehicle jointly with your client/your motor workshop. We propose to use one of the following motor surveyors to conduct the joint pre-repair survey as a single joint expert.

ADRIAN LING
LOW SAR HUEI
SEE CHEW SENG
MOHD FADHILAH BIN OSMAN
XING QUO QIANG
KENNETH KONG
HONG FOOK CHOY
CHUA WEIJIE
MARCUS CHUA
HENRY NG

Please let us know within two(2) working days whether you agree to the appointment of any of these motor surveyors as a single joint expert.

You may select one of the listed motor surveyors and we will bear the cost of the pre-repair survey carried out by the single joint expert.

Thank you.

Regards

Tan Kah Leong

Assistant Executive

Claims Department

China Taiping Insurance (Singapore) Pte. Ltd.

3 Anson Road #15-00 Springleaf Tower Singapore 079909

DID: (65) 6389 6193 | F: (65) 6222 1033

W: www.sg.cntaiping.com | **FB:** www.facebook.com/chinataipingsg/

Disclaimer: This e-mail and any files transmitted with it is intended only for the named recipients and may contain confidential information. Any unauthorized disclosure, use or dissemination of this message, either in whole or partial, is prohibited. If you are not the intended recipient, please notify the sender immediately. Please delete the e-mail and any copies of it thereafter.

From: Claims Dept of CTI

Sent: Wednesday, 21 August, 2019 10:18 AM

To: Tan Kah Leong <KahLeong.Tan@sg.cntaiping.com>; Alfred Toh <alfred.toh@sg.cntaiping.com>; Chee So Chow

<sochow.chee@sg.cntaiping.com>; claims@teamworkgarage.com

Subject: OUR REF: SNM19D203871-GQ3808U-TKL - FW: OUR REF : 1908-38 // YOUR REF : GQ3808U ACCIDENT INVOLVING GQ3808U AND SLQ4312S

Dear Kah Leong,

Please conduct PRS for SLQ4312S.

Note : officer in charge – Kah Leong 63896193.

Regards,

Claims Department

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road #15-00 Springleaf Tower Singapore 079909
T: (65) 63896116 | F: (65) 62247175

W: www.sg.cntaiping.com | **FB:** www.facebook.com/chinataipingsg/ | **WeChat:** 太平獅城 Taiping SG

Disclaimer: This e-mail and any files transmitted with it is intended only for the named recipients and may contain confidential information. Any unauthorized disclosure, use or dissemination of this message, either in whole or partial, is prohibited. If you are not the intended recipient, please notify the sender immediately. Please delete the e-mail and any copies of it thereafter.

From: TEAMWORK [<mailto:claims@teamworkgarage.com>]
Sent: Wednesday, 21 August, 2019 9:26 AM
To: Claims Dept of CTI <claimsdept@sg.cntaiping.com>
Cc: TEAMWORK <claims@teamworkgarage.com>
Subject: OUR REF : 1908-38 // YOUR REF : GQ3808U ACCIDENT INVOLVING GQ3808U AND SLQ4312S

WITHOUT PREJUDICE

OUR REF : 1908-38
YOUR REF : GQ3808U

Dear Sir / Madam,
PRE-REPAIR INSPECTION FOR SLQ4312S
ACCIDENT INVOLVING GQ3808U AND SLQ4312S ON 17.08.2019.

We refer to the above matter and enclosed herewith our client's GIA report and notification of Pre-repair inspection for your attention.

We also enclosed herewith the State Court of the Republic of Singapore Practice Direction-Amendment No. 1 of 2016 of 2016 of Pre-repair Inspection for your attention.

Thank you and have a nice day.

Regards,

Shu Shan

Teamwork Garage Pte Ltd
Blk 53 Ubi Avenue 1
#01-24
Paya Ubi Industrial Park

Singapore 408934
Tel: 6844 2475
Fax:6844 2474

This email has been scanned by the Symantec Email Security.cloud service.
For more information please visit <http://www.symanteccloud.com>

This email has been scanned by the Symantec Email Security.cloud service.
For more information please visit <http://www.symanteccloud.com>

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	529A
Vehicle Details	
Vehicle No.:	SLQ43125
Vehicle to be Exported:	No
Intended Deregistration Date:	27 Aug 2019
Vehicle Make:	TOYOTA
Vehicle Model:	LEXUS IS200T EXECUTIVE <i>Turbo</i>
Primary Colour:	Silver
Manufacturing Year:	2016
Engine No.:	8ARZ042696
Chassis No.:	JTHBA1D2505028689
Maximum Power Output:	180.0 kW (241 bhp)
Open Market Value:	\$37,505.00
Original Registration Date:	06 Jun 2016
First Registration Date:	06 Jun 2016
Transfer Count:	1
Actual ARF Paid:	\$44,507.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	05 Jun 2026
PARF Rebate Amount:	\$33,380.00
Intended COE Rebate Details	
COE Expiry Date:	05 Jun 2026
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$51,010.00
COE Rebate Amount:	\$34,557.00
Total Rebate Amount:	\$67,937.00

The information contained herein is correct as at 27 Aug 2019

OK Balance: 6 year 10 month

Depreciation: $11,000 \div 12 = 916$

month = 916

$66,000 + 9160 + 22,253$

$= 97,413 \#$

MV = 97400

PV = 67937

NV = ~~29463~~ 00
29400

MV = 96-97

> Back to OneMotoring

Enquire Transfer Fee

Vehicle Details	
Vehicle No. :	SLQ43125
Vehicle Type :	P10 - Passenger Motor Car
Vehicle Attachment 1 :	No Attachment
Vehicle Scheme :	Normal
Vehicle Make :	TOYOTA
Vehicle Model :	LEXUS IS200T EXECUTIVE
Chassis No. :	JTHBA1D2505028689
Propellant :	Petrol
Engine No. :	8ARZ042696
Engine Capacity :	1998 cc
Maximum Power Output :	180.0 kW (241 bhp)
Maximum Laden Weight :	2125 kg
Unladen Weight :	1620 kg
Year Of Manufacture :	2016
Original Registration Date :	06 Jun 2016
Lifespan Expiry Date :	-
COE Category :	B - Car above 1600cc or 97kW (130bhp)
Quota Premium :	\$51,010.00
COE Expiry Date :	05 Jun 2026
Road Tax Expiry Date :	05 Dec 2019
PARF Eligibility Expiry Date :	05 Jun 2026
Inspection Due Date :	05 Jun 2021
Intended Transfer Date :	27 Aug 2019
CO2 Emission :	175.00 (g/km)
CEV/VES Rebate Utilised Amount :	-
CO Emission :	-
HC Emission :	-
NOx Emission :	-
PM Emission :	-

Late renewal fee(s) will be imposed if road tax / lay-up has expired. Please use Enquire Road Tax Payable for fee(s) payable.
Road tax, including Over Payment (if any), of a vehicle will follow the vehicle to the new registered owner when its ownership is being transferred.

Amount Payable

	Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
Transfer Fee :	25.00	-	25.00
Total Amount Payable :			25.00

You may print this page for reference.

OK Print

**Budget
Direct
insurance**

Car insurance due?

Pay Less or Get \$100*, even if you don't buy.

Get a Quote >

*Terms and conditions apply.

Lexus

Price Range

Depreciation

Year Reg

Vehicle Type



Advanced Search

Home > Used Cars > Speedo Motoring > Lexus IS Turbo IS200t Executive

Lexus IS Turbo IS200t Executive

Overview

Financial

Insurance

Accessories

Similar

Research

Photos

Map

PREMIER AD



Speedo Motoring Pte Ltd

スピードモーターリング 株式会社 (a member of Singapore Motor Vehicle Dealers Association)



Price \$115,800

Depreciation \$12,770 /yr
View models with similar depre

Reg Date 22-Dec-2016
(7yrs 3mths 24days COE left)

Mileage 73,500 km (27.4k /yr)

Manufactured 2016

Road Tax \$1,210 /yr

Transmission Auto

Dereg Value \$73,590 as of today (change)

OMV \$37,509

COE \$54,901

ARF \$44,513

Engine Cap 1,998 cc

Power 180.0 kW (241 bhp)

Curb Weight 1,620 kg

No. of Owners 1

Type of Vehicle Luxury Sedan

Features

2.0L Inline 4 Cylinder DOHC Engine With Twin Scroll Turbo, 8 Speed, Paddle Shifter, Drive Mode Select, Keyless Entry/Start, Multi Function Steering. View specs of the Lexus IS 300 (2016-2018)

Accessories

Dual Electric Seats With Air Ventilation, Lexus Premium Audio System, Reverse Camera/Sensor, Xenon Headlamp With DRL, Auto Folding Side Mirror.

Description

Agent Unit, In House Financing Available, Flexible Loan Scheme, One Of The Top Luxury Sedan, Lexus Premium White Exterior, Maximum Comfort Driving With Powerful Yet Quiet Engine, Just Serviced On 08/07/19, Call Now For Viewing Appointment Without Any Obligation.

Category

PARF Car, Premium Ad Car

Status

Available

Resources



Vehicle Evaluation

Afraid of lemons? Request to have this car evaluated professionally. Find out more



Car Valuation - Free

Find out the market value of your existing car for free. Get started

Posted by


listed on: 24-Aug-2019

Compare



Price Chart

Summary

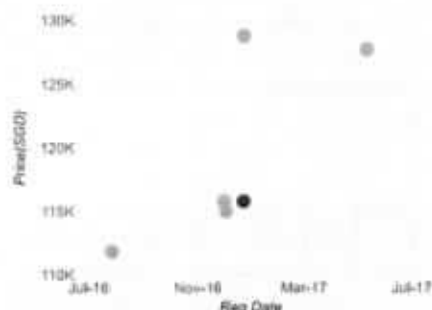

Click on the point to view the vehicle

Shortlist

Compare

Add note

Report Error

More Actions

Seller Information

Company

Speedo Motoring


* dealer's pricelist

* 25 vehs sold | 22 vehs available

PREMIER DEALER 2019

Address

33 Ubi Avenue 3 #01-75/76/77

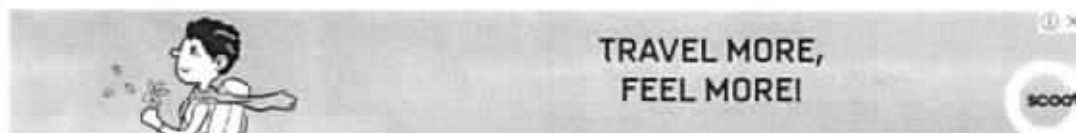

Lexus IS200

Price Range

Depreciation

2017

Vehicle Type

Advanced Search

Home » Used Cars » GOWheeler Pte Ltd » Lexus IS Turbo IS200t Executive

Lexus IS Turbo IS200t Executive

Overview

Financial

Insurance

Accessories

Similar

Research

Photos

Map

PREMIUM AD



Our Accreditations

Price **\$127,800**Depreciation **\$13,620 /yr**
View models with similar depreReg Date **10-May-2017**
(7yrs 8mths 12days COE left)Mileage **54,900 km (23.9k /yr)**Manufactured **2017**Road Tax **\$1,210 /yr**Transmission **Auto**Dereg Value **\$76,382 as of today (change)**OMV **\$38,430**COE **\$54,556**ARF **\$45,802**Engine Cap **1,998 cc**Power **180.0 kW (241 bhp)**Curb Weight **1,620 kg**No. of Owners **1**Type of Vehicle **Luxury Sedan**

Features

241Bhp Twin-Scroll Turbocharged Engine, 350Nm Torque, 8 Speed Gearbox, 0-100km/h In 7.0s, Gear Shift Paddles, Navigation, Bluetooth, Cruise Control. View specs of the Lexus IS 300 (2015-2018)

Accessories

19" Rims, Keyless Entry/Start, LED DRL, Front Ventilated Electric Seats, Dual Climatic Aircon With Rear Aircon, Auto Rain Sensors, Drive Mode Select.

Description

Low-Interest Rate, Maintained And Warranty By Borneo Motors, Balloon Scheme, In House Financing Available. Buy With A Peace Of Mind, 1 Owner, 100% Genuine Mileage, No Chassis/Structural Damage, Immaculate Condition, All Trade-In Welcome.

Category

PARF Car, Premium Ad Car, STA Evaluated Car

Status

Available

Resources



Vehicle Evaluation

Afraid of lemons? Request to have this car evaluated professionally. Find out more



Car Valuation - Free

Find out the market value of your existing car for free. Get started


STA Evaluation

This vehicle has undergone a 120-point check by STA, and has received a Graded A for its overall condition.

View more STA vehicles | Learn More on STA



Price Chart

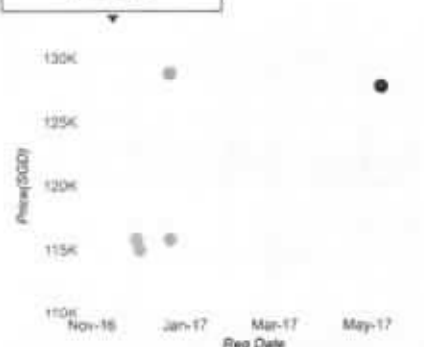

Click on the point to view the vehicle

Shortlist

Compare

Add note

Report Error

More Actions

Posted

dated on: 27-Aug-2019

Compare

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	17/08/2019 17:00
Date Of Accident	(17/08/2019 13:20)
Exact Location Of Accident	PAYA LEBAR RD TWDS GEYLANG RD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLQ4312S
Insured/Policyholder	
Name Of Registered Owner	KOH CHIN SUN
NRIC No	S1429529A
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-97680300
Alternative Phone No	OFFICE-97680300

Vehicle Particulars

Manufacturer	TOYOTA
Model	LEXUS IS200T EXECUTIVE
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	5105956488
Cover Note Number	

Driver

Name of Driver	LIM BENG HUAT
NRIC No	S1588857A
Date Of Birth	15/05/1963
Occupation	OUTDOOR
Date Of Driving Pass	22/07/1983
Driving Experience	36 YEARS AND 0 MONTHS
Gender	MALE
Mobile Number	+65-84048628
Fax Number	
Contact Number	OFFICE-84048628
EMail Address	NOEMAIL

Address	BLK 496F TAMPINES AVENUE 9 #12-504
Postcode	522496
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	RELATIVE
Vehicle Registration Number of Driver's Own Vehicle	- - -
Insurance Company of Driver's Own Vehicle	- - -

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	WET

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles (including own vehicle) involved in the accident	3
Was any body injured in the Accident?	YES
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO STATEMENT.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	YES
Remarks/ Reasons:	VIDEO FOOTAGE WITH DRIVER
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GQ3808U
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SLP6426P
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

DETAILS OF INJURED PERSON 1

Name	LIM BENG HUAT
Approximate Age	
Injuries Sustain	NECK & BACK
Injured person in which vehicle?	SLQ4312S
Were seat belts worn?	YES
Was this injured conveyed to hospital by ambulance?	NO
Address	
Postcode	

Accident Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

- 1) Please report correctly on the details of the accident to speed up the claims process.
- 2) This form must be completed by the policy holder and/or the authorised driver.
- 3) Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- 4) The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5) Any false reporting may be referred to the police for investigation.
- 6) The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7) By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8) **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in the [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such personal information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"), the insurers' lawyers/law firm, the Monetary Authority of Singapore and any relevant government agency/authority (such as police), for the purpose(s) of:
 - (i) Processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) Investigations the accident and/or my claims;
 - (iii) Carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) Administering my claims (including the mailing of correspondence, statement, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) Complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "purposes")
- (b) All insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyer/law firms, may/are permitted to collect, use, disclose and/or process my personal information for one or more of the above purposes; and
- (c) My personal information may/can be disclosed by any of the insurer and/or GIA to their third party service providers or agents (including their lawyer/law firms), which may be sited outside of Singapore, for one or more of the above purposes.
- (d) My personal information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) The information so collected under (d) above may be shared / disclosed:
 - (i) To all insurers and/or any other third parties that assist in evaluating, investigation, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) For complying with requirements under my regulations, laws or court orders.


Policy holder's signature
Date / time:

Driver's signature
(if driver is not policy holder)
Date / time:

reporting centre personnel's Signature
Date / time:

Accident Sketch Plan

SKETCH PLAN

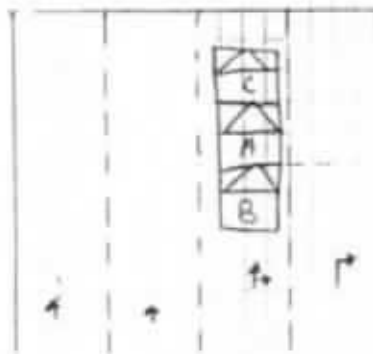

A: SLQ43125
B: GQ3808U
C: SLP6426P

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I WAS SATIONARY ALONG PAYA LEBAR ROAD TOWARDS GEYLANG AS THE TRAFFIC LIGHT WAS RED . OUT OF THE SUDDEN I FELT AN HUGE IMPACT FROM THE REAR PORTION OF MY VEHICLE WHICH CAUSE ME TO THRUST FORWARD AND COLLIDE ONTO VEHICLE C . I HAVE VIDEO FOOTAGE TO PROVE MY STATEMENT . TOTAL 3 CARS ARE INVOLVED .

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policy holder's signature
Date & time:

Driver's signature
(if driver is not policy holder)
Date & time:

reporting centre personnel's Signature
NRIC/FIN No.:

Page 6

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	21 Aug 2019		21 Aug 2019 12:07 Edit Adj Rpt	\$11,750.00 Edit Estimates	\$11,750.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS		(Created by insurer)
Insured:	Co. Reg. No.: -	
Main Claimant:	KOH CHIN SUN, ID: S1429529A	
Vehicle Reg. No.:	SLQ4312S	Date of Loss: 17/08/2019 13:00 - :59 [38 Months and 11 Days From LTA Reg Date (Man Yr)]
Claim Type:	TP / SNM19D203871C02	Policy/Cover Note No.: DMCVSN30437719000
Vehicle Reg. No. (Insured):	GQ3808U	Policy No. (Claimant): S105956488
		Excess: S\$1,000.00
Repairer:	Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park, 408934 Ubi - Tel: 6844 2475	
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Tan Kah Leong - 63896193]	
Claimant's Insurer:	NTUC Income Insurance Co-operative Ltd (HQ) - Tel:	
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by LEE HOCK ANN] ... [Final Rpt due 30/08/2019]	

ASSOCIATED MAIL RECEIVED	View All	Compose Case Mail
There are no mail for this case.		

ALL ASSOCIATED TASKS										View All	Search Tasks	Create New Task	Complete
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?				
No results.													

Claim Documents

*SLQ4312S (SNM19D203871C02)
[GQ3808U]
TP
KOH CHIN SUN
Aug 17 2019 1:00PM
[-]
Teamwork Garage Pte Ltd

Upload Documents			Upload Photos			Compose New Letter			View			View in Browser		
Photos/Images									3 per page			☒		
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)								Thumbnail	Print			
1	28/08/19 13:21	Odometer Reading								Load JPG	☒			
2	28/08/19 13:22	Chassis Number								Load JPG	☒			
3	28/08/19 13:23	General View								Load JPG	☒			
4	28/08/19 13:23	General View								Load JPG	☒			
5	28/08/19 13:23	General View								Load JPG	☒			
6	28/08/19 13:23	General View								Load JPG	☒			
7	28/08/19 13:23	General View								Load JPG	☒			
8	28/08/19 13:23	General View								Load JPG	☒			
9	28/08/19 13:23	General View								Load JPG	☒			
10	28/08/19 13:24	General View								Load JPG	☒			
11	28/08/19 13:24	General View								Load JPG	☒			
12	28/08/19 13:24	General View								Load JPG	☒			
13	28/08/19 13:24	General View								Load JPG	☒			
14	28/08/19 13:24	General View								Load JPG	☒			
15	28/08/19 13:24	General View								Load JPG	☒			
16	28/08/19 13:24	General View								Load JPG	☒			
17	28/08/19 13:24	General View								Load JPG	☒			
18	28/08/19 13:24	General View								Load JPG	☒			
19	28/08/19 13:24	General View								Load JPG	☒			
20	28/08/19 13:24	General View								Load JPG	☒			
21	28/08/19 13:24	General View								Load JPG	☒			
22	28/08/19 13:24	General View								Load JPG	☒			
23	28/08/19 13:24	General View								Load JPG	☒			
24	28/08/19 13:24	General View								Load JPG	☒			
25	28/08/19 13:24	General View								Load JPG	☒			
26	28/08/19 13:25	General View								Load JPG	☒			
27	28/08/19 13:25	General View								Load JPG	☒			
28	28/08/19 13:25	General View								Load JPG	☒			
29	28/08/19 13:25	General View								Load JPG	☒			
30	28/08/19 13:25	General View								Load JPG	☒			
31	28/08/19 13:25	General View								Load JPG	☒			
32	28/08/19 13:25	General View								Load JPG	☒			
33	28/08/19 13:25	General View								Load JPG	☒			
34	28/08/19 13:26	General View								Load JPG	☒			
35	28/08/19 13:26	General View								Load JPG	☒			
36	28/08/19 13:26	General View								Load JPG	☒			
37	28/08/19 13:26	General View								Load JPG	☒			
38	28/08/19 13:26	General View								Load JPG	☒			
39	28/08/19 13:26	General View								Load JPG	☒			
40	28/08/19 13:26	General View								Load JPG	☒			
41	28/08/19 13:26	General View								Load JPG	☒			
42	28/08/19 13:26	General View								Load JPG	☒			
43	28/08/19 13:26	General View								Load JPG	☒			

Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
44	28/08/19 13:26	General View	 Load JPG	☒
45	28/08/19 13:26	General View	 Load JPG	☒
46	28/08/19 13:26	General View	 Load JPG	☒
47	28/08/19 13:26	General View	 Load JPG	☒
48	28/08/19 13:26	General View	 Load JPG	☒
49	28/08/19 13:26	General View	 Load JPG	☒
50	28/08/19 13:26	General View	 Load JPG	☒
51	28/08/19 13:26	General View	 Load JPG	☒
52	28/08/19 13:26	General View	 Load JPG	☒
53	28/08/19 13:26	General View	 Load JPG	☒
54	28/08/19 13:26	General View	 Load JPG	☒
55	28/08/19 13:26	General View	 Load JPG	☒
56	28/08/19 13:26	General View	 Load JPG	☒
57	28/08/19 13:26	General View	 Load JPG	☒
58	28/08/19 13:26	General View	 Load JPG	☒
59	28/08/19 13:26	General View	 Load JPG	☒
60	28/08/19 13:26	General View	 Load JPG	☒
61	28/08/19 13:26	General View	 Load JPG	☒
62	28/08/19 13:26	General View	 Load JPG	☒
63	28/08/19 13:26	General View	 Load JPG	☒
64	28/08/19 13:26	General View	 Load JPG	☒
65	28/08/19 13:26	General View	 Load JPG	☒
66	28/08/19 13:27	General View	 Load JPG	☒
67	28/08/19 13:27	General View	 Load JPG	☒
68	28/08/19 13:27	General View	 Load JPG	☒
69	28/08/19 13:27	General View	 Load JPG	☒
70	28/08/19 13:27	General View	 Load JPG	☒
71	28/08/19 13:27	General View	 Load JPG	☒
72	28/08/19 13:27	General View	 Load JPG	☒
73	28/08/19 13:27	General View	 Load JPG	☒
74	28/08/19 13:27	General View	 Load JPG	☒
75	28/08/19 13:27	General View	 Load JPG	☒
76	28/08/19 13:27	General View	 Load JPG	☒
77	28/08/19 13:27	General View	 Load JPG	☒
78	28/08/19 13:27	General View	 Load JPG	☒
79	28/08/19 13:27	General View	 Load JPG	☒
80	28/08/19 13:27	General View	 Load JPG	☒
81	28/08/19 13:27	General View	 Load JPG	☒
82	28/08/19 13:27	General View	 Load JPG	☒
83	28/08/19 13:27	General View	 Load JPG	☒
84	28/08/19 13:27	General View	 Load JPG	☒
85	28/08/19 13:27	General View	 Load JPG	☒
86	28/08/19 13:27	General View	 Load JPG	☒
87	28/08/19 13:27	General View	 Load JPG	☒
88	28/08/19 13:27	General View	 Load JPG	☒
89	28/08/19 13:27	General View	 Load JPG	☒
90	28/08/19 13:28	General View	 Load JPG	☒
91	28/08/19 13:28	General View	 Load JPG	☒
92	28/08/19 13:28	General View	 Load JPG	☒
93	28/08/19 13:28	General View	 Load JPG	☒
94	28/08/19 13:28	General View	 Load JPG	☒
95	28/08/19 13:28	General View	 Load JPG	☒
96	28/08/19 13:28	General View	 Load JPG	☒
97	28/08/19 13:28	General View	 Load JPG	☒
98	28/08/19 13:28	General View	 Load JPG	☒
99	28/08/19 13:28	General View	 Load JPG	☒

Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
100	28/08/19 13:28	General View		☒
101	28/08/19 13:28	General View		☒
102	28/08/19 13:28	General View		☒
103	28/08/19 13:28	General View		☒
104	28/08/19 13:28	General View		☒
105	28/08/19 13:28	General View		☒
106	28/08/19 13:29	General View		☒
107	28/08/19 13:29	General View		☒
108	28/08/19 13:29	General View		☒
109	28/08/19 13:29	General View		☒
110	28/08/19 13:29	General View		☒
111	28/08/19 13:29	General View		☒
112	28/08/19 13:29	General View		☒
113	28/08/19 13:29	General View		☒
114	28/08/19 13:29	General View		☒
115	28/08/19 13:29	General View		☒
116	28/08/19 13:29	General View		☒
117	28/08/19 13:29	General View		☒
118	28/08/19 13:29	General View		☒
119	28/08/19 13:29	General View		☒
120	28/08/19 13:29	General View		☒
121	28/08/19 13:29	General View		☒
122	28/08/19 13:29	General View		☒
123	28/08/19 13:29	General View		☒
124	28/08/19 13:29	General View		☒
125	28/08/19 13:29	General View		☒
126	28/08/19 13:29	General View		☒
127	28/08/19 13:29	General View		☒
128	28/08/19 13:29	General View		☒
129	28/08/19 13:29	General View		☒
130	28/08/19 13:30	General View		☒
131	28/08/19 13:30	General View		☒
132	28/08/19 13:30	General View		☒
133	28/08/19 13:30	General View		☒
134	28/08/19 13:30	General View		☒
135	28/08/19 13:30	General View		☒
136	28/08/19 13:30	General View		☒
137	28/08/19 13:30	General View		☒
138	28/08/19 13:31	General View		☒
139	28/08/19 13:31	General View		☒
140	28/08/19 13:31	General View		☒
141	28/08/19 13:31	General View		☒
142	28/08/19 13:31	General View		☒
143	28/08/19 13:31	General View		☒
144	28/08/19 13:31	General View		☒
145	28/08/19 13:31	General View		☒
146	28/08/19 13:31	General View		☒
147	28/08/19 13:31	General View		☒
148	28/08/19 13:31	General View		☒
149	28/08/19 13:31	General View		☒
150	28/08/19 13:31	General View		☒
151	28/08/19 13:31	General View		☒
152	28/08/19 13:31	General View		☒
153	28/08/19 13:31	General View		☒
154	28/08/19 13:33	Reinspection Photo		☒
155	28/08/19 13:33	Reinspection Photo		☒

Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
156	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
157	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
158	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
159	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
160	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
161	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
162	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
163	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
164	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
165	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
166	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
167	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
168	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
169	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
170	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
171	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
172	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
173	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
174	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
175	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
176	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
177	28/08/19 13:33	Reinspection Photo	 Load JPG	☒
178	28/08/19 13:34	Reinspection Photo	 Load JPG	☒
179	28/08/19 13:34	Reinspection Photo	 Load JPG	☒
180	28/08/19 13:34	Reinspection Photo	 Load JPG	☒
181	28/08/19 13:34	Reinspection Photo	 Load JPG	☒
182	28/08/19 13:34	Reinspection Photo	 Load JPG	☒
183	28/08/19 13:34	Reinspection Photo	 Load JPG	☒
184	28/08/19 13:34	Reinspection Photo	 Load JPG	☒
185	28/08/19 13:34	Reinspection Photo	 Load JPG	☒
186	28/08/19 13:36	Reinspection Photo	 Load JPG	☒
187	28/08/19 13:36	Reinspection Photo	 Load JPG	☒
188	28/08/19 13:36	Reinspection Photo	 Load JPG	☒
189	28/08/19 13:36	Reinspection Photo	 Load JPG	☒
190	28/08/19 13:36	Reinspection Photo	 Load JPG	☒
191	28/08/19 13:36	Reinspection Photo	 Load JPG	☒
192	28/08/19 13:36	Reinspection Photo	 Load JPG	☒
193	28/08/19 13:36	Reinspection Photo	 Load JPG	☒
194	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
195	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
196	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
197	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
198	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
199	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
200	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
201	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
202	28/08/19 13:37	Reinspection Photo	Load JPG	☒
203	28/08/19 13:37	Reinspection Photo	Load JPG	☒
204	28/08/19 13:37	Reinspection Photo	Load JPG	☒
205	28/08/19 13:37	Reinspection Photo	Load JPG	☒
206	28/08/19 13:37	Reinspection Photo	Load JPG	☒
207	28/08/19 13:37	Reinspection Photo	Load JPG	☒
208	28/08/19 13:37	Reinspection Photo	Load JPG	☒
209	28/08/19 13:37	Reinspection Photo	Load JPG	☒
210	28/08/19 13:37	Reinspection Photo	Load JPG	☒
211	28/08/19 13:37	Reinspection Photo	Load JPG	☒

Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
212	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
213	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
214	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
215	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
216	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
217	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
218	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
219	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
220	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
221	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
222	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
223	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
224	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
225	28/08/19 13:37	Reinspection Photo	 Load JPG	☒
226	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
227	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
228	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
229	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
230	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
231	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
232	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
233	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
234	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
235	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
236	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
237	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
238	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
239	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
240	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
241	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
242	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
243	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
244	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
245	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
246	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
247	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
248	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
249	28/08/19 13:38	Reinspection Photo	 Load JPG	☒
250	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
251	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
252	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
253	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
254	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
255	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
256	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
257	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
258	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
259	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
260	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
261	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
262	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
263	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
264	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
265	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
266	28/08/19 13:39	Reinspection Photo	Load JPG	☒
267	28/08/19 13:39	Reinspection Photo	Load JPG	☒

Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
268	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
269	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
270	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
271	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
272	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
273	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
274	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
275	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
276	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
277	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
278	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
279	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
280	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
281	28/08/19 13:39	Reinspection Photo	 Load JPG	☒
282	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
283	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
284	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
285	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
286	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
287	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
288	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
289	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
290	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
291	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
292	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
293	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
294	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
295	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
296	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
297	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
298	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
299	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
300	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
301	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
302	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
303	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
304	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
305	28/08/19 13:40	Reinspection Photo	 Load JPG	☒
306	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
307	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
308	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
309	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
310	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
311	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
312	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
313	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
314	28/08/19 13:41	Reinspection Photo	Load JPG	☒
315	28/08/19 13:41	Reinspection Photo	Load JPG	☒
316	28/08/19 13:41	Reinspection Photo	Load JPG	☒
317	28/08/19 13:41	Reinspection Photo	Load JPG	☒
318	28/08/19 13:41	Reinspection Photo	Load JPG	☒
319	28/08/19 13:41	Reinspection Photo	Load JPG	☒
320	28/08/19 13:41	Reinspection Photo	Load JPG	☒
321	28/08/19 13:41	Reinspection Photo	Load JPG	☒
322	28/08/19 13:41	Reinspection Photo	Load JPG	☒
323	28/08/19 13:41	Reinspection Photo	Load JPG	☒

Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
324	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
325	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
326	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
327	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
328	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
329	28/08/19 13:41	Reinspection Photo	 Load JPG	☒
330	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
331	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
332	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
333	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
334	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
335	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
336	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
337	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
338	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
339	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
340	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
341	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
342	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
343	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
344	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
345	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
346	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
347	28/08/19 13:42	Reinspection Photo	 Load JPG	☒
348	13/09/19 17:54	After Repair Photo	 Load JPG	☒
349	13/09/19 17:54	After Repair Photo	 Load JPG	☒
350	13/09/19 17:54	After Repair Photo	 Load JPG	☒
351	13/09/19 17:54	After Repair Photo	 Load JPG	☒
352	13/09/19 17:54	After Repair Photo	 Load JPG	☒
353	13/09/19 17:54	After Repair Photo	 Load JPG	☒
354	13/09/19 17:54	After Repair Photo	 Load JPG	☒
355	13/09/19 17:54	After Repair Photo	 Load JPG	☒
356	13/09/19 17:54	After Repair Photo	 Load JPG	☒
357	13/09/19 17:54	After Repair Photo	 Load JPG	☒
358	13/09/19 17:55	After Repair Photo	 Load JPG	☒
359	13/09/19 17:55	After Repair Photo	 Load JPG	☒
360	13/09/19 17:55	After Repair Photo	 Load JPG	☒
361	13/09/19 17:55	After Repair Photo	 Load JPG	☒
362	13/09/19 17:55	After Repair Photo	 Load JPG	☒
363	13/09/19 17:55	After Repair Photo	 Load JPG	☒
364	13/09/19 17:55	After Repair Photo	 Load JPG	☒
365	13/09/19 17:55	After Repair Photo	 Load JPG	☒
366	13/09/19 17:55	After Repair Photo	 Load JPG	☒
367	13/09/19 17:55	After Repair Photo	 Load JPG	☒
368	13/09/19 17:55	After Repair Photo	 Load JPG	☒
369	13/09/19 17:55	After Repair Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	03/10/19 09:13	Supplementary	 Load PDF	

Linked Accident Report Documents

Assessment Reports			View	View in Browser
No	Finalized On	National Assessment Centre Services (Ubi)	Thumbnail	Print

Assessment Reports				1 per page	☒
No	Finalized On	National Assessment Centre Services (Ubl)		Thumbnail	Print
1	17/08/19 17:29	Accident Statement		Load HTM	
2	20/08/19 19:45	Addendum Sheet		Load JPG	☒
3	20/08/19 19:45	Accident Statement Addm. #1		Load HTM	
Photos/Images				3 per page	☒
No	Finalized On	National Assessment Centre Services (Ubl)		Thumbnail	Print
1	17/08/19 17:26	Accident Photo		Load JPG	☒
2	17/08/19 17:26	Accident Photo		Load JPG	☒
3	17/08/19 17:26	Accident Photo		Load JPG	☒
4	17/08/19 17:26	Accident Photo		Load JPG	☒
5	17/08/19 17:26	Accident Photo		Load JPG	☒
6	17/08/19 17:26	Accident Photo		Load JPG	☒
7	17/08/19 17:26	Accident Photo		Load JPG	☒
8	17/08/19 17:26	Accident Photo		Load JPG	☒
9	17/08/19 17:26	Accident Photo		Load JPG	☒
10	17/08/19 17:26	Accident Photo		Load JPG	☒
11	17/08/19 17:26	Accident Photo		Load JPG	☒
12	17/08/19 17:26	Accident Photo		Load JPG	☒
13	17/08/19 17:26	Accident Photo		Load JPG	☒
14	17/08/19 17:26	Accident Photo		Load JPG	☒
15	17/08/19 17:26	Accident Photo		Load JPG	☒
16	17/08/19 17:26	Accident Photo		Load JPG	☒
Documentation				1 per page	☒
No	Finalized On	National Assessment Centre Services (Ubl)		Thumbnail	Print
1	17/08/19 17:27	Accident Sketch Plan		Load JPG	☒
2	17/08/19 17:27	Accident Sketch Plan		Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) 			
Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.			

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CT119014669/HQF3E2

Date: 03/10/2019

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSN30437719000
Claimant Vehicle No :	SLQ4312S	Insured Vehicle No :	GQ3808U
Date of Loss:	17/08/2019	Nature of Claim: TP	Claim No: SNM19D203871C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLQ4312S	Engine No:	8ARZ042696
Make & Model:	LEXUS IS, 200 (A)	Chassis No:	JTHBA1D2505028689
Reg. Date:	06/06/2016 (Man. Year: 2016)	Odometer:	63002 km
Colour:	Silver		
Engine Capacity:	1998 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/35Z R19	Rear Tyre Size:	255/30Z R19
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		25,924.59	11,343.77	14,580.82	56.24
Miscellaneous Items		0.00	0.00	0.00	
Labour		7,170.00	3,340.00	3,830.00	53.42
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
	Calculated Gross Total (S\$)	33,094.59	14,683.77	18,410.82	55.63
	Approved Total (Overridden) (S\$)		11,750.00		
	(S\$)	33,094.59	11,750.00	21,344.59	64.50
	+ GST 7.00/7.00% (S\$)	2,316.62	822.50	1,494.12	64.50
	Nett Amount (S\$)	35,411.21	12,572.50	22,838.71	64.50

INSPECTION

Date of Assignment:	21/08/2019	
Date Inspected:	26/08/2019 Inspected At:	Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park Singapore 408934
Estimated Period of Repair:	11.0 days	

Adjuster: LEE HOCK ANN

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 03 Oct 2019)
Parts:	143	LEXUS IS 200 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLQ4312S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Broken	1,092.96 FL	*927.50 FL
2	1		*FRONT BUMPER RETAINER	N/S Cracked / O/S Serviceable	278.54 FL	*94.70 FL
3	1		*FRONT BUMPER LOWER GRILLE	Cracked	323.96 FL	*223.50 FL
4	1		*TOW COVER	Crushed	61.64 FL	*61.64 FL
5	1		*FRONT GRILLE ASSY	Cracked	841.69 FL	*493.74 FL
6	1		*FRONT GRILLE EMBLEM	Necessary	70.15 FL	*70.15 FL
7	1		*FRONT FOG LAMP	N/S Cracked / O/S Serviceable	1,186.82 FL	*346.90 FL
8	1		*FRONT FOG LAMP COVER	N/S Crushed / O/S Serviceable	118.20 FL	*59.10 FL
9	1		*FRONT HEADLAMP	N/S Cracked / O/S Serviceable	5,239.64 FL	*1,614.15 FL
10	1		*BOOTLID	Bent	874.35 FL	*650.50 FL
11	1		*BOOTLID HINGE	N/S Dented / O/S Serviceable	730.94 FL	*220.30 FL
12	1		*BOOTLID LOCK	Jammed	555.80 FL	*385.40 FL
13	1		*BOOTLID LOCK STRIKER	Serviceable	177.68 FL	*- FL
14	1		*BOOTLID GARNISH	Dented	433.55 FL	*200.00 FL
15	1		*BOOTLID EMBLEM LOGO	Necessary	76.02 FL	*76.02 FL
16	1		*BOOTLID EMBLEM - LEXUS	Necessary	79.81 FL	*79.81 FL
17	1		*BOOTLID EMBLEM - IS2500	Necessary	83.03 FL	*83.03 FL
18	1		*BOOTLID LAMP LH	Cracked	783.27 FL	*450.50 FL
19	1		*REAR BUMPER RETAINER (2PCS)	Necessary	319.24 FL	*86.25 FL
20	1		*REAR BUMPER REINFORCEMENT	Damaged	531.19 FL	*410.60 FL
21	1		*REAR BUMPER LOWER LIP	Crushed	560.86 FL	*400.50 FL
22	2		*REAR BUMPER REFLECTOR	Serviceable	375.36 FL	*- FL
23	1		*END PANEL	Dented	970.72 FL	*811.90 FL
24	1		*END PANEL TOP GARNISH	Damaged	435.39 FL	*250.80 FL
25	1		*SPARE TYRE TOP BOARD	Serviceable	86.83 FL	*- FL
26	1		*REAR LH FENDER	Cut	1,401.51 FL	*1,044.45 FL
27	1		*REAR LH TAILLAMP PANEL	Bent	323.84 FL	*180.30 FL
28	1		*REAR LH TAILLAMP	Crushed	864.57 FL	*680.50 FL
29	1		*REAR LH FENDER INNER TRIM	Crushed	776.25 FL	*350.50 FL
30	1		*REAR LH WHEELHOUSE PANEL	Serviceable	756.59 FL	*- FL
31	1		*REAR LH AIR VENT	Crushed	153.99 FL	*105.20 FL
32	1		*REAR EXHAUST SILENCER	Serviceable	1,961.33 FL	*- FL
33	1		*REAR EXHAUST HEAT SHIELD	Serviceable	318.55 FL	*- FL
34	2		*EXHAUST MOUNTING	Serviceable	80.50 FL	*- FL
35	1		*REAR LH SHOCK ABSORBER	Serviceable	391.46 FL	*- FL
36	1		*REAR LH KNUCKLE ARM	Serviceable	1,001.42 FL	*- FL
37	1		*REAR LH KNUCKLE BEARING	Serviceable	702.77 FL	*- FL
38	1		*REAR LH LOWER ARM	Serviceable	521.99 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
39	1		*REAR WINDSCREEN MOULDING	Necessary	182.16 FL	*127.20 FL
40	1		*REAR BUMPER	Cracked	1,190.71 FL	*880.50 FL
41	1		*SET FRONT BUMPER CLIP	Necessary	50.00 FS	*20.00 FS
42	1		*SET FRONT GRILLE CLIP	Necessary	60.00 FS	*20.00 FS
43	1		*FRONT NUMBER PLATE	Cracked	80.00 FS	*40.00 FS
44	1		*SET REAR BUMPER CLIP	Necessary	50.00 FS	*20.00 FS
45	1		*SET END PANEL TOP GARNISH CLIP	Necessary	60.00 FS	*15.00 FS
46	1		*SET FENDER INNER TRIM CLIP	Necessary	60.00 FS	*15.00 FS
47	1		*SET REAR NUMBER PLATE	Serviceable	80.00 FS	*- FS
48	1		*SET WINDSCREEN SEALANT	Necessary	150.00 FS	*30.00 FS
49	1		*FRONT BUMPER SPONGE	Cracked	145.20 FL	*100.50 FL
50	2		*FRONT BUMPER REINFORCEMENT	Serviceable	388.40 FL	*- FL
51	1		*FRONT BUMPER REINFORCEMENT INNER GUIDE	Crushed	201.30 FL	*144.30 FL
52	1		*FRONT BUMPER LH SIGNAL LAMP	Damaged	688.30 FL	*480.00 FL
53	1		*FRONT BRAKE AIRDUCT LH	Damaged	311.80 FL	*170.80 FL
54	1		*FRONT SUPPORT PANEL LOWER SIDE GARNISH LH	Crushed	210.50 FL	*133.80 FL
55	1		*FRONT GRILLE LOWER GARNISH	Crushed	513.50 FL	*284.85 FL
56	1		*REAR RH TAILLAMP	Scratched	864.57 FL	*680.50 FL
57	1		*REAR RH BOOTLID LAMP	Scratched	783.27 FL	*450.50 FL
58	1		*BOOTLID INNER TRIM	Crushed	432.40 FL	*250.80 FL
59	1		*FRONT NUMBER PLATE BASE	Damaged	90.00 FL	*50.00 FL
60	1		*BOOTLID HINGE COVER LH	Serviceable	101.60 FL	*- FL
61	2		*FRONT GRILLE SENSOR CENTRE	Shorted	800.00 FS	*300.00 FS
62	2		*REAR REVERSE SENSOR LH	Broken / Crushed	800.00 FS	*300.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$) **33,836.12** **14,871.69**
 - List Item Discount on L Items 25.00/25.00% (S\$) 7,911.53 3,527.92

Total Parts (S\$) **25,924.59** **11,343.77**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	CHECK FRONT AND REAR WIRING AND LIGHTNING SYSTEM	New	120.00	40.00
2	REMOVE AND REFIT GARNISH, LINING AND TRIM FOR REPAIR	New	200.00	50.00
3	CHECK WHEEL ALIGNMENT	New	200.00	0.00
4	REMOVE AND REPLACE FRONT UNDERCARRIAGE PARTS	New	200.00	0.00
5	MOUNT VEHICLE ON BENCH FOR CHASSIS REPLACEMENT	New	300.00	0.00
6	REMOVE AND REFIT FUEL TANK	New	200.00	40.00
7	REMOVE AND RENEW FLOOR INSULATOR	New	150.00	0.00
8	REMOVE AND RENEW EXHAUST ASSY	New	150.00	40.00
9	REMOVE AND REFIT REAR WINDSCREEN	New	150.00	100.00
10	TRANSFER PARTS, ATTACHMENT FROM OLD BOOTLID TO NEW	New	150.00	30.00
11	PANEL BEATING ON AFFECTED PANEL	New	2,600.00	1,600.00
12	SPRAY PAINTING ON AFFECTED PANEL	New	2,600.00	1,400.00
13	APPLY ANTI RUST ON AFFECTED PANEL	New	150.00	40.00
Gross Labour Cost (S\$)			7,170.00	3,340.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >