

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG19016617/R1TD3E2

Date: 16/12/2020

REFERENCE

Insured/Claimant: GOH CHYE KIANG (WU CAIQIANG)

Policy No: 1700079762

Date of Loss: 16/09/2019

Nature of Claim: OD Claim No: 1874050091SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SFY651T

Make & Model: AUDI Q3, 2.0 TFSI QU (A)

Engine No: DAX019373

Reg. Date: 29/11/2017 (Man. Year: 2017)

Chassis No: WAUZZZF5J2051897

Colour: Blue

Odometer: 18637 km

Engine Capacity: 1984 cc

Market Value/New Car Price: S\$159,000.00

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 235/55 R19

Rear Tyre Size: 235/55 R19

Front Left Side: Michelin 6 mm

Rear Left Side: Michelin 6 mm

Front Right Side: Michelin 6 mm

Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	205,382.00	117,893.10	87,488.90	42.60
Miscellaneous Items	0.00	0.00	0.00	
Labour	53,824.00	36,269.00	17,555.00	32.62
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	259,206.00	154,162.10	105,043.90	40.53
Approved Total (Overridden) (S\$)		145,000.00		
- Excess (S\$)	1,200.00	1,200.00	0.00	0.00
(S\$)	258,006.00	143,800.00	114,206.00	44.26
+ GST 7.00/7.00% (S\$)	18,060.42	10,066.00	7,994.42	44.26
Nett Amount (S\$)	276,066.42	153,866.00	122,200.42	44.26

INSPECTION

Date of Assignment: 20/09/2019

Date Inspected: 19/09/2019 Inspected At:

24 BENOI SECTOR

Repairer : Premium Automobiles Pte Ltd

Estimated Period of Repair: 91.0 days

Adjuster: MOHD RASUL

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Torn	2,696.00 FS	*2,156.80 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	244.00 FS	*- FS
3	1		*ULTRASOUND SENSOR SUPPORT-LH/RH	N/s Crushed	166.00 FS	*65.84 FS
4	2		*FRONT BUMPER SECURING STRIP-LH/RH	Broken	68.00 FS	*52.96 FS
5	2		*FRONT BUMPER CLOSING ELEMENT-LH/RH	Cracked	202.00 FS	*164.40 FS
6	1		*FRONT BUMPER GRILLE-CENTRE	Deformed	155.00 FS	*124.00 FS
7	1		*FRONT BUMPER SPOILER	Deformed	725.00 FS	*579.00 FS
8	1		*RADIATOR GRILLE	Cracked	3,258.00 FS	*2,606.40 FS
9	1		*RADIATOR GRILLE STRIKER PLATE	Cracked	222.00 FS	*177.20 FS
10	1		*FRONT BUMPER AIR GUIDE GRILLE-LH	Broken	635.00 FS	*507.60 FS
11	1		*FRONT BUMPER END CAP-LH	Serviceable	83.00 FS	*- FS
12	1		*FRONT BUMPER AIR GUIDE GRILLE-RH	Scratched	635.00 FS	*507.60 FS
13	1		*FRONT BUMPER END CAP-RH	Serviceable	83.00 FS	*- FS
14	4		*LOCKING CLIP	Necessary	15.00 FS	*11.52 FS
15	1		*FRONT BUMPER CLOWING ELEMENT	Cracked	246.00 FS	*196.80 FS
16	1		*FRONT BUMPER FOAM FILLER PIECE	Cracked	259.00 FS	*207.20 FS
17	1		*FRONT BUMPER CARRIER	Bent	831.00 FS	*664.40 FS
18	2		*FRONT BUMPER BRACKET-LH/RH	O/S Bent N/S Broken	462.00 FS	*368.80 FS
19	1		*FRONT BUMPER COVER	Deformed	116.00 FS	*92.40 FS
20	1		*CAUTIN SIGN	Necessary	13.00 FS	*9.76 FS
21	1		*AIRCON STICKER	Necessary	18.00 FS	*14.00 FS
22	2		*FRONT BUMPER GUIDE SECTION-LH/RH	Cracked	68.00 FS	*54.24 FS
23	2		*FRONT WHEEL COVER-LH/RH	Necessary	1,212.00 FS	*968.80 FS
24	1		*FENDER-LH/RH	N/s Bent O/s Repair	2,602.00 FS	*1,040.80 FS
25	2		*FENDER BRACKET-LH/RH	Not Necessary	32.00 FS	*- FS
26	2		*FENDER BRACE-LH/RH	Not Necessary	412.00 FS	*- FS
27	2		*FENDER COVER PANEL-LH/RH	Necessary	72.00 FS	*56.80 FS
28	2		*FENDER CLOSURE PANEL-LH/RH	Necessary	56.00 FS	*44.48 FS
29	2		*FENDER INNER SHIELD-LH/RH OUTER	Cut	142.00 FS	*112.96 FS
30	2		*FENDER ATTACHMENT PARTS - FRONT	Cut	119.00 FS	*47.52 FS
31	2		*S-LINE INSCRIPTION	Necessary	225.00 FS	*180.00 FS
32	2		*FRONT WHEEL HOUSING LINER - LH / RH	N/S Deformed / O/S Cut	492.00 FS	*392.80 FS
33	2		*FRONT WHEEL SPOILER - LH / RH	N/S Cracked O/S Deformed	292.00 FS	*233.60 FS
34	1		*WHEEL HOUSING LINER ATTACHMENT PARTS - FRONT	N/S Serviceable O/SNecessary	69.00 FS	*27.28 FS
35	1		*BONNET	Buckled	3,707.00 FS	*2,965.60 FS
36	2		*BONNET LID HINGE - LH / RH	Bent	292.00 FS	*233.60 FS
37	1		*BONNET ATTACHMENT PARTS	Serviceable	127.00 FS	*- FS
38	2		*BONNET GAS FILLED STRUT	Serviceable	217.00 FS	*- FS
39	2		*BONNET STRIKER - LH / RH	Bent	218.00 FS	*174.40 FS
40	1		*BONNET SOUND ABSORBER	Deformed	289.00 FS	*231.20 FS
41	1		*BONNET IMPACT PROTECTION - LH / RH / CENTRE (3PCS)	Necessary	75.00 FS	*59.44 FS
42	1		*PLENUM CHAMBER COVER	Serviceable	131.00 FS	*- FS
43	2		*BONNET LID LOCK - FRONT	Bent	391.00 FS	*312.80 FS
44	1		*BONNET RELEASE ELEMENT	Necessary	53.00 FS	*41.68 FS
45	1		*BONNET BOWDEN CABLE - CENTRE	Cracked	53.00 FS	*41.68 FS
46	1		*BONNET RELEASE LEVER	Cracked	13.00 FS	*10.00 FS
47	1		*BONNET LID LOCK CABLE	Cracked	67.00 FS	*53.36 FS
48	2		*LED HEADLIGHT - LH / RH	Cracked	14,454.00 FS	*11,563.20 FS
49	2		*LIGHT SYSTEM CONTROL UNIT	Serviceable	1,383.00 FS	*- FS

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
50	2		*MAIN LIGHT ELECTRONICS POWER MODULE	Serviceable	1,385.00 FS	*- FS
51	2		*LED WITH HEAT SINK - LH / RH	Serviceable	1,980.00 FS	*- FS
52	2		*HEADLIGHT HOSE - LH / RH	Crumpled	70.00 FS	*54.88 FS
53	2		*MAIN BEAM HEADLIGHT MOUNTING - LH / RH	Broken	214.00 FS	*171.20 FS
54	1		*HEADLIGHT WASHER SYSTEM LIFT CYLINDER - LH / RH	O/S Cracked N/S Not Necessary	256.00 FS	*204.00 FS
55	1		*HEADLIGHT HOSE - LH / RH	Crumpled	113.00 FS	*90.00 FS
56	1		*COOLANT RADIATOR LOCK CARRIER	Cracked	1,169.00 FS	*935.20 FS
57	2		*COOLANT BRACE - LH / RH LOWER	Bent	104.00 FS	*83.20 FS
58	1		*CHARGE AIR COOLER	Bent	724.00 FS	*578.80 FS
59	1		*INTER COOLER HOSE - LH	Serviceable	477.00 FS	*- FS
60	1		*PRESSURE SENSOR O-RING	Necessary	17.00 FS	*13.44 FS
61	1		*PRESSURE HOSE - RH	Serviceable	283.00 FS	*- FS
62	3		*AIR GUIDE - UPPER / CENTRE / LOWER	Torn	123.00 FS	*97.20 FS
63	2		*AIR GUIDE LH - RH	O/s Missing / N/s Cracked	100.00 FS	*79.36 FS
64	1		*RADIATOR LOUVRE	Cracked	483.00 FS	*386.00 FS
65	1		*SERVOMOTOR	Jammed	166.00 FS	*132.80 FS
66	1		*RADIATOR LOUVRE	Bent	820.00 FS	*655.60 FS
67	1		*A/C CONDENSOR	Bent	547.00 FS	*437.60 FS
68	4		*READY-MIX COOLANT	Necessary	84.00 FS	*67.20 FS
69	2		*COOLANT SUPPORT - LH / RH	Cracked	96.00 FS	*76.64 FS
70	1		*FAN RING	Broken	373.00 FS	*298.40 FS
71	1		*RADIATOR FAN WITH CONTROL UNIT	Dented	2,159.00 FS	*1,727.20 FS
72	2		*RUBBER BUSH - LOWER	Necessary	17.00 FS	*13.44 FS
73	2		*RUBBER BUSH - LOWER	Necessary	24.00 FS	*18.56 FS
74	1		*PRESSURE RELIEF VALVE	Serviceable	48.00 FS	*- FS
75	1		*REFRIGERANT LINE PRESSURE SENSOR	Missing	180.00 FS	*144.00 FS
76	1		*AC ADAPTER CABLE	Serviceable	27.00 FS	*- FS
77	1		*SHOCK ABSORBER MOUNTING - LH / RH	Not Necessary	698.00 FS	*- FS
78	1		*WINDOW SLOT SEAL WITH TRIM STRIP - LH FRONT	Cut	537.00 FS	*429.60 FS
79	1		*WINDOW SLOT SEAL WITH TRIM STRIP	Cut	561.00 FS	*448.80 FS
80	1		*WINDOW GUIDE - LH	Serviceable	440.00 FS	*- FS
81	2		*WINDOW GUIDE TRIM STRIP - LH / RH	Serviceable	622.00 FS	*- FS
82	1		*WINDOW GUIDE - RH	Serviceable	440.00 FS	*- FS
83	1		*FRONT DOOR	Bent	2,829.00 FS	*2,263.20 FS
84	1		*FRONT DOOR OUTER SEAL	Necessary	185.00 FS	*147.60 FS
85	1		*BONDING AGENT	Necessary	45.00 FS	*35.92 FS
86	1		*CLEANING SOLUTION	Necessary	65.00 FS	*51.68 FS
87	1		*FRONT DOOR ATTACHMENT PARTS	Not Necessary	239.00 FS	*- FS
88	1		*FRONT DOOR CATCH	Jammed	132.00 FS	*105.60 FS
89	1		*FRONT DOOR COVER - LH	Deformed	643.00 FS	*514.00 FS
90	1		*WINDOW REGULATOR WITHOUT MOTOR - LH	Bent	270.00 FS	*215.60 FS
91	1		*PILLAR B TRIM - LH	Serviceable	153.00 FS	*- FS
92	1		*REAR DOOR	Bent	2,829.00 FS	*2,263.20 FS
93	1		*REAR DOOR SEAL BRACKET	Cut	39.00 FS	*30.48 FS
94	1		*REAR DOOR OUTER SEAL - LH	Necessary	190.00 FS	*152.00 FS
95	1		*BONDING AGENT	Necessary	45.00 FS	*35.92 FS
96	1		*CLEANING SOLUTION	Necessary	65.00 FS	*51.68 FS
97	1		*REAR DOOR SEALING STRIP	Crumpled	15.00 FS	*11.68 FS
98	1		*DOOR HINGE HALF - UPPER PART - LH UPPER	Bent	42.00 FS	*33.04 FS
99	1		*DOOR HINGE HALF - LOWER PART - LH UPPER	Bent	42.00 FS	*33.04 FS
100	1		*DOOR HINGE HALF - UPPER PART - LH LOWER	Bent	42.00 FS	*33.04 FS
101	1		*DOOR HINGE HALF - LOWER PART - LH LOWER	Bent	42.00 FS	*33.04 FS
102	1		*REAR DOOR CATCH	Jammed	132.00 FS	*105.60 FS
103	1		*REAR OUTER DOOR SEAL - LH	Necessary	201.00 FS	*160.80 FS

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
104	1		*REAR INNER DOOR SEAL	Necessary	190.00 FS	*152.00 FS
105	1		*SILL PANEL SEAL - LH	Necessary	234.00 FS	*187.20 FS
106	1		*REAR DOOR SEAL BRACKET - LH	Necessary	39.00 FS	*30.48 FS
107	1		*REAR DOOR GUIDE RAIL - LH	Broken	65.00 FS	*51.44 FS
108	1		*PILLAR B TRIM - LH	Serviceable	200.00 FS	*- FS
109	1		*WINDOW REGULATOR MOTOR - LH	Serviceable	329.00 FS	*- FS
110	1		*WINDOW REGULATOR WITHOUT MOTOR - LH	Bent	277.00 FS	*221.20 FS
111	1		*REAR DOOR COVER - LH	Deformed	558.00 FS	*446.40 FS
112	1		*REAR WHEEL COVER - LH	Scratched	473.00 FS	*378.40 FS
113	1		*SIDE MEMBER - LH	Bent	2,226.00 FS	*1,780.80 FS
114	1		*INNER B PILLAR - LH	Dented	511.00 FS	*408.40 FS
115	1		*B-PILLAR REINFORCEMENT - LH	Dented	844.00 FS	*674.80 FS
116	1		*B-PILLAR CLOSING PLATE - LH	Dented	646.00 FS	*516.40 FS
117	1		*B-PILLAR CLOSING PLATE REINFORCEMENT - LH	Dented	17.00 FS	*12.96 FS
118	1		*SILL - LH	Serviceable	646.00 FS	*- FS
119	1		*NOISE INSULATION PLATE (3PCS)	Necessary	47.00 FS	*36.48 FS
120	1		*B-PILLAR PLATE - LH INNER	Necessary	12.00 FS	*9.12 FS
121	1		*AIRBAG STICKER	Necessary	23.00 FS	*17.76 FS
122	1		*DOOR TRIM - LH	Crumpled	2,301.00 FS	*1,840.80 FS
123	1		*FRONT PARKING AID SENSOR - INNER (2PCS)	Missing (1Pc Only)	462.00 FS	*83.54 FS
124	1		*SET FRONT BUMPER WIRING	Torn	378.00 FS	*302.00 FS
125	2		*THREE - POINT AUTOMATIC SEAT BELT - LH / RH	Jammed	2,010.00 FS	*1,608.00 FS
126	2		*SEAT BELT HEIGHT ADJUSTER	Jammed	322.00 FS	*257.60 FS
127	1		*AIRBAG CONTROL UNIT	Activated	1,927.00 FS	*1,541.60 FS
128	1		*AIRBAG PRESSURE SENSOR	Activated	245.00 FS	*196.00 FS
129	1		*AIRBAG CRASH SENSOR	Activated	382.00 FS	*305.20 FS
130	2		*B-PILLAR TRIM - LH UPPER / LOWER	Deformed	489.00 FS	*171.20 FS
131	1		*CENTRAL PROTECTION	Activated	485.00 FS	*388.00 FS
132	1		*FRONT NO. PLATE	Bent	40.00 FS	*40.00 FS
133	1		*SUNDRIES	Necessary	1,000.00 FS	*684.56 FS
134	1		*FUEL PUMP	Cracked	906.00 FS	*724.80 FS
135	1		*EXHAUST PIPE WITH FRONT SILENCER	Bent	1,081.00 FS	*892.00 FS
136	1		*EXHAUST PIPE SEAL	Necessary	11.00 FS	*8.24 FS
137	2		*WHEEL LINER COVER FOR JOINT SHAFT - LH / RH	Cracked	68.00 FS	*54.40 FS
138	1		*TURBOCHARGE PRESSURE HOSE RH	Cut	283.00 FS	*237.60 FS
139	1		*THROTTLE VALVE PRESSURE PIPE	Cut	477.00 FS	*381.60 FS
140	1		*THROTTLE VALVE PRESSURE SENSOR	Serviceable	183.00 FS	*- FS
141	1		*A/C COMPRESSOR REFRIGERANT LINE	Serviceable	263.00 FS	*- FS
142	1		*A/C CONDENSER REFRIGERANT LINE	Serviceable	263.00 FS	*- FS
143	1		*GUARD PLATE - LH / RH	Serviceable	198.00 FS	*- FS
144	1		*ENGINE TOP COVER	Cracked	284.00 FS	*227.20 FS
145	1		*CYLINDER HEAD COVER	Serviceable	119.00 FS	*- FS
146	1		*MAGNET	Not Necessary	331.00 FS	*- FS
147	1		*FILTER HOUSING	Serviceable	76.00 FS	*- FS
148	1		*TUBE FOR OIL DIPSTICK	Cut	104.00 FS	*83.20 FS
149	1		*TIMING CASE	Dented	384.00 FS	*307.20 FS
150	1		*SILICONE SEALANT	Necessary	59.00 FS	*46.48 FS
151	1		*EXHAUST GAS TURBOCHARGER	Cracked	4,983.00 FS	*3,986.40 FS
152	1		*SUPPORT FOR EXHAUST GAS TURBOCHARGER	Not Necessary	36.00 FS	*- FS
153	1		*OIL RETURN LINE FOR EXHAUST GAS TURBOCHARGER	Dented	157.00 FS	*125.20 FS
154	1		*OIL PIPE FOR EXHAUST GAS TURBOCHARGER	Serviceable	135.00 FS	*- FS
155	1		*HEAT INSULATION	Serviceable	45.00 FS	*- FS
156	1		*COVER PLATE FOR EXHAUST GAS TURBOCHARGER	Serviceable	77.00 FS	*- FS

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
157	1		*COOLANT PIPE FEED FOR RADIATOR	Serviceable	108.00 FS	*- FS
158	1		*COOLANT PIPE RETURN FOR RADIATOR	Distorted	99.00 FS	*78.88 FS
159	1		*AIR FILTER	Cracked	368.00 FS	*294.40 FS
160	1		*AIR FILTER INTAKE HOSE	Not Necessary	85.00 FS	*- FS
161	1		*AIR FILTER AIR GUIDE	Deformed	79.00 FS	*62.72 FS
162	1		*DRIVE SHAFT	Distorted	2,620.00 FS	*2,096.00 FS
163	1		*COOLANT PIPE	Bent	50.00 FS	*39.84 FS
164	1		*COOLANT HOSE WITH QUICK RELEASE COUPLING	Serviceable	64.00 FS	*- FS
165	1		*COOLANT PIPE	Serviceable	105.00 FS	*- FS
166	1		*VIBRATION DAMPER	Dented	396.00 FS	*316.80 FS
167	1		*POLY-V-BELT	Torn	47.00 FS	*37.12 FS
168	1		*BELT TENSIONER DAMPER	Serviceable	132.00 FS	*- FS
169	1		*ENGINE MOUNTING LHS	Cracked	331.00 FS	*264.40 FS
170	1		*ENGINE MOUNTING RHS	Distorted	331.00 FS	*264.40 FS
171	1		*SUPPORT FOR ENGINE RHS	Distorted	149.00 FS	*119.20 FS
172	1		*SUPPORT FOR ENGINE LHS	Cut	149.00 FS	*119.20 FS
173	1		*ENGINE SUPPORT BEARING LHS	Missing	63.00 FS	*49.76 FS
174	1		*ENGINE SUPPORT BEARING RHS	Distorted	63.00 FS	*49.76 FS
175	1		*HEXAGON HEAD BOLT	Necessary	89.00 FS	*70.72 FS
176	1		*CONSOLE RHS	Serviceable	511.00 FS	*- FS
177	1		*CONSOLE LHS	Bent	511.00 FS	*408.80 FS
178	1		*ASSEMBLY CARRIER	Bent	1,726.00 FS	*1,380.80 FS
179	1		*CROSS MEMBER	Cracked	583.00 FS	*466.40 FS
180	1		*GEARBOX SUPPORT	Cracked	75.00 FS	*59.36 FS
181	1		*GEARBOX MOUNTING	Bent	194.00 FS	*154.80 FS
182	1		*HIGH LUBRICITY ENGINE OIL	Necessary	270.00 FS	*215.60 FS
183	1		*WIRING SET FOR STARTER AND ALTERNATOR	Distorted	772.00 FS	*617.20 FS
184	1		*NOISE INSULATION LHS	Deformed	743.00 FS	*594.40 FS
185	1		*NOISE INSULATION RHS	Serviceable	454.00 FS	*- FS
186	1		*CRASH SENSOR FOR AIRBAG	Necessary	763.00 FS	*610.40 FS
187	1		*PRESSURE SENSOR FOR AIRBAG	Missing	245.00 FS	*196.00 FS
188	1		*BASE ENGINE	Serviceable	28,359.00 FS	*- FS
189	1		*OIL SUM-LOWER PART	Cracked	311.00 FS	*389.60 FS
190	1		*GEARBOX ASSY	Cracked	29,608.00 FS	*23,686.40 FS
191	1		*TRANSMISSION FLUID	Not Necessary	244.00 FS	*- FS
192	1		*ALUMINIUM RIM	Cut	923.00 FS	*738.40 FS
193	1		*A/C COMPRESSOR	Necessary	1,769.00 FS	*1,415.20 FS
194	1		*TYRE MICHELIN	Deformed	1,307.00 FS	*360.00 FS
195	1		*REAR SUPPORT FRAME	Bent	2,975.00 FS	*2,380.00 FS
196	1		*HEXAGON FLANGE SCREW FRONT	Necessary	41.00 FS	*32.16 FS
197	1		*HEXAGON FLANGE SCREW REAR	Necessary	33.00 FS	*26.24 FS
198	1		*CARDAN SHAFT	Torn	4,588.00 FS	*3,670.40 FS
199	1		*FRONT WISHBONE LINK RHS	Bent	491.00 FS	*392.40 FS
200	1		*SUSPENSION GUIDE	Bent	861.00 FS	*688.40 FS
201	1		*GUIDE UPPER FRONT RHS	Serviceable	297.00 FS	*- FS
202	1		*GUIDE UPPER REAR RHS	Serviceable	297.00 FS	*- FS
203	1		*WHEEL BEARING HOUSING RHS	Bent	1,035.00 FS	*828.00 FS
204	1		*SWIVEL JOINT	Necessary	175.00 FS	*140.00 FS
205	1		*WHEEL HUB	Bent	451.00 FS	*360.40 FS
206	1		*WHEEL BEARING WITH ASSY	Not Necessary	330.00 FS	*- FS
207	1		*SUSPENSION FORKS RHS	Not Necessary	345.00 FS	*- FS
208	1		*COUPLING ROD	Not Necessary	123.00 FS	*- FS
209	1		*LEVEL SENSOR WITH POLES	Not Necessary	340.00 FS	*- FS
210	1		*GAS SHOCK ABSORBER	Not Necessary	1,353.00 FS	*- FS
211	1		*MOUNTING UPPER	Not Necessary	83.00 FS	*- FS

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
212	1		*STEERING GEAR WITH INT TRACK ROD JOINT	Serviceable	6,081.00 FS	*- FS
213	1		*TIE ROD END RHS	Serviceable	180.00 FS	*- FS
214	1		*EXHAUST PIPE WITH FRONT SILENCER	Serviceable	1,081.00 FS	*- FS
215	1		*REAR AXLE DIFFERENTIAL	Bent	12,373.00 FS	*9,898.40 FS
216	1		*AXLE OIL	Serviceable	199.00 FS	*- FS
217	1		*FUEL PUMP	Serviceable	906.00 FS	*- FS
218	1		*FRONT DOOR LOCK LH	Serviceable	394.00 FS	*- FS
219	1		*REAR DOOR LOCK LH	Jammed	604.00 FS	*482.80 FS
220	1		*COOLANT HOSE WIT5H QUICK RELEASE COUPLING LOWER	Cracked	244.00 FS	*204.80 FS
221	1		*SEAL	Necessary	13.00 FS	*9.84 FS
222	1		*COOLANT HOSE WITH QUICK RELEASE COUPLING UPPER	Cracked	64.00 FS	*50.88 FS
223	1		*FUEL HOSE	Cut	132.00 FS	*108.00 FS
224	1		*CUT OFF VALVE	Not working	210.00 FS	*168.00 FS
225	1		*TRIM FOR PILLAR C LHS	Deformed	127.00 FS	*101.60 FS
226	1		*TRIM STRIP FOR WINDOW GUIDE LHS	Deformed	272.00 FS	*224.00 FS
227	1		*DOOR LOCK LHS	Not Necessary	604.00 FS	*- FS
228	1		*SIDE WINDOW LHS	Scratched	750.00 FS	*618.80 FS
229	1		*SILL TRIM STRIP LHS FRONT	Scratched	535.00 FS	*427.60 FS
230	1		*SILL TRIM STRIP LHS REAR	Scratched	130.00 FS	*108.00 FS
231	1		*WIRING SET FOR DOOR	Cut	345.00 FS	*276.00 FS
232	1		*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
233	1		*FRONT WISHBONE LINK LHS	Bent	491.00 FS	*327.60 FS
234	1		*BRAKE DISCS	Scratched	664.00 FS	*530.40 FS
235	1		*WHEEL BEARING	Necessary	232.00 FS	*185.20 FS
236	1		*OIL LEVEL SENSOR	Not Working	259.00 FS	*206.80 FS

F=Franchise part. S=SpcNett.

Total Parts (S\$) 205,382.00 117,893.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO TOW AND RECOVER VEHICLE FROM SCENE OF ACCIDENT	New	280.00	0.00
2	TO CARRY OUT FIRST MEASUREMENT ON CAR-O-LINER	New	800.00	800.00
3	TO REMOVE AND RENEW FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, FOG LAMPS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER ASSY AND FRONT PARKING AID	New	480.00	480.00
4	TO REMOVE AND RENEW, AIRCON CONDENSER, CHARGED AIR COOLER, RADIATOR, ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	New	1,200.00	1,200.00
5	TO REMOVE CENTRE CONSOLE. RENEW BOTH FRONT SEAT BELTS AND AIR BAG CONTROL UNIT. REINSTALL ALL PARTS REMOVED	New	1,800.00	1,800.00
6	TO REMOVE AND TRANSFER LHS FRONT AND REAR DOORS MULTI-LOCK SYSTEMS AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES AND RENEW IF NECESSARY	New	720.00	720.00
7	TO REMOVE AND REINSTALL LHS FRONT SEAT ASSY, ABCD PILLAR TRIMS, SILL TRIMS, FLOOR CARPETS, ELECTRONIC COMPONENT AND FUSE TRAYS	New	1,400.00	1,400.00
8	TO DISMANTLE ENGINE ASSY WITH GEARBOX ASSY. INSPECT FOR DAMAGES AND RENEW ACCORDINGLY	New	3,200.00	3,200.00
9	TO RENEW GEARBOX ASSY	New	1,800.00	1,800.00
10	TO DISMANTLE FRONT SUSPENSION ASSY. INSPECT FOR DAMAGES AND RENEW ACCORDINGLY. REINSTALL ALL PARTS REMOVED	New	2,400.00	2,400.00
11	TO PLACE VEHICLE ON CAR-O-LINER	New	1,200.00	1,200.00
12	TO DISMANTLE FRONT BUMPER, BONNET, BOTH FRONT FENDERS, LHS FRONT AND REAR DOORS. CUT OUT AND WELD BOTH FRONT CHASSIS FRAME SHOCK ABSORBER MOUNTING, LHS B-PILLAR, REINFORCEMENT PANELS AND SILL PANEL REINFORCEMENT. ALIGN BOTH FRONT CHASSIS FRAMES TO SPECIFICATION OF ORIGIN. RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RENEW DAMAGED PANELS. RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS. }	New	17,600.00	7,500.00
13	REINSTALL ALL PARTS REMOVED }	New	0.00	0.00
14	TO REMOVE RHS FRONT DOOR PANEL TRIMS, DISMANTLE RHS WING MIRROR ASSY. RENEW DOOR CHROME MOLDING	New	400.00	250.00
15	TO RESPRAY FRONT BUMPER, LOWER SPOILER, BOTH FRONT FENDERS, BONNET, HINGES, BOTH A-PILLARS, BOTH FRONT DOORS, LHS REAR DOOR, DOOR COVERS, LHS B-PILLAR, SILL PANEL, INNER PANELS DOOR ENTRANCES, LHS REAR FENDER AND WHEEL ARCH TRIMS, AND ENGINE COMPARTMENT. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS	New	15,000.00	7,975.00
16	TO RENEW LHS REAR RIM AND CARRY OUT WHEEL ALIGNMENT	New	280.00	280.00
17	TO CARRY OUT DIAGNOSTIC CHECK	New	384.00	384.00
18	TO REMOVE AND RENEW EXHAUST GAS TURBOCHARGER AND OTHER ENGINE COMPARTMENT	New	980.00	980.00
19	TO REMOVE AND REINSTALL EXHAUST SYSTEM AND REAR SUSPENSION ASSEMBLY, INCLUDING REAR AXLE AND PROPELLOR SHAFT. RENEW ACCORDINGLY	New	3,200.00	3,200.00
20	TO RENEW 1/4 GLASS LHS REAR	New	300.00	300.00
21	TO INSTALL SOLAR FILM FOR 1/4 GLASS	New	400.00	400.00
Gross Labour Cost (\$\$)			53,824.00	36,269.00

< END OF ESTIMATES >