



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SFY 3172P

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BOOT LID	DENTED / DISTORTED	2,671.97	1,875.00
1	BOOT LID NAME PLATE 'VOLVO'	NECESSARY	92.90	92.90
1	BOOT LID NAME PLATE 'S40'	NECESSARY	82.00	82.00
1	BOOT LID NAME PLATE '2.0'	NECESSARY	80.80	80.80
1	BOOT LID LOCK	SERVICEABLE	530.70	-
1	BOOT LID WEATHER-STIP	SERVICEABLE	166.90	-
1	TAIL LAMP LH	CRACKED	820.30	820.30
1	REAR BUMPER	DENTED / TORN	1,827.33	1,285.40
1	REAR BUMPER LOWER	GRAZED / CUT	693.00	693.00
1	REAR BUMPER REFLECTOR LH	BROKEN	115.43	115.43
1	REAR BUMPER CENTRE BRACKET	SERVICEABLE	422.30	-
1	REAR BUMPER RETAINER LH	SERVICEABLE	97.57	-
1	REAR BUMPER SUPPORT LH	SERVICEABLE	74.58	-
1	REAR BUMPER REINFORCEMENT	DENTED	1,222.50	1,135.00
1	LHR FENDER INNER SHIELD	BROKEN	261.90	261.90
1	REAR END PANEL	TO REPAIR SEE LABOUR	1,127.18	-
1	REAR END PANEL TRIM	SERVICEABLE	552.36	-
1	EXHAUST SILENCER	TO REPAIR SEE LABOUR	968.33	-
			11,808.05	6,441.73
<u>SPECIAL NETT ITEMS</u>				
1	SET BOOT LID INNER TRIM CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET REVERSE SENSOR (SN)	MALFUNCTIONED	300.00	220.00
1	JOINT SEALANT (SN)	NOT NECESSARY	60.00	-
			410.00	220.00
<u>LABOUR</u>				
	CHECK REAR LIGHTING & WIRINGS.		80.00	30.00
	TO REMOVE & TRANSFER BOOT LID FITTINGS.		150.00	60.00
	RENEW REVERSE SENSOR.		50.00	40.00

Report Ref No. CS1/LPC19016929/Dqd3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE & REFIT REAR UPHOLSTERIES TO ENABLE REPLACEMENT.	NOT NECESSARY	120.00	100.00
	RENEW EXHAUST SILENCER.		180.00	-
	ANTI RUST TREATMENT ON REAR AFFECTED PANELS.		100.00	60.00
	TO RENEW REAR DAMAGED PARTS, PANEL BEAT, REFORM & REALIGN AFFECTED AREA. INCLUSIVE OF THE REPAIR OF REAR END PANEL AND EXHAUST SILENCER.		2,000.00	800.00
	TO RESPRAY REAR AFFECTED PANELS.		1,600.00	800.00
			4,280.00	1,890.00
GRAND TOTAL			16,498.05	8,551.73

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,800.00
--	--	--	--	----------

Report Ref No. CS1/LPC19016929/Dqd3s2

ANG BRYAN TANI

Automotive Assessor / Investigator

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.