



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD
3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV No. AC2003203
INV Date 16/04/2020
Reference CC6/CTI19017024/Aea3n2
Code CTI



PROFESSIONAL SERVICE FEE

Vehicle No. SML 4914U
Insured Veh. SMG 9810D
Claim No. SNM19D204378C02/0
Policy No. DMPCSN1904371900
Accident Date 13/09/2019
Inspection Date 16/09/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CC6/CTI19017024/Aea3n2

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 16-04-2020



Code : CTI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SMG 9810D	Veh. Inspected	SML 4914U
Policy No.	DMPCSN1904371900	Coverage (\$)	0.00
Claim No.	SNM19D204378C02/0	Excess (\$)	0.00
Assign From		Assign Date	16/09/2019

2. Vehicle Particulars & Condition

Make & Model	MERCEDES BENZ CLA 180	c.c	1600
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	WDD1173422N186566	Colour	BROWN
Odometer	62071	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	225/40 R18	PIRELLI	6 mm
L/H Front Tyre	225/40 R18	PIRELLI	6 mm
R/H Rear Tyre	225/40 R18	PIRELLI	6 mm
L/H Rear Tyre	225/40 R18	PIRELLI	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	13/09/2019	Inspection Date	16/09/2019
Survey held at	FLYING HIGH SPRAY PAINTING BLK 1 KAKI BUKIT AVE 6 #01-29 AUTOBAY SINGAPORE 417883		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	11 Working Days
-------------------------------------	-----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SML 4914U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEFORMED	1,439.00	1,439.00
1	REAR BUMPER CLIPS	NECESSARY	30.00	30.00
2	REAR BUMPER SIDE HOLDER @\$85.00	NECESSARY	170.00	170.00
1	REAR BUMPER LOWER GARNISH	DEFORMED	488.00	488.00
1	REAR BUMPER LOWER CHROME MOULDING	CUT	406.00	406.00
1	REAR BUMPER REINFORCEMENT	BENT	669.00	669.00
4	REVERSE SENSOR @\$260.00	DAMAGED (2 PCS ONLY)	1,040.00	520.00
1	TAILLAMP LH	CRACKED	795.00	795.00
1	TAILLAMP LOWER BRACKET	DAMAGED	95.00	95.00
1	BOOTLID	DENTED	1,875.00	1,875.00
1	BOOTLID LOCK	NOT NECESSARY	289.00	-
1	BOOTLID WEATHERSTRIPE	NOT NECESSARY	278.00	-
1	MERCEDES BENZ LOGO	NECESSARY	78.00	78.00
1	CLA 180 WORDING	NECESSARY	155.00	155.00
1	CYCLE AND CARRIAGE LOGO	NECESSARY	45.00	45.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	981.00	-
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	223.00	-
1	REAR EXHAUST PIPE	NOT NECESSARY	1,650.00	-
1	REAR EXHAUST CHROME PIPE LH	CUT	302.00	302.00
1	FRONT BUMPER	DISTORTED	1,554.00	1,554.00
1	FRONT BUMPER CLIPS	NECESSARY	30.00	30.00
1	FRONT BUMPER SIDE HOLDER LH	NECESSARY	85.00	85.00
1	FRONT BUMPER SPONGE	CRACKED	185.00	185.00
1	FRONT BUMPER REINFORCEMENT	BENT	585.00	585.00
1	FRONT BUMPER SIDE COVER LH	NOT NECESSARY	46.00	-
1	FRONT BUMPER LOWER GRILLE	CRACKED	179.00	179.00
1	FRONT BUMPER NOZZLE PUMP LH	CRACKED	185.00	185.00
1	FRONT BUMPER NOZZLE PUMP COVER LH	DAMAGED	35.00	35.00
1	FRONT BUMPER REINFORCEMENT BRACKET LH	BENT	285.00	285.00

Report Ref No. CC6/CTI19017024/Aea3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER UNDER COVER	TORN	326.00	326.00
1	FRONT BUMPER UNDER COVER CLIPS	NECESSARY	30.00	30.00
1	FRONT BUMPER INNER FRAME	CRACKED	98.00	98.00
1	FRONT BUMPER REINFORCEMENT COVER	CRACKED	149.00	149.00
2	FRONT BUMPER SENSOR @\$260.00	DAMAGED (1 PC ONLY)	520.00	260.00
1	AIR CON CONDENSER	WARPED	1,091.00	1,091.00
1	RADIATOR	CRACKED	825.00	825.00
1	OIL COOLER	NOT NECESSARY	973.00	-
1	RADIATOR FAN COWLING	NOT NECESSARY	345.00	-
1	WIPER WASHER TANK	DEFORMED	165.00	165.00
1	FRONT LH FENDER	TO REPAIR SEE LABOUR	1,030.00	-
1	FRONT GRILLE	CRACKED	692.00	692.00
1	FRONT GRILLE LOGO	NECESSARY	189.00	189.00
1	FRONT AIR DUCT	DEFORMED	75.00	75.00
1	HEADLAMP LH	CRACKED	2,663.00	2,663.00
1	HEADLAMP BRACKET LH	DAMAGED	310.00	310.00
1	HORN	DAMAGED	65.00	65.00
	LESS 10% DISCOUNT		-	-1,712.80
			23,723.00	15,415.20
	<u>SPECIAL NETT ITEMS</u>			
1	REAR END PANEL SEALANT (SN)	NOT NECESSARY	60.00	-
			60.00	-
	<u>LABOUR</u>			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR END PANEL AND FRONT LH FENDER.		2,000.00	1,400.00
	SPRAY PAINTING.		2,000.00	1,200.00
	WIRING.		100.00	60.00
	TO UNDERSEAL.		150.00	50.00
	TO REMOVE FRONT BUMPER SENSOR.		150.00	60.00
	TO REMOVE CONDENSER,RADIATOR AND TO RE-GAS.		180.00	120.00
	TO REMOVE REVERSE SENSOR.		150.00	60.00

Report Ref No. CC6/CTI19017024/Aea3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE UPHOLSTERY.		150.00	60.00
	TO TRANSFER BOOTLID FITTINGS.		150.00	80.00
	TO REMOVE REAR CAMERA.		100.00	60.00
	TO REMOVE EXHAUST PIPE.	NOT NECESSARY	150.00	-
			5,280.00	3,150.00
GRAND TOTAL			29,063.00	18,565.20
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				14,800.00

Report Ref No. CC6/CTI19017024/Aea3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.