



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2101217

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 01/03/2021
Reference CC6/CTI19017345/Apa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLR 6160U
Insured Veh. SLN 2077A
Claim No. SNM19D204636
Policy No. DMPCSN3026671900
Accident Date 23/09/2019
Inspection Date 01/10/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI19017345/Apa3q2	
			Date: 01/03/2021	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SLN 2077A	Veh. Inspected	SLR 6160U	
Policy No.	DMPCSN3026671900	Coverage (\$)	0.00	
Claim No.	SNM19D204636	Excess (\$)	0.00	
Assign From		Assign Date	01/10/2019	
2. Vehicle Particulars & Condition				
Make & Model	OPEL ASTRA	c.c	999	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	W0LBE8EA2H8065468	Colour	GREEN	
Odometer	100380 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	225/45 R17	PIRELLI	6 mm	
L/H Front Tyre	225/45 R17	PIRELLI	6 mm	
R/H Rear Tyre	225/45 R17	PIRELLI	6 mm	
L/H Rear Tyre	225/45 R17	PIRELLI	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	23/09/2019	Inspection Date	01/10/2019	
Survey held at	XIN HUA WORKSHOP PTE LTD 23 KAKI BUKIT AVENUE 4 #04-01 (SOUTH WING) SINGAPORE 415933			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLR 6160U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	RR BUMPER	DEFORMED	1,966.00	1,966.00
1	RR BUMPER SPONGE	CRACKED	180.00	180.00
1	RR BUMPER TOW COVER	DEFORMED	94.00	94.00
1	RR BUMPER SIDE RETAINER RH	NECESSARY	154.00	154.00
1	RR BUMPER CENTER RETAINER	NECESSARY	160.00	160.00
1	RR BUMPER SIDE RETAINER LH	NECESSARY	154.00	154.00
1	RR BUMPER LOW BRACKET RH	NECESSARY	86.00	86.00
1	RR BUMPER LOW BRACKET LH	NECESSARY	86.00	86.00
1	RR BUMPER REINFORCEMENT	BENT	716.00	716.00
1	RR BUMPER LOW GARNISH	DEFORMED	332.00	332.00
4	RR BUMPER REVERSE SENSOR	DAMAGED	528.00	528.00
4	RR BUMPER REVERSE SENSOR RUBBER SEAL	NECESSARY	40.00	40.00
1	RR BUMPER REVERSE SENSOR WIRE HARNESS	SNAPPED	390.00	390.00
1	RR BUMPER REFLECTOR RH	CRACKED	144.00	144.00
1	RR BUMPER REFLECTOR LH	NOT NECESSARY	144.00	-
1	RR REVERSE CAMERA	NOT NECESSARY	477.00	-
1	RR TAILGATE	DENTED	2,488.00	2,488.00
1	RR TAILGATE LOGO	NECESSARY	222.00	222.00
1	RR TAILGATE ASTRA EMBLEM	NECESSARY	174.00	174.00
1	RR TAILGATE ECO EMBLEM	NECESSARY	154.00	154.00
1	RR TAILGATE LOCK	DAMAGED	320.00	320.00
1	RR TAILGATE LOCK CARRIER	NOT NECESSARY	146.00	-
1	RR TAILGATE LOCK KEYLESS REVEIVER SENSOR	CRACKED	274.00	274.00
1	RR TAILGATE WEATHER STRIP	CUT	252.00	252.00
1	RR TAILGATE HINGE RH	NOT NECESSARY	138.00	-
1	RR TAILGATE HINGE LH	NOT NECESSARY	138.00	-
1	RR TAILGATE STOPPED	NOT NECESSARY	56.00	-
1	RR TAILGATE INNER TRIM BOARD	CRACKED	462.00	462.00
1	RR TAILGATE REFLECTOR RH - T/LAMP FOG	CRACKED	666.00	666.00
1	RR TAILGATE REFLECTOR LH - T/LAMP FOG	NOT NECESSARY	666.00	-
1	RR TAILGATE TOP SPOILED	NOT NECESSARY	1,112.00	-

Report Ref No. CC6/CTI19017345/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RR TAILGATE GLASS	NOT NECESSARY	682.00	-
1	RR TAILGATE HANDS FREE SENSOR	CRACKED	423.00	423.00
1	RR TAIL LAMP RH	CRACKED	618.00	618.00
1	RR TAIL LAMP LH	NOT NECESSARY	618.00	-
1	RR END PANEL	TO REPAIR SEE LABOUR	816.00	-
1	RR END PANEL TOP GARNISH	DEFORMED	280.00	280.00
	LESS 10% DISCOUNT		-1,635.60	-1,136.30
			14,720.40	10,226.70
	<u>SPECIAL NETT ITEMS</u>			
10	FENDER INNER SHIELD CLIP (SN)	NOT NECESSARY	60.00	-
10	RR BUMPER CLIP (SN)		60.00	30.00
10	RR TAILGATE INNER TRIM BOARD CLIP (SN)	NECESSARY	60.00	30.00
10	RR TAILGATE TOP SPOILER CLIP (SN)	NOT NECESSARY	60.00	-
5	RR END PANEL TOP GARNISH CLIP (SN)	NECESSARY	30.00	10.00
1	RR WINDSCREEN SEALANT (SN)	NECESSARY	65.00	40.00
1	RR WINDSCREEN INNER SEAL (SN)	NECESSARY	40.00	30.00
1	RR WINDSCREEN SOLAR FILM (SN)	NOT NECESSARY	200.00	-
1	RR NUMBER PLATE WITH CASING (SN)	CRACKED	65.00	65.00
			640.00	205.00
	<u>LABOUR</u>			
	TO DISMANTLE / RENEW THE ACCIDENT DAMAGED PORTION, TO PANEL BEATING, RESHAPE, STRAIGHTEN, ORIENTATE AND ALIGN REPAIR / REPLACEMENT PARTS. INCLUSIVE OF THE REPAIR OF RR END PANEL.		1,200.00	600.00
	CARRY OUT SPRAY PAINTING OF AFFECTED AREA. RR BUMPER, RR END PANEL, RR TAILGATE, RR TAILGATE TOP SPOILER, RR FENDER RH, RR FENDER LH.		1,200.00	600.00
	TO DISCONNECT FRONT WIRE HARNESS OF ELECTRICAL COMPONENT TO FACILITATE REPAIRS, RECONNECT AND CHECK ELECTRICAL FUNCTION AFTER REPAIR.		180.00	30.00
	REMOVE AND REFIX SEAT CUSHION / UPHOLSTERY & ROOF LINING TO FACILITATE REPAIRS.		400.00	60.00
	TO REMOVE AND REFIX REVERSE SENSOR AND CONDUCT TEST.		80.00	50.00

Report Ref No. CC6/CTI19017345/Apa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE AND REFIX REVERSE CAMERA AND CONDUCT TEST.		80.00	50.00
	TO CONDUCT TRANSFER OF PARTS FROM OLD TAILGATE TO NEW TAILGATE.		200.00	80.00
	TO CONDUCT WATER LEAKAGE TEST AFTER REPAIRS OF VEHICLE.	NOT NECESSARY	80.00	-
	TO REMOVE AND REFIX REAR TAIL GATE WINDSCREEN.		200.00	120.00
	TO RESET FAULTY CODE.	NOT NECESSARY	200.00	-
			3,820.00	1,590.00
GRAND TOTAL			19,180.40	12,021.70
RECOMMENDED COST OF REPAIRS				12,021.70

Report Ref No. CC6/CTI19017345/Apa3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 6160U

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLR 6160U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

