

Kh

**Esteem Performance Pte Ltd  
385 Sin Ming Drive, Vicom Vehicle  
Inspection Centre (575718)**

**Insurer Reference:**  
**Repairer Reference: 018323**  
**Date calculated: 24/11/2019 1:01 PM**

**Full Report**  
**Registration: SLT3421B**  
**Printed: 24/11/2019 1:01 PM**

**Summary Information**

---

**Claim**

Location:	Singapore (SG)	Work Provider:	AIG Asia Pacific Insurance Pte Ltd
Printed by:	Carmen SG	Currency:	SGD
Claim Reference:		Date of Incident:	05/10/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

**Vehicle Details**

---

**Vehicle**

Manufacturer:	TOYOTA
Model:	PRIUS IV
Sub Model:	BASE MODEL
Model Sheet Number:	70 P5 01
Registration:	SLT3421B
VIN number:	
Odometer:	

**Vehicle Condition**


---

**Vehicle Status**

Pre-Accident Damage:  
Date of Inspection:

**Damage Areas**

All   
Underbody

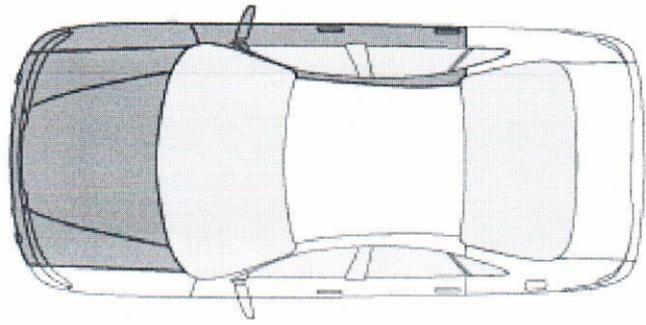

**Labour**

---

**Time Base 10 WU/h** **Price = 50.00 SGD/h**

Code	Description	WU	Price SGD
B020	RENEW FRONT BUMPER INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE AND NECESSARY ATTACHED PARTS	15.0	75.00
B040)	R + R RIGHT HEADLAMP (BUMPER REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMP	1.0	5.00
NO NUMBER	ADJUST HEADLAMPS	2.0	10.00
B110	RENEW R/F WING (BUMPER AND HEADLAMP REMOVED) INCLUDES: R + R WING, CONVERT ATTACHED PARTS	7.0	35.00
B100	R + R R/SILL TRIM	3.0	15.00
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>
<b>Panel / Mechanical Labour</b>		2.80	28.0
<b>Total of Labour</b>			140.00 ✓

## Paint

Code	Description	WU	Price SGD
Paint Work		SYSTEM AZT	
		Time Basis 10 WU/h	
	R/F WING NEW PART PAINTING	10.0	
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	R/DOOR MIRROR COVER NEW PART PAINT K1R	3.0	

## Paint Material Per Part

Code	Description	Price SGD
0742	R/F WING NEW PART PAINTING	16.93
0283	FRONT BUMPER NEW PART PAINT K1R	48.16
1746	R/DOOR MIRROR COVER NEW PART PAINT K1R	2.09

<b>Labour Cost - Paint</b>		Hrs	WU	Price SGD
Factor	50.00 SGD/h			
Time Paint			24.0	
Preparation Main Work Metal		0.70	7.0	35.00
Preparation Comp. Work Plastic		0.30	3.0	15.00
<b>Total</b>	<b>10 WU/h</b>	<b>3.40</b>	<b>34.0</b>	<b>170.00</b> ✓

<b>Material Cost - Paint</b>		Price SGD
New Part Painting		16.93
New Part Painting - Plastic K1R		50.25
Material-constant Metal		18.10
Material-constant Plastic		9.00
<b>Total</b>		<b>94.28</b> ✓

## Spare Parts

prices as at 2015-06-01/01

Code	Description	Part Number	Supplier	Price SGD
0283	FRONT BUMPER	52119 47962	BUCKLEB/CRA	450.80 ✓
0742	R/F WING	53801 47080	BENT	868.70 ✓
0812	R/F WING BADGE	75374 47140	NOC	44.17 ✓
1001	FRONT BUMPER CLIP	B.CLIP	NOC	40.00 ✓
1005	RHF HUP CAP	RHF HUP CAP	DD	195.62 ✓
f: OEM Parts	<b>Savings</b>			0.00
n: Non-OEM Parts	<b>Subtotal</b>			1,599.29
u: Used parts	<b>Subtotal Discount(+30.00%)</b>			-479.79
	<b>Total</b>			1,119.50

### Extras

Code	Description	Price SGD
1006	TO DO ALIGNMENT ALIGNMENT	60.00* ✓
1007	TUFF COAT TUFF COAT	30.00* ✓
	<b>Total Extras</b>	90.00

### Final Calculation

	SGD	SGD
<b>Parts</b>	1,599.29	
Total Discount(+30.00%)	-479.79	
<b>Total Parts</b>		1,119.50
<b>Labour Time Base 10 WU/h</b>		
Total 28.0 WU X 50.00 SGD/h	140.00	
<b>Total of Labour</b>		140.00
<b>Total Of Extras</b>		90.00
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 34.0 WU X 50.00 SGD/h	170.00	
Material Cost	94.28	
<b>Total Paint Including Material</b>		264.28
<b>Repair Cost Excludes GST</b>		1,613.78
GST (+7.0%)		112.96
<b>Repair Cost Included GST</b>		1,726.74

### Comments

\* - USER SUPPLIED DATA  
 NN - NO MANUFACTURERS CODE EXISTS  
 ) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
 Signature:  
 Date: