

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/III19018574/UGA3Q2

Date: 02/06/2020

REFERENCE

Handling Insurer: India International Insurance Pte Ltd	Policy No:	MCOM0015
Claimant		
Vehicle No : SKF2612J	Insured Vehicle No :	SHC1584P
Date of Loss: 18/10/2019	Nature of Claim: TP	Claim No: MCT19100426

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKF2612J	Engine No:	CAV384834
Make & Model:	VOLKSWAGEN JETTA, 1.4 TSI 1623Q5 (A)	Chassis No:	WVWZZZ16ZCM115645
Reg. Date:	11/05/2012 (Man. Year: 2012)	Odometer:	141998 km
Colour:	White		
Engine Capacity:	1390 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/40 R18	Rear Tyre Size:	225/40 R18
Front Left Side:	Goodyear 6 mm	Rear Left Side:	Goodyear 6 mm
Front Right Side:	Goodyear 6 mm	Rear Right Side:	Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,870.72	3,664.19	2,206.53	37.59
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,500.00	720.00	780.00	52.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$)	7,370.72	4,384.19	2,986.53	40.52
Approved Total (Overridden) (\$)		3,500.00		
Nett Amount (\$)	7,370.72	3,500.00	3,870.72	52.51
+ Loss of Use (4.0 x \$S\$60.00/day) (\$)		240.00		
Nett Liability (\$)		3,740.00		
Global Sum Settlement (\$)		3,700.00		

INSPECTION

Date of Assignment:	21/10/2019	
Date Inspected:	21/10/2019 Inspected At:	Choo Motor Spray Painter (HQ) 1 Kaki Bukit Avenue 6, #01-39 AutoBay @ Kaki Bukit Singapore 417883
Estimated Period of Repair:	3.0 days	

Adjuster: MARCUS CHUA

Manager: Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 01 Apr 2020)
Parts:	143	VOLKSWAGEN JETTA 1.4 TSI 1623Q5 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKF2612J)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed / Scratched	1,566.32 F	*1,315.32 FL
2	1		*FRONT BUMPER FOG LAMP COVER O/S	Not Necessary	211.40 F	*- FL
3	1		*FRONT BUMPER FOG LAMP O/S	Not Necessary	420.15 F	*- FL
4	1		*HEADLAMP ASSY O/S	Scratched / Cracked	2,205.35 F	*2,201.25 FL
5	1		*FRONT GRILLE	Cracked	850.00 F	*554.75 FL
6	1		*FRONT FENDER O/S	Repair	617.50 F	*- FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	5,870.72	4,071.32
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	407.13
Total Parts (\$\$)	5,870.72	3,664.19

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO CHECK WIRING	New	50.00	20.00
2	TO SPRAY RUST PROOFING	New	50.00	0.00
3	LABOUR FOR PANEL & REPLACING PARTS	New	600.00	300.00
4	TO PUTTY & SPRAY PAINTING	New	800.00	400.00
Gross Labour Cost (\$\$)			1,500.00	720.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >