



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2105760

INV Date 17/08/2021

Reference CC4/LPC19018826/R1pa3q2

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SLN 7916X
Insured Veh. XE 3129H
Claim No. 19/19/19/VC05/022557
Policy No. Z19VC05002822
Accident Date 18/10/2019
Inspection Date 23/10/2019

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC19018826/R1pa3q2 Date: 17/08/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	XE 3129H	Veh. Inspected	SLN 7916X	
Policy No.	Z19VC05002822	Coverage (\$)	0.00	
Claim No.	19/19/19/VC05/022557	Excess (\$)	0.00	
Assign From	GERALD	Assign Date	23/10/2019	
2. Vehicle Particulars & Condition				
Make & Model	MAZDA 3 SEDAN 1.5 AT	c.c	1496	
Engine No.	HIDDEN	Year of Reg.	2017	
Chassis No.	JM6BN22A8H0152535	Colour	BLACK	
Odometer	-	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/60 R16	WEST LAKE	6 mm	
L/H Front Tyre	205/60 R16	WEST LAKE	6 mm	
R/H Rear Tyre	205/60 R16	WEST LAKE	6 mm	
L/H Rear Tyre	205/60 R16	WEST LAKE	6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT AND O/S REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	18/10/2019	Inspection Date	23/10/2019	
Survey held at	74 Kian Teck Road Singapore 628800			
Repairer	PEGASUS ENGINEERING & TRADING PTE LTD			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			20 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLN 7916X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR END PANEL TOP GARNISH	DEFORMED	125.00	125.00
6	REAR END PANEL TOP GARNISH CLIP @\$4.00	NECESSARY	24.00	24.00
1	REAR SPARE TYRE PANEL	TO REPAIR SEE LABOUR	825.00	-
1	REAR SPARE TYRE PANEL FLOOR BOARD	SERVICEABLE	350.00	-
1	REAR SPARE TYRE PANEL TOOLKITS FOAM	SERVICEABLE	228.00	-
2	REAR SPARE TYRE SIDE EXTENSION PANEL @\$298.00	SERVICEABLE	596.00	-
1	REAR BOOTLID COVER	BENT	965.00	965.00
1	REAR BOOTLID 'MAZDA' EMBLEM	NECESSARY	75.00	75.00
1	REAR BOOTLID 'MAZDA 3' BADGE	NECESSARY	55.00	55.00
1	REAR BOOTLID 'SKYACTIV' BADGE	NECESSARY	65.00	65.00
2	REAR BOOTLID NUMBER PLATE LAMP @\$85.00	SERVICEABLE	170.00	-
2	REAR BOOTLID REFLECTOR @\$295.00	O/S CRACKED	590.00	295.00
6	REAR BOOTLID REFLECTOR CLIP @\$5.00	O/S NECESSARY	30.00	15.00
1	REAR BOOTLID INNER TRIM BOARD	SERVICEABLE	395.00	-
4	REAR BOOTLID INNER TRIM BOARD CLIP @\$4.00	NECESSARY	16.00	16.00
1	REAR BOOTLID LOCK	SERVICEABLE	198.00	-
2	REAR BOOTLID HINGE @\$155.00	BENT	310.00	310.00
2	REAR BOOTLID REFLECTOR SIDE COVER @\$35.00	SERVICEABLE	70.00	-
1	REAR BOOTLID CATCH	SERVICEABLE	55.00	-
2	REAR FENDER @\$1,385.00	O/S BUCKLED	2,770.00	1,385.00
2	REAR FENDER SPLASH SHIELD @\$155.00	DEFORMED (1 PCS ONLY)	310.00	155.00
20	REAR FENDER SPLASH SHIELD CLIP @\$4.00	NECESSARY (10 PCS ONLY)	80.00	40.00
2	REAR FENDER EXTENSION PANEL @\$265.00	BUCKLED (1 PCS ONLY)	530.00	265.00
2	REAR FENDER AIR VENT @\$85.00	O/S CRACKED	170.00	85.00
2	REAR FENDER INNER TRIM BOARD @\$495.00	O/S DEFORMED	990.00	495.00
20	REAR FENDER INNER TRIM BOARD CLIP @\$4.00	NECESSARY (10 PCS ONLY)	80.00	40.00
2	REAR TAILLAMP @\$535.00	O/S BROKEN	1,070.00	535.00
2	REAR TAILLAMP PANEL @\$385.00	O/S BENT	770.00	385.00

Report Ref No. CC4/LPC19018826/R1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
6	REAR TAILLAMP CLIP @\$5.00	NECESSARY (3 PCS ONLY)	30.00	15.00
1	REAR CHASSIS LHS	TO REPAIR SEE LABOUR	965.00	-
1	REAR CROSS MEMBLER PANEL	SERVICEABLE	1,795.00	-
2	REAR FENDER WHEEL HOUSE PANEL @\$735.00	O/S BUCKLED	1,470.00	735.00
2	REAR SHOCK ABSORBER @\$325.00	O/S BENT	650.00	325.00
2	REAR DRIVE SHAFT @\$1715.00	SERVICEABLE	3,430.00	-
2	REAR SHOCK ABSORBER MOUNTING @\$195.00	SERVICEABLE	390.00	-
2	REAR KNUCKLE ARM @\$655.00	SERVICEABLE	1,310.00	-
2	REAR LOWER ARM @\$255.00	SERVICEABLE	510.00	-
2	REAR WHEEL BEARING @\$378.00	SERVICEABLE	756.00	-
1	REAR STABILIZER LINK	SERVICEABLE	95.00	-
1	REAR STABILIZER BAR	SERVICEABLE	200.00	-
1	REAR STABILIZER BUSH	SERVICEABLE	55.00	-
2	REAR DOOR @\$1000.00	BUCKLED	2,000.00	2,000.00
2	REAR DOOR HINGE RHS @\$58.00	SERVICEABLE	116.00	-
1	REAR DOOR CHECKER RHS	SERVICEABLE	45.00	-
1	REAR DOOR REGULATOR	SERVICEABLE	155.00	-
1	REAR DOOR REGULATOR MOTOR	SERVICEABLE	175.00	-
1	REAR DOOR OUTER HANDLE RHS	SERVICEABLE	125.00	-
1	REAR DOOR OUTER HANDLE CAP RHS	SERVICEABLE	40.00	-
1	REAR DOOR OUTER CHROME MOULDING RHS	DISTORTED	155.00	155.00
1	REAR DOOR INNER TRIM BOARD RHS	SERVICEABLE	595.00	-
10	REAR DOOR INNER TRIM BOARD CLIP @\$5.00	NECESSARY	50.00	50.00
1	REAR DOOR LOCK RHS	BENT	285.00	285.00
1	REAR DOOR CATCH RHS	SERVICEABLE	45.00	-
1	REAR WINDSCREEN GLASS	BROKEN	1,155.00	1,155.00
1	REAR WINDSCREEN GLASS MOULDING	NECESSARY	125.00	125.00
1	REAR WINDSCREEN GLASS SPONGE	SERVICEABLE	100.00	-
1	REAR SEAT BACK CUSHION	SERVICEABLE	789.00	-
1	FRONT WHEEL BEARING LHS	NECESSARY	545.00	545.00
2	FRONT SHOCK ABSORBER @\$298.00	BENT (1 PCS ONLY)	596.00	298.00
2	FRONT LOWER ARM @\$485.00	BENT (1 PCS ONLY)	970.00	485.00

Report Ref No. CC4/LPC19018826/R1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT SHOCK ABSORBER MOUNTING @\$298.00	NECESSARY (1 PCS ONLY)	596.00	298.00
2	FRONT KNUCKLE ARM @\$398.00	BENT (1 PCS ONLY)	796.00	398.00
1	FRONT STEERING RACK & PINION	SERVICEABLE	1,985.00	-
1	FRONT STEERING TIE ROD END	SERVICEABLE	168.00	-
1	FRONT DRIVER SEAT	SERVICEABLE	1,890.00	-
1	ROOF TOP PANEL	SERVICEABLE	1,598.00	-
2	ROOF TOP SIDE MOULDING @\$185.00	SERVICEABLE	370.00	-
1	ROOF TOP INNER LINING	SERVICEABLE	1,415.00	-
1	FRONT DRIVER SEAT BACK CUSHION	SERVICEABLE	538.00	-
2	REAR BOOTLID HINGE COVER @\$75.00	SERVICEABLE	150.00	-
1	REAR SEAT	SERVICEABLE	2,150.00	-
1	FRONT BUMPER	DEFORMED	1,130.00	1,130.00
1	FRONT BUMPER SIDE RETAINER LHS	NECESSARY	70.00	70.00
10	FRONT BUMPER CLIP @\$4.00	NECESSARY	40.00	40.00
4	FRONT BUMPER RIVET @\$5.00	NECESSARY	20.00	20.00
1	FRONT BUMPER FOGLAMP LHS	CRACKED	150.00	150.00
1	FRONT BUMPER FOGLAMP COVER LHS	CUT	75.00	75.00
1	FRONT HEADLAMP LHS	BROKEN	1,075.00	1,075.00
1	FRONT FENDER LHS	BUCKLED	395.00	395.00
1	FRONT FENDER SPLASH SHIELD	TORN	148.00	148.00
10	FRONT FENDER SPLASH SHIELD CLIPS @\$4.00	NECESSARY	40.00	40.00
1	FRONT FENDER LOWER AIR DEFLECTOR LHS	SERVICEABLE	75.00	-
1	FRONT FENDER INNER SIDE BRACKET LHS	NECESSARY	85.00	85.00
1	FRONT DOOR LHS	TO REPAIR SEE LABOUR	1,145.00	-
2	FRONT DOOR HINGE @\$65.00	SERVICEABLE	130.00	-
1	FRONT DOOR CHECKER	SERVICEABLE	78.00	-
1	FRONT DOOR REGULATOR	SERVICEABLE	158.00	-
1	FRONT DOOR REGULATOR MOTOR	SERVICEABLE	195.00	-
1	FRONT SIDE MIRROR LHS	SERVICEABLE	498.00	-
1	FRONT SIDE MIRROR COVER LHS	SERVICEABLE	155.00	-
1	REAR BUMPER	DEFORMED	1,075.00	1,075.00
1	I-STOP CONVERTER	SERVICEABLE	495.00	-

Report Ref No. CC4/LPC19018826/R1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FUEL BOX	SERVICEABLE	485.00	-
2	REAR BUMPER SIDE RETAINER @\$55.00	O/S CRACKED	110.00	55.00
1	FUEL BOX COVER	SERVICEABLE	65.00	-
10	REAR BUMPER CLIPS @\$4.00	NECESSARY	40.00	40.00
1	FRONT CROSS MEMBER	SERVICEABLE	1,795.00	-
4	REAR BUMPER RIVET @\$5.00	NECESSARY	20.00	20.00
1	FRONT DASH BOARD TOP	TORN	1,450.00	1,450.00
2	REAR BUMPER TOW COVER @\$35.00	O/S MISSING	70.00	35.00
1	FRONT STEERING WHEEL AIR BAG	ACTIVATED	1,985.00	1,985.00
2	REAR BUMPER REFLECTOR @\$115.00	O/S BROKEN	230.00	115.00
1	FRONT STEERING WHEEL AIR BAG SPIRAL SENSOR	ACTIVATED	295.00	295.00
1	REAR BUMPER INNER CENTER BRACKET	SERVICEABLE	35.00	-
1	REAR REINFORCEMENT	SERVICEABLE	545.00	-
1	FRONT AIR BAG IMPACT SENSOR	ACTIVATED	195.00	195.00
1	FRONT PASSENGER AIR BAG	ACTIVATED	1,680.00	1,680.00
1	REAR UPPER SPEAKER TRAY	SERVICEABLE	1,778.00	-
1	FRONT AIR BAG ECU (MODULE)	ACTIVATED	1,290.00	1,290.00
1	REAR EXHAUST	SERVICEABLE	1,280.00	-
2	FRONT SEAT BELT @\$1230.00	ACTIVATED	2,460.00	2,460.00
1	REAR EXHAUST PIPE	SERVICEABLE	1,448.00	-
2	FRONT SEAT BELT BUCKLE @\$968.00	SERVICEABLE	1,936.00	-
1	REAR EXHAUST HEAT SHIELD	SERVICEABLE	195.00	-
1	FRONT WINDSCREEN GLASS	CRACKED	1,230.00	1,230.00
2	REAR EXHAUST MOUNTING @\$85.00	SERVICEABLE	130.00	-
1	FRONT WINDSCREEN GLASS MOULDING	NECESSARY	198.00	198.00
	LESS 20% DISCOUNT		-14,293.40	-5,510.00
			57,173.60	22,040.00
	<u>SPECIAL NETT ITEMS</u>			
4	RIM @\$500.00 (SN)	BENT (1 PCS ONLY)	2,000.00	300.00
4	TYRE @\$400.00 (SN)	DEFORMED (1 PCS ONLY)	1,600.00	100.00
4	WHEEL HUP CAP @\$125.00 (SN)	DEFORMED (1 PCS ONLY)	500.00	125.00

Report Ref No. CC4/LPC19018826/R1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR REVERSE SENSOR (SN)	SERVICEABLE	280.00	-
1	SEALANT (SN)	NECESSARY	120.00	60.00
1	PHV DECAL STICKER (SN)	NECESSARY	20.00	20.00
1	IU BRACKET (SN)	NOT NECESSARY	30.00	-
1	ERP BRACKET (SN)	NECESSARY	30.00	30.00
			4,580.00	635.00
	LABOUR			
	TO REMOVE & REFOCUS FRONT HEADLAMP .		100.00	30.00
	TO PLACE VEHICLE INTO WORKBEACH .	NOT NECESSARY	350.00	-
	TO CONDUCT WHEEL ALIGNMENT .		120.00	60.00
	TO DROP FRONT UNDERCARRIAGE PARTS & REMOVE & REPLACED NECESSARY PARTS.		350.00	150.00
	TO DROP REAR UNDERCARRIAGE PARTS ,TO REMOVE & REPLACED NECESSARY PARTS .	NOT NECESSARY	350.00	-
	TO REMOVE & REPLACED TYRE & RIM .		100.00	50.00
	TO CONDUCT WHEEL BALANCING .		100.00	50.00
	TO REMOVE & TRANSFER DOOR MECHANISM TO THE NEW DOOR .		400.00	80.00
	TO REMOVE & REPLACED REAR REVERSE SENSOR .		120.00	60.00
	TO REMOVE & REFIX REAR EXHAUST SILENCER & PIPING .	NOT NECESSARY	150.00	-
	TO REMOVE & REPLACED FRONT & REAR WINDSCREEN GLASS & TEST WATER .		400.00	240.00
	TO REMOVE & REFIX FUEL TANK TO FACILITATE CHANGING OF SPARE TYRE FLOOR PARTS.	NOT NECESSARY	250.00	-
	TO CONDUCT CHASSIS ALIGNMENT .		150.00	100.00
	TO REMOVE & REFIT REAR INNER TRIMMINGS ,GARNISHES,ROOF LINING ,SEATS & FLOOR BOARD PERFORMING INTERIOR CLEANING.		200.00	100.00
	TO APPLY RUSTPROOFING & TUFFCOATING TREATMENT.		280.00	160.00
	TO REMOVE & REPLACED DASH BOARD TO ASSIST AC REPAIR .		340.00	150.00
	TO REMOVE & REPLACED AIRBAG & SRS.		340.00	150.00
	TO RESET AIR BAG WARNING LIGHT .		120.00	60.00

Report Ref No. CC4/LPC19018826/R1pa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO KNOCKING & PANEL BEATING.INCLUSIVE OF THE REPAIR OF REAR SPARE TYRE PANEL,REAR CHASSIS LHS AND FRONT DOOR LHS.		5,800.00	1,800.00
	TO PUTTY & SPRAY PAINT ON THE AFFECTED AREAS .		3,800.00	1,800.00
	TOWING FEE.		100.00	60.00
			13,920.00	5,100.00
GRAND TOTAL			75,673.60	27,775.00
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				18,000.00

Report Ref No. CC4/LPC19018826/R1pa3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLN 7916X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

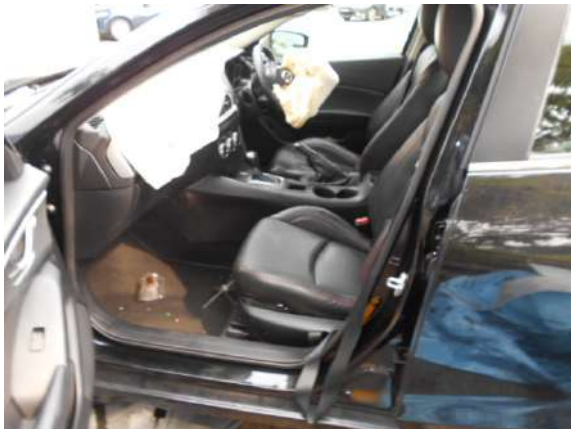



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLN 7916X

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

