

Sng Ah Tee Motor Pte Ltd
Blk 3 Pioneer Road North, #01-18,
628457

Insurer Reference:
Repairer Reference: SGV5800B -TP-CHINA
Date calculated: 04/11/2019 3:09 PM

Full Report
Registration: SGV5800B
Printed: 04/11/2019 3:09 PM

Summary Information

Claim

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	DARREN SNG	Currency:	SGD
Claim Reference:		Date of Incident:	25/10/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

[Handwritten signature]
7/11/2019

Vehicle Details

Vehicle				
Manufacturer:	HONDA	<i>Stevie (LKK)</i>	<i>WTL</i>	<i>7/11/19, 3.07 PM</i>
Model:	FIT	<i>83228813</i>	<i>5 day</i>	
Sub Model:	BASE MODEL		<i>L/S</i>	
Model Sheet Number:	35 50 01		<i>RJ AL SM</i>	
Registration:	SGV5800B			
VIN number:				
Odometer:				
Model Specs				
FROM MODEL 2007	FOG LAMPS	WHEELS 6J X 15 ALLOY	TWO COAT METALLIC	
PREPARE OFF VEHICLE				


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
 Date of Inspection:

Damage Areas

All
 Underbody

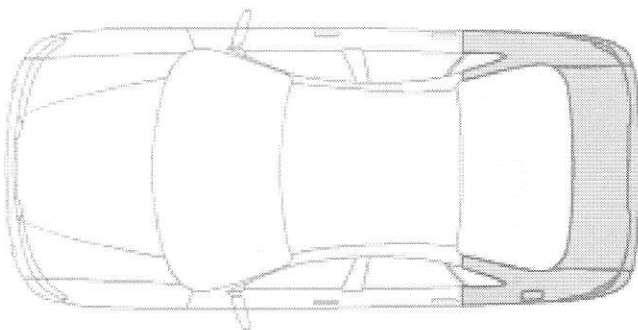

Labour

Time Base 10 WU/h

Price = 42.00 SGD/h

Code	Description	WU	Price SGD
NO NUMBER	RENEW REAR NUMBER PLATE (REMOVED)	2.0	8.40
8111D1	R + R REAR BUMPER	2.0	8.40
8111A5)	R + R REAR BUMPER (REMOVED)	1.0	4.20
8111B8)	R + R LEFT REAR OUTER BUMPER BRACKET	1.0	4.20
8111B9)	R + R RIGHT REAR OUTER BUMPER BRACKET	1.0	4.20
714125)	R + R L/TAILLAMP	2.0	8.40
714135)	R + R R/TAILLAMP	2.0	8.40
823380	R + R TAILGATE	2.0	8.40
823100)	RENEW TAILGATE (REMOVED)	39.0	163.80
8391A0	INCLUDES: R + R REAR WINDOW, REAR WIPER,	3.0	12.60
8231A9	REAR WIPER MOTOR, LOCK, NUMBER PLATE	2.0	8.40
NO NUMBER	LAMPS AND TAILGATE TRIMS	30.0	126.00
848140	R + R TAILGATE SEAL	1.0	4.20
8481A5	R + R TAILGATE LOCK STRIKER	2.0	8.40
8571C8)	RENEW REAR END PANEL CPL	2.0	8.40
8571C9)	R + R REAR END PANEL TRIM	2.0	8.40
3481	R + R BOOT FLOOR CARPET	5.0*	21.00
3482	R + R L/LOAD COMPARTMENT TRIM	5.0*	21.00
	R/R WING REPAIR		
	R/R WING REPAIR		
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	10.40	104.0
	Total of Labour		436.80

Paint	SYSTEM AZT	Time Basis 10 WU/h	WU	Price SGD
Paint Work				
Code	Description - TWO COAT METALLIC			
	REAR PANEL CPL NEW PART PAINTING		19.0	
	BOOTLID/TAILGATE NEW PART PAINTING		13.0	
	REAR BUMPER NEW PART PAINT K1N		14.0	
	L/R WING REPAIR PAINTING >50%		21.0	
	R/R WING REPAIR PAINTING >50%		21.0	
	BOOTFLOOR CPL SURFACE PAINT		8.0	

Paint Material Per Part	Description	Price SGD
Code		
2711	REAR PANEL CPL NEW PART PAINTING	21.0
2931	BOOTLID/TAILGATE NEW PART PAINTING	3.0
2583	REAR BUMPER NEW PART PAINT K1N	6.0
3481	L/R WING REPAIR PAINTING >50%	2.0
3482	R/R WING REPAIR PAINTING >50%	2.0
3900	BOOTFLOOR CPL SURFACE PAINT	2.0

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			96.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	12.90	129.0	541.80

Material Cost - Paint		Price SGD
New Part Painting		54.96
New Part Painting - Plastic K1N		61.82
Repair Painting		52.94
Surface-/Blend Paint		23.16
Material-constant Metal Preparation		28.60
Material-constant Plastic		12.70
Total		234.18

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Supplier	Price SGD
2583	REAR BUMPER	04715SAA900ZZ	DD	140.00
2619	L/R BUMPER BRACKET	71598SAA013	BR	9.00
2620	R/R BUMPER BRACKET	71593SAA013	BR	9.00
2702	REAR NUMBER PLATE	KNPL6 X NN		0.00
2711	REAR PANEL CPL	66100SAA300ZZ	DD (photo Dsrndk)	195.00
2931	BOOTLID/TAILGATE	68100SAAQ20ZZ	DD	420.00
2944	BOOT/TAILGATE SEAL	74440SAA023	TN	38.00
2953	L/TAILGATE HINGE	68210SAA000ZZ	X	18.00
2954	R/TAILGATE HINGE	68210SAA000ZZ	X	18.00
2977	BOOT/TAILGATE LOCK	74801SAAE21	BT	75.00
3015	BADGE HONDA	75701SAA003	X BR NN	12.00
3019	BADGE	75717SAGH01ZB	BR	18.00
3160	REAR SCREEN BOND KIT	08CRCX016N0	NR	0.00
3161	REAR SCREEN SEAL	04733SAA000	NR	30.00
3163	REAR SCREEN FIX SET	USE SINGLE PARTS	NR	
3170	REAR SCREEN CLAMPS	91536SS0J01	NR	0.00
3171	REAR SCREEN SPACER	91501S70003	NR	0.00
3172	REAR SCREEN CLAMPS	91502S70003	NR	0.00
3281	L/R LAMP	33551SAA003	X NN	110.00
3282	R/R LAMP	33501SAA003	BR	110.00
4985	END PANEL TRIM	84640SAET01ZA	CVT	28.00
f: OEM Parts	Savings			0.00
n: Non-OEM Parts	Subtotal			1,230.00
u: Used parts	Fixed Sundry Parts Price			100.00
	Total			1,330.00

Extras

Code	Description	Price SGD
1000	REAR NUMBER PLATE - X	35.00*
1001	REAR REVERSE SENSOR - / SKL	180.00*
1002	REAR WINDSCREEN SEALANT - / NR	40.00*
1003	TO CHECK WIRING - / NR	30.00*

Code
1004

Description
APPLY ANTI RUST COATING
Total Extras

Price SGD
120.00*
405.00

Final Calculation

	SGD	SGD
Parts		
Fixed Sundry Parts Price	1,230.00	
Total Parts	100.00	1,330.00
Labour Time Base 10 WU/h		
Total 104.0 WU X 42.00 SGD/h		
Total of Labour	436.80	436.80
Total Of Extras		405.00
Paint Work Time Base 10 WU/h		
Labour Cost 129.0 WU X 42.00 SGD/h		
Material Cost	541.80	
Total Paint Including Material	234.18	775.98
Repair Cost Excludes GST		2,947.78
GST (+7.0%)		206.34
Repair Cost Included GST		3,154.12

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed **and** is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:


Date:

ASSIGNMENT

From: _____ Date: 7/11/2019
 Estimated Cost: _____
 OD: TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: SGV 5800B
 at Workshop m/s: Sng Ah Tee
 of Blk 3 Pioneer Road north # 01-18
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: 3pm - 4pm

Veh No: SGV 5800B Yr Regn: 20/6/07
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Honda Fit c.c. 1339
 Colour: Black A/C: Insured / Std / NI / NA
 Sp. Reading: 219216 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: GD 12388757 *
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or _____
 Brake: In order / Jammed / Leaked / Burnt or _____
 Modi: Nil / S/Rim / STD A/Rim or _____
 Tyre Size: F: 185/60R15
 R: 4

(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

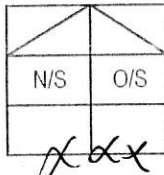

Bal. or Market Value: _____
 IDAC Accident Rport: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lum Sum: _____ % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS lump
 Date: _____ Person Contacted: _____
 Vehicle: IN / OUT

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or _____
 Front _____ Rear _____
 R/Bal. 5 mm R/Bal. 5 mm
 L/Bal. 5 mm L/Bal. 5 mm
 D.O.A. 25/10/19 D.O.I. 7/11/19
 Survey held at Sng Ah Tee
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or _____
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
	MV - 18,000
	PV - 13,372
	NV - 4628
	<u>lump sum \$2100, 5 days (Red: 84778; 28%)</u>

Date/Time, File Pass to? : Preli. Report
 : Final Report
 Date/Time, File Return to?
 Report Format: TP
 Lump: 2100

Days Of Repair: 5
 Resurvey No. of Trip: _____
 Add Fee: : Site Insp (\$) : Interview (\$) : Tech. Invs (\$) : Weekend (\$)

Survey Fee: _____
 Transportation: _____
 S+PS, SI _____
 Photos _____
 Others _____
 TOTAL: _____