

**Jin Auto Services Pte Ltd**  
**#01-410/412, 14 Defu Lane 10**  
**539195**

**Insurer Reference: SNM19D205009.**

**Repairer Reference: SKL888L**

**DMPCSN30383419000**

**Date calculated: 07/11/2019 12:07 PM**

**Full Report**  
**Registration: SKL888L**

**Printed: 07/11/2019 12:07 PM**

**Summary Information**

---

**Claim**

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	JOUIS SEOW	Currency:	SGD
Claim Reference:	SNM19D205009.	Date of Incident:	16/10/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

**Vehicle Details**

---

**Vehicle**

Manufacturer:	LEXUS
Model:	GS 250
Sub Model:	BASE MODEL
Model Sheet Number:	24 10 95
Registration:	SKL888L
VIN number:	JTHBF1BL905005977
Odometer:	

**Model Specs**

FROM 01/2012	FOG LAMPS	TRIM F SPORT	2.5 LTR 153/154KW
WHEELS 9J/10JX19 ALU	ALL WHEEL DRIVE(4X4)	PREPARE OFF VEHICLE	TWO COAT PEARL/MICA

**Vehicle Condition**

---


**Vehicle Status**

Pre-Accident Damage:

Date of Inspection:

**Damage Areas**

All ☐  
Underbody ☐

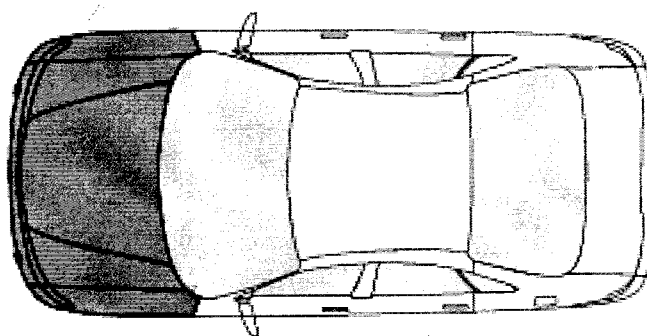

**Labour**

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
B020	RENEW FRONT BUMPER INCLUDES: R + R FRONT BUMPER, RADIATOR GRILLE AND NECESSARY ATTACHED PARTS	19.0		79.80
B020)	RENEW FRONT BUMPER REINFORCEMENT	5.0		21.00
B110	RENEW L/FRT WING (FRONT BUMPER, LEFT HEADLAMP ASSY AND L/SILL MOULDING REMOVED) INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R.	6.0		25.20
B110	RENEW R/FRT WING (FRONT BUMPER, RIGHT HEADLAMP ASSY AND R/SILL MOULDING REMOVED) INCLUDES: WHEELHOUSE LINER AND REQUIRED ATTACHED PARTS R + R.	6.0		25.20
B131)	RENEW LEFT FRONT PANEL	5.0		21.00
B131)	RENEW RIGHT FRONT PANEL	5.0		21.00
B100	R + R LEFT SILL RAIL	3.0		12.60
B100	R + R RIGHT SILL RAIL	3.0		12.60
B040)	R + R HEADLAMP (ADD)	3.0		12.60
B040)	R + R LEFT FRONT HEADLAMP (FRONT BUMPER REMOVED)	1.0		4.20
B040)	R + R RIGHT HEADLAMP (FRONT BUMPER REMOVED)	1.0		4.20
B070	RENEW BONNET INCLUDES: ASS ATTACHED PARTS AND IF NECE RENEW	7.0		29.40
B125	R + R FRONT LOCK CARRIER	3.0		12.60
M020)	R + R RADIATOR	5.0		21.00
M010	CONDENSER AND ADD RADIATOR R + R INCLUDES: REFILL COOLANT	10.0		42.00
420018)	R + R L/FRONT WHEEL	2.0		8.40
420018)	R + R R/FRONT WHEEL	2.0		8.40
420091A)	R + R L/F TYRE AND WHEEL	3.0		12.60
420091A)	R + R R/F TYRE AND WHEEL	3.0		12.60
4465	CONDENSER CPL CHECK			
7761	RADIATOR CPL CHECK			
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>	
<b>Panel / Mechanical Labour</b>		<b>9.20</b>	<b>92.0</b>	<b>386.40</b>
<b>Total of Labour</b>				<b>386.40</b>

**Paint**

Paint Work		SYSTEM AZT		Time Basis 10 WU/h	
Code	Description - TWO COAT PEARL/MICA			WU	Price SGD
	LOCK CARRIER STRUT SURFACE PAINT			4.0	
	FRT LOCK CARRIER SURFACE PAINT			4.0	
	L/F PANEL SURFACE PAINT			4.0	
	R/F PANEL SURFACE PAINT			4.0	
	FRONT BUMPER NEW PART PAINT K1R			12.0	

Code	Description - TWO COAT PEARL/MICA	WU	Price SGD
	FRT BUMPER TRIM CAP NEW PART PAINT K1R	3.0	
	BONNET REPAIR PAINTING >50%	42.0	
	L/F WING REPAIR PAINTING >50%	17.0	
	R/F WING REPAIR PAINTING >50%	17.0	

## Paint Material Per Part

Code	Description	Price SGD
0988	LOCK CARRIER STRUT SURFACE PAINT	0.75
1017	FRT LOCK CARRIER SURFACE PAINT	4.48
1187	L/F PANEL SURFACE PAINT	1.25
1188	R/F PANEL SURFACE PAINT	1.25
0283	FRONT BUMPER NEW PART PAINT K1R	61.01
0299	FRT BUMPER TRIM CAP NEW PART PAINT K1R	0.49
0471	BONNET REPAIR PAINTING >50%	70.71
0741	L/F WING REPAIR PAINTING >50%	16.99
0742	R/F WING REPAIR PAINTING >50%	16.99

## Labour Cost - Paint

	Hrs	WU	Price SGD
Factor	42.00 SGD/h		
Time Paint		107.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
<b>Total</b>	<b>10 WU/h</b>	<b>13.70</b>	<b>137.0</b>

## Material Cost - Paint

	Price SGD
New Part Painting - Plastic K1R	61.50
Repair Painting	104.69
Surface-/Blend Paint	7.73
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
<b>Total</b>	<b>211.52</b>

## Spare Parts

Code	Description	Part Number	Supplier	prices as at 2015-06-01	Price SGD
0257	FRONT NUMBER PLATE	KNPL3	✓ OR		35.00
0258	FRT NO PLATE REINF	KNPL0	X		0.00
0260	FRT NO PLATE BRKT	52114 30230	X NF		35.00
0283	FRONT BUMPER	52119 3A933	✓ OR		300.00
0299	FRT BUMPER TRIM CAP	52129 30911	X		10.00
0321	L/INN BUMPER BRACKET	52116 30090	X		12.00
0322	R/INN BUMPER BRACKET	52115 30140	X		12.00
0323	L/F BUMPER SUPPORT	52536 30220	✓ OR		33.00
0324	R/F BUMPER SUPPORT	52535 30230	✓ OR		33.00
0325	L/F OUT BUMPER BRKT	52116 30100	X		23.00
0326	R/F BUMPER OUT BRKT	52115 30150	X		23.00
0340	FRT BUMPER REINF	52131 30300	X		135.00

Code	Description	Part Number	Supplier	Price SGD
0344	FRT IMPACT ABSORBER	52611 30420	X NF	42.00
0410	GRILLE	53111 30E00	/ BR	290.00
0412	CTR BUMPER GRILLE	53112 30380	/ BR	60.00
0420	RADIATOR GRILLE TRIM	52711 30270	/ BR	140.00
0431	GRILLE BADGE	90975 02125	X NF	145.00
0471	BONNET	53301 30491	/ CR4	800.00
0481	BONNET INSULATION	53341 30310	/ CR4	0.00
0493	BONNET LOCK	53510 30360	/ DT	55.00
0502	BONNET LOCK COVER	53525 30080	/ BR	28.00
0561	LEFT HEADLAMP ASSY	81185 30G10	/ CUT	1,350.00
0562	RIGHT HEADLAMP ASSY	81145 30G10	/ CUT	1,350.00
0639	L/BUMPER GRILLE	53142 30100	X	22.00
0640	R/BUMPER GRILLE	53141 30260	X	22.00
0741	L/F WING	53802 30A30	X R	350.00
0742	R/F WING	53801 30A40	X R	350.00
0839	L/F WIND DEFLECTOR	53852 30110	X	45.00
0840	R/F WIND DEFLECTOR	53851 30110	X	45.00
0841	L/WHEELHOUSE SHELL	53806 30203	/ TN	120.00
0842	R/WHEELHOUSE SHELL	53805 30203	/ TN	120.00
0845	L/W-HOUSE AIR DEFL	53286 30130	X	88.00
0846	R/W-HOUSE AIR DEFL	53285 30120	/ TN (Cow/ panel rubber)	88.00
0988	LOCK CARRIER STRUT	53217 30903	X	36.00
1015	UPPER AIR GUIDE	53295 30100	X	120.00
1017	FRT LOCK CARRIER	53216 30261	X	125.00
1169	L/RADIATOR AIR GUIDE	53154 30190	X	48.00
1170	R/RADIATOR AIR GUIDE	53153 30200	X	48.00
1187	L/F PANEL	53203 30130	X	130.00
1188	R/F PANEL	53202 30122	X	130.00
7201	L/F WHEEL	42611 30F60	X	0.00
7202	R/F WHEEL	42611 30F60	/ DT	(m Air) 0.00
7227	L/F TYRE	225/50 R17 .. W	/ TN	(m Air) 0.00
1000	engine top cover	engine topcover	/ BR	(m Air) 0.00

f: OEM Parts  
n: Non-OEM Parts  
u: Used parts

<b>Savings</b>	0.00
<b>Subtotal</b>	6,798.00
<b>Fixed Sundry Parts Price</b>	100.00
<b>Total</b>	6,898.00

## Final Calculation

	SGD	SGD
<b>Parts</b>	6,798.00	
Fixed Sundry Parts Price	100.00	
<b>Total Parts</b>		<b>6,898.00</b>
<b>Labour Time Base 10 WU/h</b>		
Total 92.0 WU X 42.00 SGD/h	386.40	
<b>Total of Labour</b>		<b>386.40</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 137.0 WU X 42.00 SGD/h	575.40	
Material Cost	211.52	
<b>Total Paint Including Material</b>		<b>786.92</b>
<b>Repair Cost Excludes GST</b>		<b>8,071.32</b>
GST (+7.00%)		<b>564.99</b>
<b>Repair Cost Included GST</b>		<b>8,636.31</b>

### Comments

- \* - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
- ) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

11/11/19, 4.30pm  
Steve CLKK) 00 - not Authorize (Remit)  
83228813 Excess - \$500  
L/S  
Ry AFL spy  
4 days