



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

NTUC INCOME INSURANCE CO-OPERATIVE LTD INV No. AC2003747
73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSE
SINGAPORE 189556
ATTN: ENG HUEY HUEY

INV Date 08/05/2020
Reference CS/INC19020490/Gtd3n2
Code INC



PROFESSIONAL SERVICE FEE

Vehicle No. SJT 961C
Insured Veh. SLU 7891X
Claim No. MT/1072031-001
Policy No.
Accident Date 15/11/2019
Inspection Date 19/11/2019

Description	Total
Damage Assessment	250.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	250.00
GST (7%)	17.50
Grand Total	267.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

DAMAGE ASSESSMENT REPORT

NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: CS/INC19020490/Gtd3n2

73 BRAS BASAH ROAD
#05-01 NTUC TRADE UNION HOUSESINGAPORE
189556

Date: 08-05-2020



ATTN: ENG HUEY HUEY

Code: INC

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SLU 7891X	Veh. Inspected	SJT 961C
Policy No.		Coverage (\$)	0.00
Claim No.	MT/1072031-001	Excess (\$)	0.00
Assign From	HAZALYSA BINTI IBRAHIM	Assign Date	19/11/2019

2. Vehicle Particulars & Condition

Make & Model	TOYOTA VIOS G	c.c	1497
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	MR053HY9305131790	Colour	BLUE
Odometer	198355 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	185/60 R15	YOKOHAMA	5 mm
L/H Front Tyre	185/60 R15	YOKOHAMA	5 mm
R/H Rear Tyre	185/60 R15	YOKOHAMA	5 mm
L/H Rear Tyre	185/60 R15	YOKOHAMA	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	15/11/2019	Inspect Date / Time	19/11/2019 (12:00 PM)
Survey held at	WORKSHOP 99 AUTO SERVICES BLK 9 SIN MING ROAD #01-34 SIN MING INDUSTRIAL ESTATE SINGAPORE 575644		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	6 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 961C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOT LID	BUCKLED	486.90	486.90
2	BOOT LID HINGES @\$65.00	O/S BENT / N/S NOT NECESSARY	130.00	65.00
1	BOOT LID RUBBER	TWISTED	42.90	42.90
1	BOOT LID HANDLE GARNISH	DEFORMED	181.60	181.60
2	LICENCE LAMPS @\$85.90	NOT NECESSARY	171.80	-
1	BOOT LID INNER LOCK TOP	BENT	88.50	88.50
1	BOOT LID INNER LOCK BOTTOM	NOT NECESSARY	22.30	-
1	BOOT LID NAME PLATE "VIOS"	NECESSARY	28.60	28.60
1	BOOT LID NAME PLATE "G"	NECESSARY	33.00	33.00
1	BOOT LID "TOYOTA" LOGO	NECESSARY	28.90	28.90
1	O/S REAR FENDER	TO REPAIR SEE LABOUR	688.60	-
1	O/S REAR FENDER INNER TRIM COVER	NOT NECESSARY	186.90	-
1	O/S REAR FENDER INNER SHIELD	NOT NECESSARY	36.90	-
1	REAR BUMPER FASCIA	DEFORMED	285.90	285.90
2	REAR BUMPER REFLECTORS @\$75.00	CRACKED	150.00	150.00
2	REAR BUMPER SIDE RETAINERS @\$28.90	DEFORMED	57.80	57.80
2	REAR BUMPER BRACKETS @\$56.60	NOT NECESSARY	113.20	-
1	SET REAR BUMPER CLIPS	NECESSARY	35.00	35.00
2	REAR LAMPS ASSY @\$180.95	CRACKED	361.90	361.90
2	REAR LAMP PANELS @\$92.70	TO REPAIR SEE LABOUR	185.40	-
1	REAR PANEL	BUCKLED	666.95	666.95
1	REAR PANEL INNER TRIM COVER	DEFORMED	109.55	109.55
1	REAR BOOT FLOOR PANEL	TO REPAIR SEE LABOUR	599.65	-
1	SPARE TYRE TOP HARDBOARD	CUT	65.70	65.70
2	BOOT SIDE ENERGY SPONGE	NOT NECESSARY	154.80	-
1	BOOT REAR ENERGY SPONGE	NOT NECESSARY	87.00	-
1	REAR EXHAUST PIPE	BENT	465.90	465.90
1	CENTRE EXHAUST BOX	NOT NECESSARY	1,055.95	-

Report Ref No. CS/INC19020490/Gtd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	EXHAUST MOUNTINGS @\$125.90	NOT NECESSARY	251.80	-
1	O/S FRONT SEAT RECLINING GEAR }	NOT NECESSARY	958.00	-
1	O/S FRONT SEAT SLIDING RAILING }	NOT NECESSARY	-	-
	LESS 25% DISCOUNT		-1,932.85	-788.53
			5,798.55	2,365.57
	<u>SPECIAL NETT ITEMS</u>			
1	REAR NOS PLATE (SN)	CUT	50.00	40.00
1	SET REVERSE SENSORS (SN)	DAMAGED	230.00	200.00
1	REAR WINDSCREEN GLASS SEALANT (SN)	NOT NECESSARY	80.00	-
			360.00	240.00
	<u>LABOUR</u>			
	TO REMOVE LAMPS,NECESSARY WIRINGS AND ELECTRICAL FITTINGS TO ENABLE NECESSARY REPAIRS,CHECK,REPLACE DAMAGED LAMPS,REFIT SAME.		50.00	30.00
	TO REMOVE O/S FRONT SEAT,CHECK,REPAIR AND ALIGN SEAT FRAME,REPLACE SLIDING RAIL AND RECLINING GEAR ASSY,REFIT SAME.	NOT NECESSARY	280.00	-
	TO REMOVE REAR EXHAUST PIPE AND SILENCER ASSY,CHECK,REPLACE SAME WITH MOUNTING AND REFIT.		150.00	150.00
	TO REMOVE REAR WINDSCREEN GLASS ASSY,TO ENABLE NECESSARY REPAIRS,CHECK,REFIT GLASS ASSY.(BONDED TYPE WINDSCREEN GLASS).	NOT NECESSARY	180.00	-
	TO REMOVE REAR SEATS AND BACKREST,REAR PARCEL TRAY,GARNISHES AND NECESSARY INTERIOR UPHOLSTERY TO ENABLE REPAIR AND REPLACE OF PARTS,REFIT SAME.		180.00	80.00
	TO REMOVE DAMAGED PARTS,JACK AND CUT OUT DAMAGED BODY PANELS,JACK OUT,STRAIGHTEN UP DAMAGED BODY PANELS AND REPAIR BODY PARTS AND FITTINGS,WHICHEVER POSSIBLE AND NECESSARY,REPLACE AND WELD NECESSARY DAMAGED PARTS,REFIT AND REALIGN WHICHEVER PARTS NECESSARY.INCLUSIVE OF THE REPAIR OF O/S REAR FENDER,REAR LAMP PANELS AND REAR BOOT FLOOR PANEL.		1,200.00	900.00

Report Ref No. CS/INC19020490/Gtd3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY PAINTING REPLACEMENT PARTS AND REPAINT DAMAGED SECTIONS WITH WELDED PORTIONS IN AND OUTSIDE.INCLUDING PUTTY.	NOT NECESSARY	1,000.00	1,000.00
	TO PERFORM A COMPUTERISE SYSTEMS CHECKING AFTER REMOVING OF NECESSARY WIRINGS AND ELECTRICAL FITTINGS TO ENABLE NECESSARY DIAGNOSTING AND RE-SETTING TO SPECIFICATIONS.		120.00	-
	TO RUST PROOFING DAMAGED PORTIONS AND REPLACEMENT PARTS.		120.00	60.00
			3,280.00	2,220.00
GRAND TOTAL			9,438.55	4,825.57
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION) (CONFIRMED)				3,850.00

Report Ref No. CS/INC19020490/Gtd3n2

XING GUO QIANG

M.MATAI, AMSAE-A

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE,
MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.