



Auto  
Consultants  
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Registration No. QX 234P

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	BONNET	1	BUCKLED	\$264.00	\$264.00	
1.2	BONNET HINGE RH	1	BENT	\$21.60	\$21.60	
1.3	BONNET HINGE LH	1	BENT	\$21.60	\$21.60	
1.4	BONNET HINGE GARNISH LH	1	DEFORMED	\$366.00	\$366.00	
1.5	WIPER PANEL GARNISH ASSY	1				
1.6	BONNET LOCK	1	BENT	\$48.00	\$48.00	
1.7	FRONT BUMPER	1	DISTORTED	\$180.00	\$180.00	
1.8	FRONT BUMPER LOWER GRILLE	1	DISTORTED	\$30.00	\$30.00	
1.9	FRONT BUMPER CLIPS	10	NECESSARY	\$1.20	\$12.00	
1.10	FRONT BUMPER RETAINER RH	1	DEFORMED	\$21.60	\$21.60	
1.11	FRONT BUMPER RETAINER LH	1	MISSING	\$21.60	\$21.60	
1.12	FOGLAMP COVER LH	1	MISSING	\$36.00	\$36.00	
1.13	FRONT BUMPER REINFORCEMENT	1	BENT	\$132.00	\$132.00	
1.14	HEADLAMP LH	1	DISTORTED	\$156.00	\$156.00	
1.15	LHF FENDER INNER SHIELD CLIPS	1	DISTORTED	\$48.00	\$48.00	
1.16	FENDER INNER SHIELD CLIPS	6	NECESSARY	\$1.20	\$7.20	
1.17	LHF WHEEL HOUSE	1	DISTORTED	\$156.00	\$156.00	
1.18	FRONT SUPPORT PANEL ASSY	1	BENT	\$216.00	\$216.00	
1.19	BRACE PANEL	1	NOT NECESSARY	\$33.60		
1.20	LHF FENDER	1	DISTORTED	\$144.00	\$144.00	
1.21	RHF FENDER	1	REPAIR	\$144.00		
1.22	RADIATOR TOP BRACKET LH	1	BENT	\$14.40	\$14.40	
1.23	RADIATOR TOP BRACKET MOUNTING LH	1	TORN	\$6.00	6.00	
1.24	RADIATOR TOP BRACKET RH	1	BENT	\$14.40	\$14.40	
1.25	RADIATOR TOP BRACKET MOUNTING RH	1	TORN	\$6.00	\$6.00	

1.26	RADIATOR BOTTOM MOUNTING	2	TORN	\$14.40	\$28.80	
1.27	LHF FENDER SIDE PROTECTOR	1	MISSING	\$30.00	\$30.00	
1.28	CONDENSER	1	UNCONFIRM	\$300.00	\$300.00	
1.29	RADIATOR	1	UNCONFIRM	\$180.00	\$180.00	
1.30	AIR CLEANER TOP	1	UNCONFIRM	\$276.00	\$276.00	
1.31	AIR CLEANER BOTTOM	1				
1.32	AIR CLEANER INLET 1 17751-37060	1	DEFORMED	\$18.00	\$18.00	
1.33	AIR CLEANER INLET 2 17552-37070	1	DEFORMED	\$54.00	\$54.00	
1.34	AIR RESONATOR 17893-22030	1	UNCONFIRM	\$78.00	\$78.00	
1.35	FUSE BOX ASSY	1	UNCONFIRM	\$81.60	\$81.60	
1.36	FUSE BOX TOP COVER	1	DEFORMED	\$48.00	\$48.00	
1.37	FUSE BOTTOM COVER	1	DEFORMED	\$36.00	\$36.00	
1.38	LHF DOOR	1	BENT	\$432.00	\$432.00	
1.39	LHF DOOR HINGE TOP	1	BENT	\$33.60	\$33.60	
1.40	LHF DOOR HINGE BOTTOM	1	BENT	\$33.60	\$33.60	
1.41	LHF DOOR CHECKER	1	NOT NECESSARY	\$57.60		
1.42	LHF DOOR BLACK STICKER	1	NECESSARY	\$30.00	\$30.00	
1.43	LHF DOOR PROTECTOR WITH CHROME	1	NECESSARY	\$55.20	\$55.20	
1.44	ANTI ROLL BAR	1	UNCONFIRM	\$126.00	\$126.00	
1.45	LHF SHOCK ABSORBER	1	BENT	\$132.00	\$132.00	
1.46	LHF LOWER ARM	1	BENT	\$78.00	\$78.00	
1.47	LHF LOWER ARM BALL JOINT	1	BENT	\$66.00	\$66.00	
1.48	LHF KNUCKLE	1	BENT	\$156.00	\$156.00	
1.49	LHF WHEEL BEARING ASSY	1	NECESSARY	\$36.00	\$36.00	
1.50	LHF TIE ROD	1	UNCONFIRM	\$90.00	\$90.00	
1.51	LHF TIE ROD END	1	UNCONFIRM	\$45.60	\$45.60	
1.52	LHF ANTI ROLL BAR LINK	1	BENT	\$66.00	\$66.00	
1.53	LHF BRAKE PIPE ASSY	1	UNCONFIRM	\$57.60	\$57.60	
1.54	LHF ABS SENSOR	1	UNCONFIRM	\$156.00	\$156.00	
1.55	LHF DRIVE SHAFT	1	UNCONFIRM	\$516.00	\$516.00	
1.56	LHF SPORT RIM 15"	1	CUT	\$480.00	\$480.00	
1.57	LHF TYRE 195/65/15 SOR 5B CAT A	1	PUNCTURE	\$125.23	\$125.23	
1.58	FRONT GRILLE ASSY	1	DEFORMED	\$108.00	\$108.00	
1.59	BATTERY TOP BRACKET	1	BENT	\$18.00	\$18.00	
1.60	BATTERY SOR 5A 12V65AH	1	DAMAGED	\$112.93	\$112.93	
1.61	LH SIDE SKIRT	1	UNCONFIRM	\$252.00	\$252.00	
1.62	ENGINE UNDER COVER ASSY	1	TORN	\$207.60	\$207.60	
1.63	FRONT WINDSCREEN	1	CRACKED	\$360.00	\$360.00	
1.64	FRONT WINDSCREEN MOULDING	1	NECESSARY	\$48.00	\$48.00	
1.65	SEALANT	2	NECESSARY	\$24.00	\$48.00	

1.66	INNER SEAL TAPE	1	NECESSARY	\$36.00	\$36.00	
1.67	IU STICKER	1	NECESSARY	\$3.60	\$3.60	
1.68	WIRE HARDNESS	1	TORN			
<b>2</b>	<b>LABOUR</b>					
2.1	TO ALIGN,REPLACE RESPRAY BONNET AND HINGES					6
2.2	TO ALIGN,REPLACE AND RESPRAY SUPPORT PANEL					4
2.3	TO REPLACE AND RESPRAY FRONT BUMPER					5
2.4	TO ALIGN,REPLACE AND RESPRAY REINFORCEMENT					1
2.5	TO REMOVE AND REFIX ENGINE PARTS IN COMPARTMENT TO ASSIST WORK		UNCONFIRM			10
2.6	TO ALIGN,REPLACE AND REPSRAY RH/LH CHASSIS					6
2.7	TO REPLACE LHS WHEEL HOUSING					10
2.8	TO REPLACE AND RESPRAY LHF FENDER					4
2.9	TO REPLACE AND RESPRAY LHF DOOR					6
3.10	TO REPLACE FRONT UNDER CARRIAGE PARTS					4
3.11	TO PERFORM 4 WHEEL ALIGNMENT					1
3.12	TO REPLACE CONDENSER RADIATOR AND TOP UP A/C GAS					2
3.13	TO REPLACE AND RESPRAY RH FENDER					4
3.14	TO REPLACE AND RESPRAY LH SIDE SKIRT		UNCONFIRM			2
3.15	TO REPLACE FRONT WINDSCREEN					4
		<b>TOTAL PARTS COST</b>			<b>\$6,961.76</b>	
		<b>TOTAL MAN-HOUR</b>				<b>69</b>

Registration No. QX 234P

Registration No. QX 234P

Vehicle Inspected By



XING GUO QIANG  
*M.MATAI, AMSAE-A*  
*Automotive Assessor*



ADRIAN LING WAI PING  
*B.Eng, AMSOE, AMIRTE, AMSAE-A, M.MATAI*  
*Licensed Appraiser*

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.