Adjuster Report Page 1 of 4

#### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/III19020955/KGA3Q2

Date: 08/07/2020

**REFERENCE** 

Handling Insurer: India International Insurance Pte Ltd Policy No: MCOM0015 Claimant SMD7661X

Insured Vehicle No: SHC8603Y Vehicle No:

Date of Loss: TP 20/11/2019 Nature of Claim: Claim No: MCT19110502

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

SMD7661X Reg No:

Make & Model: TOYOTA VELLFIRE, 2.5 CVT (A) Engine No: 2ARJ117026 Reg. Date: 03/09/2018 (Man. Year: 2018) Chassis No: AGH300195759 Colour: Odometer: 88020 km Metallic Black

**Engine Capacity:** 2493 cc Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

**CONDITION OF VEHICLE AT THE TIME OF SURVEY** 

**General Condition:** Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: Pre-accident Condition:

**CONDITION OF TYRES** 

Front Tyre Size: 235/50 R18 235/50 R18 Rear Tyre Size: Rear Left Side: Front Left Side: West Lake 8 mm West Lake 9 mm Rear Right Side: Front Right Side: West Lake 9 mm West Lake 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,940.85	4,655.74	285.11	5.77
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,300.00	720.00	580.00	44.62
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	6,240.85	5,375.74	865.11	13.86
Approved Total (Overridden) (S\$)		4,300.00		
(S\$)	6,240.85	4,300.00	1,940.85	31.10
+ GST 7.00/7.00% (S\$)	436.86	301.00	135.86	31.10
Nett Amount (S\$)	6,677.71	4,601.00	2,076.71	31.10
Global Sum S	Settlement (S\$)	0.00		

**INSPECTION** 

Date of Assignment: 25/11/2019

Date Inspected: 25/11/2019 Inspected At: Hui Yang Motor Pte Ltd (HQ)

176 Sin Ming Drive #04-02, Sin Ming

AutoCare

Singapore 575721

Estimated Period of Repair: 3.0 days

Adjuster: KENNETH KONG Manager: Chong Pui Lin Adjuster Report Page 2 of 4

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Adjuster Report Page 3 of 4

# **REPAIR DETAILS**

Reference			
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 07 Jul 2020)	
Parts:	M1-MPV	TOYOTA VELLFIRE 2.5 CVT (A) (Catalogue:Merimen Singapore 1.0)	
Labour:	Repairer's	(Price-denominated Standard List)	
Print Code: (Unsubmitted, no print-code for SMD7661X)			
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page			
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.			

## **Recommended Parts**

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Cracked	1,812.50 FL	*1,614.20 FL
2	1		*FRONT BUMPER LH SIDE COVER WITH CHROME	Scratched	580.50 FL	*580.50 FL
3	1		*FRONT BUMPER LH SIDE RETAINER	Distorted	181.25 FL	*181.25 FL
4	1		*FRONT LH HEADLAMP	Mtg Cracked	3,831.70 FL	*3,831.70 FL
5	1		*FRONT LH HEADLAMP LOWER BRACKET	Repair	181.85 FL	*-FL
F=Fra	anchise	part. L=ListI	ItemDisc.			
				Sub Total (S\$)	6,587.80	6,207.65
- List Item Discount on L Items 25.00/25.00% (S\$)			1,646.95	1,551.91		
			ī	otal Parts (S\$)	4,940.85	4,655.74
	Report was unsubmitted during this print-out.					

Adjuster Report Page 4 of 4

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

#### Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount			
Lab	Labour Items						
1	WIRING	New	100.00	20.00			
2	SPRAY PAINTING	New	600.00	400.00			
3	LABOUR CHARGES	New	600.00	300.00			
		Gross Labour Cost (S\$)	1,300.00	720.00			
	R	eport was unsubmitted during this print-out.	_				

< END OF ESTIMATES >