

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/III19021131/KGA3Q2

Date: 17/07/2020

REFERENCE

Handling Insurer: India International Insurance Pte Ltd	Policy No:	MCOM0015
Claimant		
Vehicle No : SHC5941R	Insured Vehicle No :	SH7255T
Date of Loss: 27/11/2019	Nature of Claim: TP	Claim No: MCT19110690

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHC5941R		
Make & Model:	RENAULT LATITUDE, 2.0 L DCI AUTO D/AB 4DR (A)	Engine No:	M9R8839C002314
Reg. Date:	14/01/2015 (Man. Year: 2014)	Chassis No:	VF1ABL15AUC281234
Colour:	Metallic White/Red	Odometer:	461210 km
Engine Capacity:	1995 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/60 R16	Rear Tyre Size:	215/60 R16
Front Left Side:	Sailun 8 mm	Rear Left Side:	Sailun 8 mm
Front Right Side:	Sailun 8 mm	Rear Right Side:	Sailun 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	36,088.89	3,610.12	32,478.77	90.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	19,090.00	1,540.00	17,550.00	91.93
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	55,178.89	5,150.12	50,028.77	90.67
Approved Total (Overridden) (S\$)		4,100.00		
(S\$)	55,178.89	4,100.00	51,078.89	92.57
+ GST 7.00/7.00% (S\$)	3,862.52	287.00	3,575.52	92.57
Nett Amount (S\$)	59,041.41	4,387.00	54,654.41	92.57
+ Car Rental (6.0 x S\$122.64/day) (S\$)		735.84		
Nett Liability (S\$)		5,122.84		

INSPECTION

Date of Assignment:	28/11/2019	
Date Inspected:	28/11/2019	Inspected At:
		Trans-cab Auto Services Pte Ltd
		No 2 Ang Mo Kio Street 63
		Singapore 569111
Estimated Period of Repair:	4.0 days	

Adjuster: KENNETH KONG**Manager:** Chong Pui Lin

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 13 Apr 2020)
Parts:	143	RENAULT LATITUDE 2.0 L DCI AUTO D/AB 4DR (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SHC5941R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER COVER FRT	Buckled	747.20 FL	*747.20 FL
2	1		*BUMPER SPOILER FRT	Serviceable	344.70 FL	*- FL
3	1		*BUMPER ABSORBER FRT	Serviceable	394.68 FL	*- FL
4	1		*BUMPER RETAINER FRT RH	Distorted	101.40 FL	*101.40 FL
5	1		*BUMPER SUPPORT FRT	Serviceable	10.70 FL	*- FL
6	1		*BUMPER UNDERTRAY FRT	Serviceable	292.50 FL	*- FL
7	1		*BUMPER GRILLE LOWER FRT	Serviceable	147.00 FL	*- FL
8	1		*BUMPER FOG LAMP GRILLE RH	Serviceable	207.21 FL	*- FL
9	1		*BUMPER BEAM FRT	Repair	663.70 FL	*- FL
10	1		*HEADLAMP RH	Cracked	743.60 FL	*743.60 FL
11	1		*HEADLAMP HARNESS	Serviceable	928.29 FL	*- FL
12	1		*HEADLAMP PANEL FRT RH	Repair	128.30 FL	*- FL
13	1		*FENDER PANEL FRT RH	Bent	437.10 FL	*437.10 FL
14	1		*WHEELARCH FRT RH	Distorted	191.40 FL	*191.40 FL
15	1		*FENDER BRACKET FRT RH	Serviceable	106.40 FL	*- FL
16	1		*FENDER BRACKET LOWER RH	Serviceable	11.80 FL	*- FL
17	1		*FENDER INSULATOR RH	Serviceable	66.30 FL	*- FL
18	1		*CHASSIS PANEL FRT RH	Repair	592.90 FL	*- FL
19	1		*CHASSIS PANEL SUPPORT FRT RH	Repair	431.70 FL	*- FL
20	1		*FENDER PANEL INNER FRT RH L70Y	Repair	838.40 FL	*- FL
21	1		*FENDER PANEL SUPPORT FRT RH L70Y	Repair	432.00 FL	*- FL
22	1		*WHEEL HOUSING PANEL FRT RH	Repair	2,698.60 FL	*- FL
23	1		*TOW COVER FRT	Serviceable	60.90 FL	*- FL
24	1		*FRONT BRACE PANEL	Repair	177.22 FL	*- FL
25	1		*RADIATOR GRILLE	Serviceable	969.90 FL	*- FL
26	1		*RADIATOR GRILLE BADGE RENAULT	Serviceable	225.36 FL	*- FL
27	1		*RADIATOR GRILLE FRAME	Serviceable	686.00 FL	*- FL
28	1		*FRAME FULL SUPPORT PANEL	Serviceable	592.70 FL	*- FL
29	1		*FRAME FULL SUPPORT BRACKET	Repair	41.60 FL	*- FL
30	1		*BONNET	Repair	1,312.70 FL	*- FL
31	1		*BONNET INSULATOR	Serviceable	294.30 FL	*- FL
32	1		*BONNET STRUT RH	Serviceable	53.30 FL	*- FL
33	1		*BONNET HINGE RH	Repair	237.40 FL	*- FL
34	1		*BONNET LOCK	Repair	152.80 FL	*- FL
35	1		*BONNET CABLE	Serviceable	55.20 FL	*- FL
36	1		*BONNET CABLE COVER	Serviceable	80.60 FL	*- FL
37	1		*BONNET SEAL OUTER	Serviceable	83.20 FL	*- FL
38	1		*BONNET SEAL INNER	Serviceable	70.10 FL	*- FL
39	1		*LOWER ARM RH L70Y	Serviceable	192.70 FL	*- FL
40	1		*KNUCKLE ARM RH L70Y	Bent	481.50 FL	*481.50 FL
41	1		*ABSORBER FRT RH L70Y	Serviceable	203.50 FL	*- FL
42	1		*DRIVESHAFT RH	Serviceable	1,355.70 FL	*- FL
43	1		*STABILIZER BAR FRT	Serviceable	427.90 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
44	2		*STABILIZER LINK FRT	Serviceable	69.50 FL	*- FL
45	1		*STEERING PINION RACK L70Y	Serviceable	3,765.30 FL	*- FL
46	1		*WIPER RESERVOIR MOTOR	Serviceable	82.60 FL	*- FL
47	1		*WIPER RESERVOIR	Dented	179.60 FL	*179.60 FL
48	1		*WIPER RESERVOIR NECK	Serviceable	29.30 FL	*- FL
49	1		*SUBFRAME OUTER FRT	Serviceable	1,094.20 FL	*- FL
50	1		*SUBFRAME BRACKET OUTER LH	Serviceable	49.00 FL	*- FL
51	1		*SUBFRAME BRACKET OUTER RH	Serviceable	49.00 FL	*- FL
52	1		*DOOR PANEL FRT RH	Repair	2,844.66 FL	*- FL
53	1		*DOOR HINGE UPPER RH	Repair	261.28 FL	*- FL
54	1		*DOOR HINGE LOWER	Repair	300.55 FL	*- FL
55	1		*DOOR CHECK FRT RH	Serviceable	194.77 FL	*- FL
56	1		*DOOR WEATHERSTRIP FRT RH L70Y	Serviceable	410.27 FL	*- FL
57	1		*DOOR SEAL LOWER FRT RH L70Y	Serviceable	91.17 FL	*- FL
58	1		*DOOR SEAL FRT RH L70Y	Serviceable	72.82 FL	*- FL
59	1		*DOOR MOULDING FRT RH	Serviceable	176.82 FL	*- FL
60	1		*DOOR FINISHER FRONT RH	Serviceable	515.06 FL	*- FL
61	1		*DOOR GLASS RUNNER SEAL FRT RH L70Y	Serviceable	626.36 FL	*- FL
62	1		*DOOR MIRROR ASSY RH	Serviceable	1,483.40 FL	*- FL
63	1		*DOOR HANDLE OUTER FRT RH L70Y	Serviceable	477.76 FL	*- FL
64	1		*DOOR HANDLE CAP FRT RH L70Y	Serviceable	35.52 FL	*- FL
65	1		*DOOR WAIST SEAL OUTER FRT RH	Serviceable	291.27 FL	*- FL
66	1		*ROCKER PANEL INNER GARNISH RH	Serviceable	466.51 FL	*- FL
67	1		*ROCKER PANEL INNER RH	Repair	1,024.79 FL	*- FL
68	1		*ROCKER PANEL OUTER RH	Repair	1,184.99 FL	*- FL
69	1		*ROCKER PANEL CENTER RH	Repair	990.25 FL	*- FL
70	1		*DOOR HARNESS WIRE RH	Serviceable	2,670.00 FL	*- FL
71	1		*BUMPER CLIP FRT	Necessary	66.00 FS	*66.00 FS
72	1		*BUMPER BRACKET CLIP FRT RH	Not Necessary	12.00 FS	*- FS
73	1		*BUMPER SUPPORT CLIP FRT RH	Not Necessary	10.50 FS	*- FS
74	1		*BUMPER GRILLE LOWER CLIP	Not Necessary	69.00 FS	*- FS
75	1		*SET FRAME FULL SUPPORT PANEL CLIP	Not Necessary	70.00 FS	*- FS
76	2		*FRAME FULL SUPPORT PANEL NUT	Not Necessary	20.00 FS	*- FS
77	2		*FRAME FULL SUPPORT PANEL STUD	Not Necessary	30.00 FS	*- FS
78	1		*WHEELARCH CLIP FRT RH	Necessary	30.50 FS	*30.50 FS
79	1		*FRONT RIGHT TYRE (50%)	Cut	300.00 FS	*240.00 FS
80	1		*FRONT RIGHT TYRE RIM	Dented	380.00 FS	*380.00 FS
81	1		*SET FRONT LICENCE PLATE WITH HOLDER	Serviceable	80.00 FS	*- FS
82	1		*SET RADIATOR GRILLE SCREW	Not Necessary	16.00 FS	*- FS
83	1		*SET RADIATOR GRILLE FRAME CLIP	Not Necessary	52.00 FS	*- FS
84	1		*WINDSCREEN SEALANT	Not Necessary	109.20 FS	*- FS
85	1		*FRONT WINDSCREEN MOULDING	Not Necessary	120.00 FS	*- FS
86	1		*FRONT WINDSCREEN INNER SPONGE SEAL	Not Necessary	100.00 FS	*- FS
87	6		*BONNET INSULATOR CLIP L70Y	Not Necessary	7.30 FS	*- FS
88	2		*BONNET CABLE CLIP L70Y	Not Necessary	6.31 FS	*- FS
89	2		*BONNET CABLE COVER SCREW L70Y	Not Necessary	10.85 FS	*- FS
90	1		*FRONT DOOR ADVERTISEMENT STICKER	Necessary	300.00 FS	*150.00 FS
91	1		*FRONT RH FENDER ADVERTISEMENT STICKER	Necessary	300.00 FS	*150.00 FS
92	1		*DOOR CHECK BOLT	Not Necessary	22.69 FS	*- FS
93	1		*DOOR GUIDE SCREW	Not Necessary	10.85 FS	*- FS
94	1		*DOOR HINGE BOLT	Not Necessary	10.85 FS	*- FS
95	1		*DOOR HINGE NUT RH	Not Necessary	14.60 FS	*- FS
96	1		*DOOR CHECK NUT	Not Necessary	3.75 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 39,859.61 3,898.30
- List Item Discount on L Items 10.00/10.00% (\$\$) 3,770.72 288.18

Total Parts (\$\$) 36,088.89 3,610.12

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO TRANSFER OF FRONT WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR	New	170.00	0.00
2	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	30.00
3	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	7,500.00	660.00
4	TO TRANSFER OF FRONT FENDER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	New	170.00	0.00
5	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME	New	7,500.00	500.00
6	TO TRANSFER OF BONNET FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	New	170.00	0.00
7	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	20.00
8	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT	New	220.00	60.00
9	TO DISMANTLE AND REFIT FRONT END SUSPENSION UNDERCARRIAGE PARTS ,FINAL CHECKING AND TESTING	New	380.00	200.00
10	TO TRANSFER OF FRONT BUMPER FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	New	170.00	0.00
11	TO TRANSFER OF TIRE ,RIM AND ON WHEEL BALANCING	New	170.00	20.00
12	TOWING FEES	New	170.00	50.00
13	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH,FITTINGS AND OTHER ,TO ENABLE REPAIR	New	380.00	0.00
14	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR	New	380.00	0.00
15	TO CHECK ABS AND BRAKE EFFICIENCY ,FINAL CHECKING AND TESTING	New	380.00	0.00
16	TO TRANSFER OF FRONT DOOR FITTINGS ,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST	New	170.00	0.00
17	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK	New	380.00	0.00
18	TO REMOVE AND RENEW POWER STEERING PUMP ,OIL COOLER PIPE AND FINAL CHECKING AND TESTING	New	440.00	0.00
Gross Labour Cost (\$\$)			19,090.00	1,540.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >