

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC4/AIG19021251/GBA3N2

**Date:** 21/07/2020

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1800136521

**Claimant**  
**Vehicle No :** SHC1802K **Insured Vehicle No :** SMF5916P

Date of Loss: 30/11/2019 Nature of Claim: TP Claim No: 3547213274SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SHC1802K</b>		
Make & Model:	HYUNDAI AE IONIQ HEV DCT, 1.6 (A)	Engine No:	G4LEJU045587
Reg. Date:	03/07/2018 (Man. Year: 2018)	Chassis No:	KMHC851CVJU103412
Colour:	Blue	Odometer:	233627 km
Engine Capacity:	1580 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Davanti 6 mm	Rear Left Side:	Davanti 6 mm
Front Right Side:	Davanti 6 mm	Rear Right Side:	Davanti 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	932.12	821.64	110.48	11.85
Miscellaneous Items	0.00	0.00	0.00	
Labour	720.00	560.00	160.00	22.22
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (\$\$)</b>	<b>1,652.12</b>	<b>1,381.64</b>	<b>270.48</b>	<b>16.37</b>
<b>+ GST 7.00/7.00% (\$\$)</b>	115.65	96.71	18.94	16.38
<b>Nett Amount (\$\$)</b>	<b>1,767.77</b>	<b>1,478.35</b>	<b>289.42</b>	<b>16.37</b>
<b>+ Loss of Use (2.5 x S\$50.00/day) (\$\$)</b>		125.00		
<b>+ Car Rental (2.5 x S\$125.19/day) (\$\$)</b>		312.98		
<b>+ Doc/Search Fee (\$\$)</b>		7.49		
<b>Nett Liability (\$\$)</b>		<b>1,923.82</b>		

### INSPECTION

Date of Assignment: 02/12/2019

Date Inspected: 02/12/2019 Inspected At:

ComfortDelGro Engineering Pte Ltd  
(Loyang)  
59 Loyang Drive  
Singapore 508969

Estimated Period of Repair: 2.0 days

**Adjuster:** XING GUO QIANG**Manager:** CHUA ZHEN LI

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Broken	459.40 FL	*459.40 FL
2	1		*REAR BUMPER CTR MOULDING	Cut	451.25 FL	*451.25 FL
3	1		*REAR BUMPER REFLECTOR RH	Cut	31.90 FL	*31.90 FL
4	1		*REAR BUMPER SIDE BRKT RH	Not Necessary	138.10 FL	*- FL
5	10		*REAR BUMPER CLIPS	Necessary	22.00 FL	*22.00 FL
6	1		*REAR BUMPER MAT	Necessary	50.00 FS	*50.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (S\$)</b>	<b>1,152.65</b>	<b>1,014.55</b>
<b>- List Item Discount on L Items 20.00/20.00% (S\$)</b>	220.53	192.91
<b>Total Parts (S\$)</b>	<b>932.12</b>	<b>821.64</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	350.00	320.00
2	SPRAYPAINT CHARGE	New	250.00	200.00
3	R/I REVERSE SENSOR	New	120.00	40.00
<b>Gross Labour Cost (\$\$)</b>			<b>720.00</b>	<b>560.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >