

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)
 51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
 Singapore 408933
 Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/ICS19021454/R1YF3E2
Date: 22/04/2020

REFERENCE

Handling Insurer: ECICS Limited Policy No:
Claimant Vehicle No : YP2554A **Insured Vehicle No :** GBC1858X
Date of Loss: 21/05/2017 **Nature of Claim:** TP **Claim No:** DMCV1700054H/NC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **YP2554A**
 Make & Model: MITSUBISHI FUSO, 7.5 D FM65FM2RDEB (M) Engine No: 6M60214446
 Reg. Date: 24/05/2016 (Man. Year: 2016) Chassis No: FM65FMA30053
 Colour: Black Odometer: 112794 km
 Engine Capacity: 7545 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 295/80 R22.5 Rear Tyre Size: 295/80 R22.5 (D)
 Front Left Side: Austone 8 mm Rear Left Side: Austone 8/8 mm
 Front Right Side: Austone 8 mm Rear Right Side: Austone 8/8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,157.00	819.00	4,338.00	84.12
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,100.00	250.00	850.00	77.27
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	6,257.00	1,069.00	5,188.00	82.92
Approved Total (Overridden) (S\$)		850.00		
(S\$)	6,257.00	850.00	5,407.00	86.42
+ GST 7.00/7.00% (S\$)	437.99	59.50	378.49	86.42
Nett Amount (S\$)	6,694.99	909.50	5,785.49	86.42

INSPECTION

Date of Assignment: 04/12/2019
 Date Inspected: 05/12/2019 Inspected At: Sin Sheng Engineering Services (HQ)
 No 8 Tuas Ave 18
 Singapore 638892
 Estimated Period of Repair: 1.0 days

Adjuster: MOHD RASUL**Manager:** YVONNE WONG YIN CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 22 Apr 2020)	
Parts:	N/A	MITSUBISHI FUSO 7.5 D FM65FM2RDEB (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for YP2554A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BUMPER, LHS	Bent	650.00 FN	*650.00 FN
2	1		*REAR LAMP, LHS	Broken	200.00 FN	*200.00 FN
3	1		*HYDRAULIC CYLINDER, BIG	Not Necessary	2,500.00 FN	*- FN
4	1		*HYDRAULIC CYLINDER, SMALL	Not Necessary	2,200.00 FN	*- FN
5	1		*RED / WHITE STICKER	Necessary	60.00 FN	*60.00 FN
6	1		*HYDRAULIC OIL	Not Necessary	120.00 FN	*- FN

F=Franchise part. N=NettItemDisc.

Sub Total (\$\$)	5,730.00	910.00
- Nett Item Discount on N Items 10.00/10.00% (\$\$)	573.00	91.00
Total Parts (\$\$)	5,157.00	819.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO SPRAY PAINTING	New	250.00	100.00
2	TO CHECK / REPAIR TAILGATE. TO DISMANTLE / REPLACE ABOVEMENTIONED PARTS	New	850.00	150.00
Gross Labour Cost (S\$)			1,100.00	250.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >