

ASS. REC. BY:

REF:

CS/SPF19021458/GGF302

Special Instructions:

Survey: G2

ASSIGNMENT (Office)

From (Person): Perry

of

SPF3

Date/Time:

04/17/19

Estimated Cost:

Bill to:

OD/TP/WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

GBF 3172L

Insured:

at Workshop m/s

INDECO

Tel:

9787 7084 Mike

of

39 DEPT LANE 12

Policy No:

Claim No:

MHASPF030000013

Sum Insured:

Excess:

Make of Veh.

D.O.A.

(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

Person Contacted:

Vehicle IN/OUT

Date/Time

Action/Instruction

Volunteer ()

GBF 3172L - X

Material = \$ 6741.30 ; Man hours: 58 hrs
 check = \$ 218.

X6K

SPF

ASSIGNMENT

From

Date:

05/12/19

Veh No:

GBF3172L

Regn:

- / 2016

Estimated Cost:

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or

Police car 25

To Inspect Vehicle No:

GBF 3172L

Make:

Hyundai H1 starex 2497

at Workshop m/s

INDECO

Colour:

Blue

A/C: Insured / Std / NI / NA

of

39 DEFU LANE 12

Sp/Reading

~~82/29~~

T/Radio: Insured / Std / NI / NA

Insured:

Eng/No:

92/29

Policy No:

C/No:

KMFV BX 7K MG 481 9049

Claims No:

Gen. Cond: Good / Fair / Poor / Burnt

Sum Insured:

Excess:

Steering: In order / Jammed / Leaked / Burnt or

(Client's Record)

Brake: In order / Jammed / Leaked / Burnt or

Make of Veh:

Modi: Nil / S/Rim / STD A/Rim or

Call Anson 85114276

Tyre Size:

F:

215/70 R16

R:

11

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Roadstone

Bal. or Market Value:

Front

Rear

IDAC Accident Rpt:

Consistent? : Yes or No

R/Bal.

5

mm

R/Bal.

5

mm

GIA / PR Seen:

Consistent? : Yes or No

L/Bal.

5

mm

L/Bal.

5

mm

Est. Repairs:

days

Res.: Yes or No

D.O.A.

D.O.I.

05-12-19

Lum Sum:

%

3 Val: Yes or No

Survey held at

w/s

12:30

CA / REV / REP. / 24 HRS

Des. of Damages: Fnt / Rear / O/S / N/S / UIC / Rooftop or

O/S front

Date:

Person Contacted:

Vehicle: IN / OUT

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

11/12

link 31 42 Hrs with Anson - 85114276

Date/Time, File Pass in:

☐

: Preli. Report

11/12/19

☐

: Final Report

Date/Time, File Return in:

31

Days Of Repair:

Resurvey No. of Trip:

2

Survey Fee:

Transportation:

2 x 100 = 200

Meals:

Other:

TOTAL

Arid Fee:

☐

: Site Insp

15

☐

: Interview

15

☐

: Tech. Insp

15

☐

: Workshop

15

Report Format:

1 map 200 / 100 / 10

180

180

Nivitha (LKK Auto)

From: Perry HE (HTX) <Perry_HE@spf.gov.sg>
Sent: Wednesday, 4 December 2019 2:35 PM
To: 'assignments'
Cc: Kim Pang CHAY (HTX); Kwee Huat TAN (HTX); 'Denise Tay (LKKAuto)'
Subject: Appraisal Services for SPF vehicle at INDECO - GBF3172L

Hi Catherine and Ashley,

Please provide Appraisal Service (Parts and Labour-man hours) for the following SPF vehicle at INDECO, with new contractual rate.

Ref: MHASPF0300000113

Pls also advise whether this vehicle is structurally safe to repair.

GBF3172L

Parts:

- 1.1 FRT BUMPER UPPER
- 1.2 FRT BUMPER LOWER
- 1.3 ENGINE UNDER COVER COMPLETE
- 1.4 FRT BUMPER CLIPS
- 1.5 FRT BUMPER RETAINER RH
- 1.6 ENGINE UNDER COVER CLIPS
- 1.7 RHF FENDER
- 1.8 RHF FENDER INNER SHIELD
- 1.9 RHF FENDER INNER SHIELD CLIP
- 1.10 RHF FENDER LAMP ASSY
- 1.11 RHF FENDER LAMP WIRE HARNESS
- 1.12 RHF WHEEL HOUSE
- 1.13 HEADLAMP RH
- 1.14 FOGLAMP RH
- 1.15 FOGLAMP BRACKET RH
- 1.16 RHF FENDER CORNER GLASS
- 1.17 WIPER TANK
- 1.18 RHF TYRE 215/70/16R SOR 5 CAT B
- 1.19 RHF METEL RIM 16"
- 1.20 RHF LOWER ARM
- 1.21 RHF KNUCKLE ARM
- 1.22 RHF WHEEL HUB
- 1.23 RHF WHEEL BEARING
- 1.24 RHF S/ABSORBER
- 1.25 RHF TIE ROD
- 1.26 RHF TIE ROD END
- 1.27 RHF DOOR
- 1.28 RHF SIDE APRON PANEL 64574-4H400
- 1.29 FRT BUMPER BRACKER RH 86556-4H000
- 1.30 FRT BUMPER LOWER LIP
- 1.31 FOGLAMP GRILLE
- 1.32 FRT BUMPER STAY RH 86552-4H500
- 1.33 RHF ANTI ROLL BAR LINK
- 1.34 ANTI ROLL BAR
- 1.35 RHF LOWER ARM BALL JOINT WITH 1.20

Mike
9787 7084
39 Defu Lam 12
(in)
call anson 8511 9276

- 1.36 ABS TUBE PIPE 58718-4H990
- 1.37 ABS TUBE PIPE 58711-4H350
- 1.38 ABS TUBE MODULE 58713-4H950
- 1.39 ABS TUBE MODULE 58715-4H950
- 1.40 ABS PUMP ASSY
- 1.41 RHF ABS SENSOR
- 1.42 HEADLAMP LH

Labour

1.1	TO REPLACE AND RESPRAY BONNET	6
1.2	TO REPLACE AND RESPRAY FRT BUMPER	5
1.3	TO REPLACE AND RESPRAY RHF FENDER	4
1.4	TO REPAIR AND RESPRAY SUPPORT PANEL	2
1.5	TO REMOVE AND REFIX CONDENSER,RADIATOR AND TOP UP AC GAS	2
1.6	TO REPLACE AND RESPRAY RHF DOOR	6
1.7	TO REPLACE WIRENESS	8
1.8	TO REMOVE AND REFIX ENGINE PARTS IN COMPARTMENT TO ASSIST WORK	10
1.9	TO ALIGN,REPAIR AND RESPRAY CHASSIS	6
1.10	TO REPLACE RHF WHEEL HOUSE	10
1.11	TO REPAIR AND RESPRAY LHF FENDER	5
1.12	TO REPLACE RHF UNDERCARRIAGE	2
1.13	TO REPLACE ABS PUMP AND TUBE	4
1.14	TO REPLACE RHF FENDER CORNER GLASS	1
1.15	TO SEND VEHICLE FOR WHEEL ALIGHMENT	1

Thanks.

Perry He Junyun

Contract Management Engineer

Capability Sustainment

Home Team Science & Technology (Forward Deployment to SPF)

DID: (65) 6478 4869 | HP: (65) 9191 5725



e^xponentially
impacting
Singapore's
safety and security_



Home Team Science & Technology Agency W htx.gov.sg FB fb.com/HTXSG IG Instagram.com/htx_sg

WARNING: Privileged/Confidential information may be contained in this message; if you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error.

Shiau Chan (LKKAUTO)

From: Perry HE (HTX) <Perry_HE@htx.gov.sg>
Sent: Tuesday, 10 March 2020 4:25 PM
To: Shiau Chan (LKKAUTO)
Cc: SUR; Kim Pang CHAY (HTX); Kwee Huat TAN (HTX)
Subject: RE: Appraisal Services for SPF vehicle at INDECO - GBF3172L

Hi Shiau Chan,

Ok, pls send all documents in soft copies.

Thanks.

Perry He Junyun

Contract Management Engineer (Land Systems – Vehicles)
Capability Sustainment
Home Team Science & Technology Agency (Forward Deployed to SPF)
DID: (65) 6478 4869 | HP: (65) 9191 5725



eXponentially
impacting
Singapore's
safety and security_



Home Team Science & Technology Agency W htx.gov.sg FB fb.com/HTXSg IG Instagram.com/htxsg

WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act (Cap 213). Please notify the sender immediately if you receive this in error."

From: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>
Sent: Tuesday, 10 March 2020 2:22 PM
To: Perry HE (HTX) <Perry_HE@htx.gov.sg>
Cc: SUR <sur@lkkauto.com>; Kim Pang CHAY (HTX) <CHAY_Kim_Pang@htx.gov.sg>; Kwee Huat TAN (HTX) <TAN_Kwee_Huat@htx.gov.sg>
Subject: RE: Appraisal Services for SPF vehicle at INDECO - GBF3172L

Dear Perry,

Kindly advise whether we can submit our report to you as dated 23/01/2020.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>
Sent: Thursday, 23 January 2020 11:24 AM
To: Perry HE (HTX) <Perry_HE@htx.gov.sg>
Cc: SUR <sur@lkkauto.com>; Kim Pang CHAY (HTX) <CHAY_Kim_Pang@htx.gov.sg>; Kwee Huat TAN (HTX)

Shiau Chan (LKKAUTO)

From: Perry HE (HTX) <Perry_HE@htx.gov.sg>
Sent: Wednesday, 22 January 2020 11:39 AM
To: Shiau Chan (LKKAUTO)
Cc: SUR; Kim Pang CHAY (HTX); Kwee Huat TAN (HTX)
Subject: RE: Appraisal Services for SPF vehicle at INDECO - GBF3172L

Hi Shiau Chan,

Apology, should be these 2 labour items, thanks.

2.8	TO REMOVE AND REFIX ENGINE PARTS IN COMPARTMENT TO ASSIST WORK	UNCONFIRM	✓	10
2.9	TO ALIGN, REPAIR AND RESPRAY CHASSIS	UNCONFIRM	✓	6

Perry He Junyun

Contract Management Engineer (Land Systems – Vehicles)
Capability Sustainment
Home Team Science & Technology Agency (Forward Deployed to SPF)
DID: (65) 6478 4869 | HP: (65) 9191 5725



eXponentially
impacting
Singapore's
safety and security_



Home Team Science & Technology Agency W htx.gov.sg FB [fb.com/HTXSG](https://www.facebook.com/HTXSG) IG [Instagram.com/htxsg](https://www.instagram.com/htxsg)

WARNING: "Privileged/Confidential information may be contained in this message. If you are not the intended addressee, you must not copy, distribute or take any action in reliance thereon. Communication of any information in this email to any unauthorized person is an offence under the Official Secrets Act [Cap 213]. Please notify the sender immediately if you receive this in error."

From: Perry HE (HTX)
Sent: Wednesday, 22 January 2020 11:36 AM
To: 'Shiau Chan (LKKAUTO)' <siewsc@lkkauto.com>
Cc: 'SUR' <sur@lkkauto.com>; Kim Pang CHAY (HTX) <CHAY_Kim_Pang@htx.gov.sg>; Kwee Huat TAN (HTX) <TAN_Kwee_Huat@htx.gov.sg>
Subject: RE: Appraisal Services for SPF vehicle at INDECO - GBF3172L

Hi Shiau Chan,

INDECO has requested to add in these 2 items back as we have verified that ABS Pump needs to be replaced.
Able to get your surveyor to confirm the man hours for these items?

2.7	TO REPLACE WIRENESS	UNCONFIRM
2.8	TO REMOVE AND REFIX ENGINE PARTS IN COMPARTMENT TO ASSIST WORK	UNCONFIRM

Thank you.



Scope Of Work
Home Team Agency

SCOPE OF WORK

1 To provide labour, materials, transportation, tools and others deemed necessary to carry out the following repairs:

CONTRACTOR :	Indeco Engineers Pte Ltd	VEH TYPE :		UNIT :	PROCOM	Reference No.
VEH NO :	GBF 3172 L	MB	REPAIR TYPE:	ACCIDENT		MHA/SPF/2019/12-0002 1100037962
VEH MAKE/MODEL	HYUNDAI HI		Mileage:	92129		

S/N	PARTS DESCRIPTION	PART COST (\$)	QTY	Mark Up Rate	Parts Cost Per Unit After Mark Up (\$)	Total Parts Cost Per Unit After Mark Up (\$)
1	Scope Of Repairs					
1.1	FRT BUMPER UPPER / <i>GA</i>	250.00	1	20%	300.00	300.00
1.2	FRT BUMPER LOWER / <i>GA</i>	230.00	1	20%	276.00	276.00
1.3	ENGINE UNDER COVER COMPLETE / <i>MIS</i>	85.00	1	20%	102.00	102.00
1.4	FRT BUMPER CLIPS / <i>NC</i>	1.50	10	20%	1.80	18.00
1.5	FRT BUMPER RETAINER RH / <i>MIS</i>	15.00	1	20%	18.00	18.00
1.6	ENGINE UNDER COVER CLIPS / <i>NC</i>	1.50	10	20%	1.80	18.00
1.7	RHF FENDER / <i>DIS</i>	220.00	1	20%	264.00	264.00
1.8	RHF FENDER INNER SHIELD / <i>MIS</i>	65.00	1	20%	78.00	78.00
1.9	RHF FENDER INNER SHIELD CLIP / <i>NC</i>	1.50	6	20%	1.80	10.80
1.10	RHF FENDER LAMP ASSY / <i>DIS</i>	25.00	1	20%	30.00	30.00
1.11	RHF FENDER LAMP WIRE HARNESS / <i>DIS</i>	1050.00	1	20%	1260.00	1260.00
1.12	RHF WHEEL HOUSE / <i>DIS</i>	1250.00	1	20%	1500.00	1500.00
1.13	HEADLAMP RH / <i>GA</i>	380.00	1	20%	456.00	456.00
1.14	FOGLAMP RH / <i>GA</i>	110.00	1	20%	132.00	132.00
1.15	FOGLAMP BRACKET RH / <i>BT</i>	175.00	1	20%	210.00	210.00
1.16	RHF FENDER CORNER GLASS / <i>DE</i>	45.00	1	20%	54.00	54.00
1.17	WIPER TANK / <i>DE</i>	244.50	1	0%	244.50	244.50
1.18	RHF TYRE 215/70/16R SOR SCAT B / <i>Plush</i>	230.00	1	20%	276.00	276.00
1.19	RHF METEL RIM 16" / <i>BT</i>	165.00	1	20%	198.00	198.00
1.20	RHF LOWER ARM / <i>BT</i>	260.00	1	20%	312.00	312.00
1.21	RHF KNUCKLE ARM / <i>BT</i>	240.00	1	20%	288.00	288.00
1.22	RHF WHEEL HUB / <i>BT</i>	165.00	1	20%	198.00	198.00
1.23	RHF WHEEL BEARING / <i>BT</i>	68.00	1	20%	81.60	81.60
1.24	RHF S/ABSORBER / <i>BT</i>	55.00	1	20%	66.00	66.00
1.25	RHF TIE ROD / <i>BT</i>	460.00	1	20%	552.00	552.00
1.26	RHF TIE ROD END / <i>BT</i>	90.00	1	20%	108.00	108.00
1.27	RHF DOOR / <i>NC</i>	15.00	1	20%	18.00	18.00
1.28	RHF SIDE APRON PANEL 64574-4H400 / <i>NC</i>	35.00	1	20%	42.00	42.00
1.29	FRT BUMPER BRACKER RH 86556-4H000 / <i>NC</i>	180.00	1	20%	216.00	216.00
1.30	FRT BUMPER LOWER LIP / <i>NC</i>	15.00	1	20%	18.00	18.00
1.31	FOGLAMP GRILLE / <i>NC</i>	42.00	1	20%	50.40	50.40
1.32	FRT BUMPER STAY RH 86552-4H500 / <i>NC</i>	490.00	1	20%	588.00	588.00
1.33	RHF ANTI ROLL BAR LINK / <i>BT</i>	0.00	1	0%	0.00	0.00
1.34	ANTI ROLL BAR / <i>BT</i>	140.00	1	20%	168.00	168.00
1.35	RHF LOWER ARM BALL JOINT WITH 1.20 / <i>BT</i>	140.00	1	20%	168.00	168.00
1.36	ABS TUBE PIPE 58718-4H990 / <i>BT</i>	95.00	1	20%	114.00	114.00
1.37	ABS TUBE PIPE 58711-4H350 / <i>BT</i>	135.00	1	20%	162.00	162.00
1.38	ABS TUBE MODULE 58713-4H950 / <i>BT</i>	585.00	1	20%	702.00	702.00
1.39	ABS TUBE MODULE 58715-4H950 / <i>BT</i>	130.00	1	20%	156.00	156.00
1.40	ABS PUMP ASSY / <i>BT</i>	380.00	1	20%	456.00	456.00
1.41	RHF ABS SENSOR / <i>BT</i>					
1.42	HEADLAMP LH / <i>NC</i>					
2	Additional Services					
	LKK Auto Consultants hence notify the Repairer of the following:					
	* To resurvey before/after spray painting					
	* To display damaged part(s) during resurvey					
	Remarks: prices are subject to confirmation					
	SUBJECT TO PARTS AVAILABILITY * BY AIR 1-2 MONTHS				Parts Total:	\$ 9,909.30

- * Third party survey is on a "Without Prejudice" basis
- * No illegal modification(s) is allowed
- * Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

S/N	LABOUR DESCRIPTION	Man-Hour Rate (\$)	Man-Hour	Total Man-Hour Cost (\$)
1	Scope Of Repairs			
1.1	TO REPLACE AND RESPRAY BONNET /	61.80	6 ✓	370.80
1.2	TO REPLACE AND RESPRAY FRT BUMPER /	61.80	5 ✓	309.00
1.3	TO REPLACE AND RESPRAY RHF FENDER /	61.80	4 ✓	247.20
1.4	TO REPAIR AND RESPRAY SUPPORT PANEL /	61.80	2 ✓	123.60
1.5	TO REMOVE AND REFIX CONDENSER,RADIATOR AND TOP UP AC GAS /	61.80	2 ✓	123.60
1.6	TO REPLACE AND RESPRAY RHF DOOR /	61.80	5 6 ✓	370.80
1.7	TO REPLACE WIRENESS /	61.80	8 ✓	494.40
1.8	TO REMOVE AND REFIX ENGINE PARTS IN COMPARTMENT TO ASSIST WORK X ✓	61.80	✓ 10	618.00
1.9	TO ALIGN,REPAIR AND RESPRAY CHASSIS # ? /	61.80	✓ 6	370.80
1.10	TO REPLACE RHF WHEEL HOUSE	61.80	10 ✓	618.00
1.11	TO REPAIR AND RESPRAY LHF FENDER X NC	61.80	5 ✓	309.00
1.12	TO REPLACE RHF UNDERCARRIAGE /	61.80	2 ✓	123.60
1.13	TO REPLACE ABS PUMP AND TUBE /	61.80	4 ✓	247.20
1.14	TO REPLACE RHF FENDER CORNER GLASS /	61.80	1 ✓	61.80
1.15	TO SEND VEHICLE FOR WHEEL ALIGNMENT /	61.80	1 ✓	61.80
2	Additional Services			
		Labour Total:	\$	4,449.60
		GRAND TOTAL :	\$	14,358.90
Contractor shall complete the entire repair within <u>80</u> working days upon quotation approved date.				

Contractor QC		Verification of Scope of Work		Approved By:	
Name:	 Lee Seng Chee Senior Technician	Name:		Name:	
Date:		Date:		Date:	
Sign:	 08/12/19	Sign:		Sign:	
Contractor QC		Verification of Completed Repairs		Home Team Contract / Fleet Manager	
Name:		Name:		Name:	
Date:		Date:		Date:	
Sign:		Sign:		Sign:	
All completed repairs must be verified by Home Team Contract Manager / Fleet Manager before payment can be made					



ACCIDENT/DAMAGE REPAIR AND AD HOC WORKS REQUEST FORM

ILMS Notification No	1100037962		
Vehicle No	GBF3172L	Division/Unit	PROCOM
Vehicle Type (e.g. FRC, minibus)	MINIBUS	Date	15/11/2019
Vehicle Make & Model	HYUNDAI STAREX	Mileage (km)	92129

Description	Pls tick	Police Report No & Date of Accident (if applicable)
NP168 (Accident involve 3 rd Party)	☒	T/20191112/7022
NP168 (Accident do not involve 3 rd Party)	☐	
NP299 Accident report	☐	
NP299 Discovered Damage	☐	
Wear and Tear	☐	

Description of affected area/required works (e.g. dented, cracked, grazed etc)

FRONT BUMPER DISLOGED

DRIVER DOOR DENTED AND GRAZED

HEADLIGHT CRACKED




FRONT RIGHT RIM DENTED

RIGHT FRONT FENDER DAMAGED

FRONT HOOD DENTED

(PLEASE SEE ATTACHED PICTURES)

Pls mark affected area with X

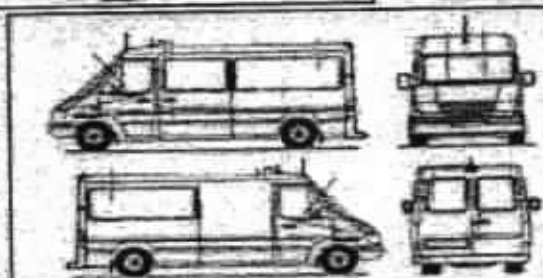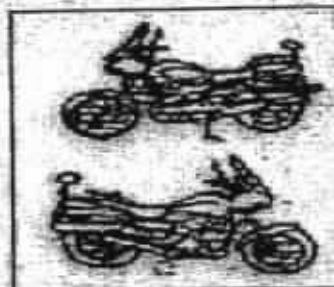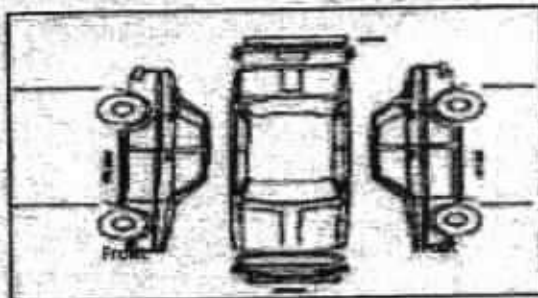

Adrian Choo
OC Transport
Protective Security Command

15/11/19

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	FRT BUMPER UPPER	1	CRACKED	\$300.00	\$300.00	
1.2	FRT BUMPER LOWER	1	CRACKED	\$276.00	\$276.00	
1.3	ENGINE UNDER COVER COMPLETE	1	MISSING	\$102.00	\$102.00	
1.4	FRT BUMPER CLIPS	10	NECESSARY	\$1.80	\$18.00	
1.5	FRT BUMPER RETAINER RH	1	MISSING	\$18.00	\$18.00	
1.6	ENGINE UNDER COVER CLIPS	10	NECESSARY	\$1.80	\$18.00	
1.7	RHF FENDER	1	DISTORTED	\$264.00	\$264.00	
1.8	RHF FENDER INNER SHIELD	1	MISSING	\$78.00	\$78.00	
1.9	RHF FENDER INNER SHIELD CLIP	6	NECESSARY	\$1.80	\$10.80	
1.10	RHF FENDER LAMP ASSY	1	DISTORTED	\$30.00	\$30.00	
1.11	RHF FENDER LAMP WIRE HARNESS	1	UNCONFIRM	\$1,260.00		
1.12	RHF WHEEL HOUSE	1	DISTORTED	\$1,500.00	\$1,500.00	
1.13	HEADLAMP RH	1	CRACKED	\$456.00	\$456.00	
1.14	FOGLAMP RH	1	SCRATCHED	\$132.00	\$132.00	
1.15	FOGLAMP BRACKET RH		BENT			
1.16	RHF FENDER CORNER GLASS	1	DEFORMED	\$210.00	\$210.00	
1.17	WIPER TANK	1	DEFORMED	\$54.00	\$54.00	
1.18	RHF TYRE 215/70/16R SOR 5 CAT B	1	PUNCTURED	\$244.50	\$244.50	
1.19	RHF METEL RIM 16"	1	BENT	\$276.00	\$276.00	
1.20	RHF LOWER ARM	1	BENT	\$198.00	\$198.00	
1.21	RHF KNUCKLE ARM	1	BENT	\$312.00	\$312.00	
1.22	RHF WHEEL HUB	1	BENT	\$288.00	\$288.00	
1.23	RHF WHEEL BEARING		BENT			
1.24	RHF S/ABSORBER	1	BENT	\$198.00	\$198.00	
1.25	RHF TIE ROD	1	BENT	\$81.60	\$81.60	
1.26	RHF TIE ROD END	1	BENT	\$66.00	\$66.00	
1.27	RHF DOOR	1	REPAIR	\$552.00		
1.28	RHF SIDE APRON PANEL 64574-4H400	1	MISSING	\$108.00	\$108.00	
1.29	FRT BUMPER BRACKET RH 86556-4H000	1	CRACKED	\$18.00	\$18.00	
1.30	FRT BUMPER LOWER LIP	1	NOT CONSISTENT	\$42.00		
1.31	FOGLAMP GRILLE	1	DEFORMED	\$216.00	\$216.00	
1.32	FRT BUMPER STAY RH 86552-4H500	1	MISSING	\$18.00	\$18.00	
1.33	RHF ANTI ROLL BAR LINK	1	BENT	\$50.40	\$50.40	
1.34	ANTI ROLL BAR	1	BENT	\$588.00	\$588.00	
1.35	RHF LOWER ARM BALL JOINT WITH 1.20	1	BENT			
1.36	ABS TUBE PIPE 58718-4H990	1	BENT	\$168.00	\$168.00	
1.37	ABS TUBE PIPE 58711-4H350	1	BENT	\$168.00	\$168.00	
1.38	ABS TUBE MODULE 58713-4H950	1	BENT	\$114.00	\$114.00	
1.39	ABS TUBE MODULE 58715-4H950	1	BENT	\$162.00	\$162.00	
1.40	ABS PUMP ASSY	1	UNCONFIRM	\$702.00		
1.41	RHF ABS SENSOR	1	UNCONFIRM	\$156.00		
1.42	HEADLAMP LH	1	NOT CONSISTENT	\$456.00		
	COSTING		TOTAL PARTS COST		\$6,741.30	

2	SCOPE OF REPAIRS				
2.1	TO REPLACE AND RESPRAY BONNET				6
2.2	TO REPLACE AND RESPRAY FRT BUMPER				5
2.3	TO REPLACE AND RESPRAY RHF FENDER				4
2.4	TO REPAIR AND RESPRAY SUPPORT PANEL				2
2.5	TO REMOVE AND REFIX CONDENSER,RADIATOR AND TOP UP AC GAS				2
2.6	TO REPLACE AND RESPRAY RHF DOOR				5
2.7	TO REPLACE WIRENESS		UNCONFIRM		
2.8	TO REMOVE AND REFIX ENGINE PARTS IN COMPARTMENT TO ASSIST WORK				10
2.9	TO ALIGN,REPAIR AND RESPRAY CHASSIS				6
2.10	TO REPLACE RHF WHEEL HOUSE				10
2.11	TO REPAIR AND RESPRAY LHF FENDER		NOT CONSISTENT		
2.12	TO REPLACE RHF UNDERCARRIAGE				2
2.13	TO REPLACE ABS PUMP AND TUBE				4
2.14	TO REPLACE RHF FENDER CORNER GLASS				1
2.15	TO SEND VEHICLE FOR WHEEL ALIGHMENT				1
COSTING		TOTAL MAN-HOUR			58.00

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTOMOTIVE ENGINEERING & MGT DIVISION Ref : CS/SPF19021458/Ggf3e2

ACCIDENT CLAIMS SECTION (SPORE POLICE
FORCE) POLICE LOGISTICS BASE (PLB) 1
HEMMANT ROAD SINGAPORE 438675

Date : 12-03-2020



ATTN : PERRY

Code : SPF3

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	GBF 3172L
Policy No.		Coverage (\$)	0.00
Claim No.	MHASPF0300000113	Excess (\$)	0.00
Assign From	PERRY	Assign Date	04/12/2019

2. Vehicle Particulars & Condition

Make & Model	HYUNDAI H1 STAREX 2.5	c.c	2497
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	KMFWBX7KMGU819049	Colour	BLUE
Odometer	92129	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/70 R16	ROADSTONE	5 mm
L/H Front Tyre	215/70 R16	ROADSTONE	5 mm
R/H Rear Tyre	215/70 R16	ROADSTONE	5 mm
L/H Rear Tyre	215/70 R16	ROADSTONE	5 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date		Inspection Date	05/12/2019
Survey held at	INDECO ENGINEERS PTE LTD 39 DEFU LANE 12 . SINGAPORE 539139		

5a. Remarks

--



Registration No. GBF 3172L

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	FRT BUMPER UPPER	1	CRACKED	\$300.00	\$300.00	
1.2	FRT BUMPER LOWER	1	CRACKED	\$276.00	\$276.00	
1.3	ENGINE UNDER COVER COMPLETE	1	MISSING	\$102.00	\$102.00	
1.4	FRT BUMPER CLIPS	10	NECESSARY	\$1.80	\$18.00	
1.5	FRT BUMPER RETAINER RH	1	MISSING	\$18.00	\$18.00	
1.6	ENGINE UNDER COVER CLIPS	10	NECESSARY	\$1.80	\$18.00	
1.7	RHF FENDER	1	DISTORTED	\$264.00	\$264.00	
1.8	RHF FENDER INNER SHIELD	1	MISSING	\$78.00	\$78.00	
1.9	RHF FENDER INNER SHIELD CLIP	6	NECESSARY	\$1.80	\$10.80	
1.10	RHF FENDER LAMP ASSY	1	DISTORTED	\$30.00	\$30.00	
1.11	RHF FENDER LAMP WIRE HARNESS	1	UNCONFIRM	\$1,260.00	\$1,260.00	
1.12	RHF WHEEL HOUSE	1	DISTORTED	\$1,500.00	\$1,500.00	
1.13	HEADLAMP RH	1	CRACKED	\$456.00	\$456.00	
1.14	FOGLAMP RH	1	SCRATCHED	\$132.00	\$132.00	
1.15	FOGLAMP BRACKET RH		BENT			
1.16	RHF FENDER CORNER GLASS	1	DEFORMED	\$210.00	\$210.00	
1.17	WIPER TANK	1	DEFORMED	\$54.00	\$54.00	
1.18	RHF TYRE 215/70/16R SOR 5 CAT B	1	PUNCTURED	\$244.50	\$244.50	
1.19	RHF METEL RIM 16"	1	BENT	\$276.00	\$276.00	
1.20	RHF LOWER ARM	1	BENT	\$198.00	\$198.00	
1.21	RHF KNUCKLE ARM	1	BENT	\$312.00	\$312.00	
1.22	RHF WHEEL HUB	1	BENT	\$288.00	\$288.00	
1.23	RHF WHEEL BEARING		BENT			
1.24	RHF S/ABSORBER	1	BENT	\$198.00	\$198.00	
1.25	RHF TIE ROD	1	BENT	\$81.60	\$81.60	
1.26	RHF TIE ROD END	1	BENT	\$66.00	\$66.00	
1.27	RHF DOOR	1	REPAIR	\$552.00		

1.28	RHF SIDE APRON PANEL 64574-4H400	1	MISSING	\$108.00	\$108.00	
1.29	FRT BUMPER BRACKET RH 86556-4H000	1	CRACKED	\$18.00	\$18.00	
1.30	FRT BUMPER LOWER LIP	1	NOT CONSISTENT	\$42.00		
1.31	FOGLAMP GRILLE	1	DEFORMED	\$216.00	\$216.00	
1.32	FRT BUMPER STAY RH 86552-4H500	1	MISSING	\$18.00	\$18.00	
1.33	RHF ANTI ROLL BAR LINK	1	BENT	\$50.40	\$50.40	
1.34	ANTI ROLL BAR	1	BENT	\$588.00	\$588.00	
1.35	RHF LOWER ARM BALL JOINT WITH 1.20	1	BENT			
1.36	ABS TUBE PIPE 58718-4H990	1	BENT	\$168.00	\$168.00	
1.37	ABS TUBE PIPE 58711-4H350	1	BENT	\$168.00	\$168.00	
1.38	ABS TUBE MODULE 58713-4H950	1	BENT	\$114.00	\$114.00	
1.39	ABS TUBE MODULE 58715-4H950	1	BENT	\$162.00	\$162.00	
1.40	ABS PUMP ASSY	1	UNCONFIRM	\$702.00	\$702.00	
1.41	RHF ABS SENSOR	1	UNCONFIRM	\$156.00	\$156.00	
1.42	HEADLAMP LH	1	NOT CONSISTENT	\$456.00		
	COSTING		TOTAL PARTS COST		\$8,859.30	
2	SCOPE OF REPAIRS					
2.1	TO REPLACE AND RESPRAY BONNET					6
2.2	TO REPLACE AND RESPRAY FRT BUMPER					5
2.3	TO REPLACE AND RESPRAY RHF FENDER					4
2.4	TO REPAIR AND RESPRAY SUPPORT PANEL					2
2.5	TO REMOVE AND REFIX CONDENSER,RADIATOR AND TOP UP AC GAS					2
2.6	TO REPLACE AND RESPRAY RHF DOOR					5
2.7	TO REPLACE WIRENESS		UNCONFIRM			
2.8	TO REMOVE AND REFIX ENGINE PARTS IN COMPARTMENT TO ASSIST WORK					10
2.9	TO ALIGN,REPAIR AND RESPRAY CHASSIS					6
2.10	TO REPLACE RHF WHEEL HOUSE					10
2.11	TO REPAIR AND RESPRAY LHF FENDER		NOT CONSISTENT			
2.12	TO REPLACE RHF UNDERCARRIAGE					2
2.13	TO REPLACE ABS PUMP AND TUBE					4
2.14	TO REPLACE RHF FENDER CORNER GLASS					1
2.15	TO SEND VEHICLE FOR WHEEL ALIGHMENT					1
	COSTING		TOTAL MAN-HOUR			58.00

Registration No. GBF 3172L

Registration No. GBF 3172L

Vehicle Inspected By

XING GUO QIANG

*M.MATAI, AMSAE-A
Automotive Assessor*

ADRIAN LING WAI PING

*B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI
Licensed Appraiser*

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.