



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Registration No. GBF 3172L

S/N	ITEM DESCRIPTION	PARTS				MAN-HOUR QTY
		PARTS QTY	Condition	PARTS COST PER UNIT (\$) AFTER MARK UP	TOTAL PARTS COST (\$) AFTER MARK UP	
1	MATERIALS					
1.1	FRT BUMPER UPPER	1	CRACKED	\$300.00	\$300.00	
1.2	FRT BUMPER LOWER	1	CRACKED	\$276.00	\$276.00	
1.3	ENGINE UNDER COVER COMPLETE	1	MISSING	\$102.00	\$102.00	
1.4	FRT BUMPER CLIPS	10	NECESSARY	\$1.80	\$18.00	
1.5	FRT BUMPER RETAINER RH	1	MISSING	\$18.00	\$18.00	
1.6	ENGINE UNDER COVER CLIPS	10	NECESSARY	\$1.80	\$18.00	
1.7	RHF FENDER	1	DISTORTED	\$264.00	\$264.00	
1.8	RHF FENDER INNER SHIELD	1	MISSING	\$78.00	\$78.00	
1.9	RHF FENDER INNER SHIELD CLIP	6	NECESSARY	\$1.80	\$10.80	
1.10	RHF FENDER LAMP ASSY	1	DISTORTED	\$30.00	\$30.00	
1.11	RHF FENDER LAMP WIRE HARNESS	1	UNCONFIRM	\$1,260.00	\$1,260.00	
1.12	RHF WHEEL HOUSE	1	DISTORTED	\$1,500.00	\$1,500.00	
1.13	HEADLAMP RH	1	CRACKED	\$456.00	\$456.00	
1.14	FOGLAMP RH	1	SCRATCHED	\$132.00	\$132.00	
1.15	FOGLAMP BRACKET RH		BENT			
1.16	RHF FENDER CORNER GLASS	1	DEFORMED	\$210.00	\$210.00	
1.17	WIPER TANK	1	DEFORMED	\$54.00	\$54.00	
1.18	RHF TYRE 215/70/16R SOR 5 CAT B	1	PUNCTURED	\$244.50	\$244.50	
1.19	RHF METEL RIM 16"	1	BENT	\$276.00	\$276.00	
1.20	RHF LOWER ARM	1	BENT	\$198.00	\$198.00	
1.21	RHF KNUCKLE ARM	1	BENT	\$312.00	\$312.00	
1.22	RHF WHEEL HUB	1	BENT	\$288.00	\$288.00	
1.23	RHF WHEEL BEARING		BENT			
1.24	RHF S/ABSORBER	1	BENT	\$198.00	\$198.00	
1.25	RHF TIE ROD	1	BENT	\$81.60	\$81.60	
1.26	RHF TIE ROD END	1	BENT	\$66.00	\$66.00	
1.27	RHF DOOR	1	REPAIR	\$552.00		

1.28	RHF SIDE APRON PANEL 64574-4H400	1	MISSING	\$108.00	\$108.00	
1.29	FRT BUMPER BRACKET RH 86556-4H000	1	CRACKED	\$18.00	\$18.00	
1.30	FRT BUMPER LOWER LIP	1	NOT CONSISTENT	\$42.00		
1.31	FOGLAMP GRILLE	1	DEFORMED	\$216.00	\$216.00	
1.32	FRT BUMPER STAY RH 86552-4H500	1	MISSING	\$18.00	\$18.00	
1.33	RHF ANTI ROLL BAR LINK	1	BENT	\$50.40	\$50.40	
1.34	ANTI ROLL BAR	1	BENT	\$588.00	\$588.00	
1.35	RHF LOWER ARM BALL JOINT WITH 1.20	1	BENT			
1.36	ABS TUBE PIPE 58718-4H990	1	BENT	\$168.00	\$168.00	
1.37	ABS TUBE PIPE 58711-4H350	1	BENT	\$168.00	\$168.00	
1.38	ABS TUBE MODULE 58713-4H950	1	BENT	\$114.00	\$114.00	
1.39	ABS TUBE MODULE 58715-4H950	1	BENT	\$162.00	\$162.00	
1.40	ABS PUMP ASSY	1	UNCONFIRM	\$702.00	\$702.00	
1.41	RHF ABS SENSOR	1	UNCONFIRM	\$156.00	\$156.00	
1.42	HEADLAMP LH	1	NOT CONSISTENT	\$456.00		
	COSTING		TOTAL PARTS COST		\$8,859.30	
2	SCOPE OF REPAIRS					
2.1	TO REPLACE AND RESPRAY BONNET					6
2.2	TO REPLACE AND RESPRAY FRT BUMPER					5
2.3	TO REPLACE AND RESPRAY RHF FENDER					4
2.4	TO REPAIR AND RESPRAY SUPPORT PANEL					2
2.5	TO REMOVE AND REFIX CONDENSER,RADIATOR AND TOP UP AC GAS					2
2.6	TO REPLACE AND RESPRAY RHF DOOR					5
2.7	TO REPLACE WIRENESS		UNCONFIRM			
2.8	TO REMOVE AND REFIX ENGINE PARTS IN COMPARTMENT TO ASSIST WORK					10
2.9	TO ALIGN,REPAIR AND RESPRAY CHASSIS					6
2.10	TO REPLACE RHF WHEEL HOUSE					10
2.11	TO REPAIR AND RESPRAY LHF FENDER		NOT CONSISTENT			
2.12	TO REPLACE RHF UNDERCARRIAGE					2
2.13	TO REPLACE ABS PUMP AND TUBE					4
2.14	TO REPLACE RHF FENDER CORNER GLASS					1
2.15	TO SEND VEHICLE FOR WHEEL ALIGHMENT					1
	COSTING		TOTAL MAN-HOUR			58.00

Registration No. GBF 3172L

Vehicle Inspected By



XING GUO QIANG

*M.MATAI, AMSAE-A
Automotive Assessor*



ADRIAN LING WAI PING

*B.Eng, AMSOE, AMIRTE, AMSAE-A, M.MATAI
Licensed Apprdiser*

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.