

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG19021687/ATF3E2

Date: 06/07/2020

REFERENCE

Insured/Claimant: CHEONG HUI TING ELIZABETH (ZHANG HUITING)	Policy No:	1800086489-01		
Date of Loss: 06/12/2019	Nature of Claim:	OD	Claim No:	0089720027SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SME130C	Engine No: CHZ468675
Make & Model: AUDI A3, 999cc TFSI (A)	Chassis No: WAUZZZ8V8J1070243
Reg. Date: 25/07/2018 (Man. Year: 2018)	Odometer: 13538 km
Colour: Black	
Engine Capacity: 999 cc	
Market Value/New Car Price: S\$93,000.00	
Sum Insured (S\$): Market Value/New Car Price	

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16	Rear Tyre Size: 205/55 R16
Front Left Side: Goodyear 6 mm	Rear Left Side: Goodyear 6 mm
Front Right Side: Goodyear 6 mm	Rear Right Side: Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	10,697.00	6,154.56	4,542.44	42.46
Miscellaneous Items	0.00	0.00	0.00	
Labour	16,352.00	9,752.00	6,600.00	40.36
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	27,049.00	15,906.56	11,142.44	41.19
+ GST 7.00/7.00% (S\$)	1,893.43	1,113.46	779.97	41.19
Nett Amount (S\$)	28,942.43	17,020.02	11,922.41	41.19

INSPECTION

Date of Assignment:	10/12/2019	
Date Inspected:	09/12/2019	Inspected At: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	12.0 days	

Adjuster: ADRIAN LING

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Distorted	1,793.00 FS	*1,434.40 FS
2	1		*REAR BUMPER GUIDE SECTION - LH	Cracked	15.00 FS	*11.44 FS
3	2		*REAR BUMPER LOCKING MECHANISM	Not Necessary	53.00 FS	*- FS
4	1		*REAR BUMPER SPOILER - LH	Cut	216.00 FS	*172.80 FS
5	1		*REAR LIGHT REFLECTOR - RH	Cracked	38.00 FS	*29.68 FS
6	1		*REAR BUMPER GUIDE SECTION - LH	Cracked	60.00 FS	*47.84 FS
7	1		*REAR BUMPER SIDE REINFORCEMENT BEAM	Not Necessary	522.00 FS	*- FS
8	2		*REAR PARKING AID SENSOR - INNER / OUTER	Not Necessary	462.00 FS	*- FS
9	1		*SIDE PANEL - LH	Distorted	2,110.00 FS	*1,688.00 FS
10	1		*REAR CONNECTING PLATE - LH	Distorted	89.00 FS	*70.72 FS
11	1		*VENT TRIM	Deformed	64.00 FS	*50.64 FS
12	1		*REAR WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	81.00 FS	*- FS
13	1		*REAR BUMPER ADAPTER - LH	Not Necessary	34.00 FS	*- FS
14	1		*LED TAIL LIGHT - LH	Not Necessary	800.00 FS	*- FS
15	1		*SIDE WINDOW - LH	Necessary	520.00 FS	*415.60 FS
16	1		*REAR WINDSCREEN	Necessary	742.00 FS	*593.20 FS
17	2		*PRIMER	Necessary	38.00 FS	*14.88 FS
18	1		*REAR ALUMINIUM RIM - LH	Cut	666.00 FS	*532.40 FS
19	1		*WHEEL BEARING	Not Necessary	452.00 FS	*- FS
20	1		*TYRE (NPA)	Not Necessary	0.00 FS	*- FS
21	1		*STUB AXLE	Not Necessary	262.00 FS	*- FS
22	1		*ACRYLIC SEALANT	Necessary	180.00 FS	*180.00 FS
23	1		*CAVITY WAX	Necessary	140.00 FS	*140.00 FS
24	1		*STONE CHIP	Necessary	180.00 FS	*180.00 FS
25	1		*REAR WINDSCREEN SEALANT	Necessary	200.00 FS	*200.00 FS
26	1		*1/4 GLASS SEALANT	Necessary	100.00 FS	*100.00 FS
27	1		*METAL FILLER POWDER	Necessary	280.00 FS	*280.00 FS
28	1		*SUNDRIES	Necessary	600.00 FS	*12.96 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) **10,697.00** **6,154.56**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND TRANSFER REAR PARKING AID. CHECK FUNCTION	New	280.00	280.00
2	TO RENEW LHS 1/4 GLASS AND REAR WINDSCREEN TO FACILITATE FENDER RENEWAL	New	600.00	600.00
3	TO DISLODGE AND REINSTALL REAR WIRE HARNESS FOR LIGHTS, BATTERY MANAGER, FUSE AND RELAY TRAYS, ELECTRICAL AND AUDIO EQUIPMENT	New	1,400.00	1,400.00
4	TO REMOVE AND REINSTALL REAR SEAT, BACK REST, HAT TRAY, ABCD PILLAR TRIMS, LUGGAGE COMPARTMENT TRIMS, SEAT BELTS. DISLODGE ROOF LINER AND DISENGAGE CURTAIN AIRBAG ETC	New	1,400.00	1,400.00
5	TO DISMANTLE REAR BUMPER AND REAR LID. CUT OUT AND WELD LHS REAR FENDER AND TAIL LAMP PANEL. RENEW REAR BUMPER. RE-ORGANISE REAR CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	6,400.00	3,000.00
6	TO INSTALL REAR WINDSCREEN SOLAR FILM	New	400.00	400.00
7	TO RESPRAY REAR BUMPER, LHS REAR FENDER, LHS SILL PANEL, DOOR ENTRANCE, DRAIN PANEL, ROOF CHANNEL AND END PANELLING. TO CARRY OUT STONE CHIP TREATMENT AND JOINT SEALER WORKS	New	4,200.00	2,200.00
8	TO DISMANTLE LHS REAR SUSPENSION ASSY. INSPECT FOR DAMAGES AND RENEW ACCORDINGLY	New	1,200.00	0.00
9	TO RENEW LHS REAR RIM AND TYRE. CARRY OUT WHEEL ALIGNMENT	New	280.00	280.00
10	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
Gross Labour Cost (\$\$)			16,352.00	9,752.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >