

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AIG19021825/KBA3Q2

Date: 14/07/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No:

Claimant
Vehicle No : SLL8641S **Insured Vehicle No :** SLV1362R

Date of Loss: 05/12/2019 Nature of Claim: TP Claim No: 9424936389SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLL8641S		
Make & Model:	TOYOTA COROLLA, 1.5 AXIO (A)	Engine No:	2NR8656908
Reg. Date:	14/03/2017 (Man. Year: 2016)	Chassis No:	NRE1610020366
Colour:	Metallic Silver	Odometer:	160297 km
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/60 R15	Rear Tyre Size:	195/60 R15
Front Left Side:	Double Star 3 mm	Rear Left Side:	Double Star 3 mm
Front Right Side:	Double Star 3 mm	Rear Right Side:	Double Star 3 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	36,958.04	13,468.97	23,489.07	63.56
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,970.00	4,680.00	2,290.00	32.86
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	43,928.04	18,148.97	25,779.07	58.68
Approved Total (Overridden) (\$\$)		14,500.00		
(\$\$)	43,928.04	14,500.00	29,428.04	66.99
+ GST 7.00/7.00% (\$\$)	3,074.96	1,015.00	2,059.96	66.99
Nett Amount (\$\$)	47,003.00	15,515.00	31,488.00	66.99
Global Sum Settlement (\$\$)		0.00		

INSPECTION

Date of Assignment: 11/12/2019

Date Inspected: 11/12/2019 Inspected At:

Accord Auto Services Pte Ltd (HQ)
10 Ang Mo Kio Ind Park 2A #03-11,
AMK Auto Point
Singapore 568047

Estimated Period of Repair: 16.0 days

Adjuster: KENNETH KONG

Manager: CHUA ZHEN LI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Torn	1,486.40 FL	*1,486.40 FL
2	1		*FRONT BUMPER INNER SPONGE	Cracked	178.10 FL	*178.10 FL
3	1		*FRONT BUMPER REINFORCEMENT	Bent	347.00 FL	*347.00 FL
4	2		*FRONT BUMPER SIDE RETAINERS RH & LH	Cracked	111.20 FL	*111.20 FL
5	2		*FRONT BUMPER SIDE BRACKETS RH & LH	*Check	111.20 FL	*- FL
6	1		*FRONT BUMPER LOWER GRILLE	Distorted	257.60 FL	*257.60 FL
7	1		*FRONT BUMPER UNDER COVER	Cracked	242.30 FL	*242.30 FL
8	2		*FRONT BUMPER FOG LAMP COVERS RH& LH	Dented	115.00 FL	*115.00 FL
9	2		*HORNS	*Check	425.60 FL	*- FL
10	1		*FRONT GRILLE ASSY	Broken	445.80 FL	*445.80 FL
11	1		*FRONT GRILLE EMBLEM }		0.00 FL	*- FL
12	1		*FRONT GRILLE RUBBER }		0.00 FL	*- FL
13	2		*RADIATOR SIDE GARNISHES RH & LH	Cracked	145.60 FL	*145.60 FL
14	2		*HEADLAMPS RH & LH	Broken	1,842.20 FL	*1,842.20 FL
15	1		*SUPPORT PANEL	Bent	1,019.20 FL	*1,019.20 FL
16	1		*SUPPORT PANEL TOP GARNISH	Cracked	137.90 FL	*137.90 FL
17	2		*HEADLAMP PANELS RH& LH	Not Necessary	282.00 FL	*- FL
18	1		*BRACE PANEL	Bent	174.80 FL	*174.80 FL
19	1		*TOP AIR DUCT	Dented	180.00 FL	*180.00 FL
20	1		*AIR CLEANER BOX	Cracked	890.00 FL	*890.00 FL
21	1		*SET WIRE HARNESS (NPA)	*Check	0.00 FL	*- FL
22	1		*WASHER TANK	Dented	119.90 FL	*119.90 FL
23	1		*WASHER TANK NECK }	Dented	0.00 FL	*- FL
24	1		*WASHER TANK CAP }	Dented	0.00 FL	*- FL
25	1		*RADIATOR SPARE TANK (NPA)	Dented	0.00 FL	*- FL
26	1		*BONNET	Buckled	840.30 FL	*840.30 FL
27	1		*BONNET CABLE	Jammed	153.30 FL	*153.30 FL
28	1		*BONNET INNER LOCK	Bent	132.60 FL	*132.60 FL
29	2		*BONNET HINGES RH & LH	Distorted	311.60 FL	*311.60 FL
30	1		*BONNET STAND	Repair	210.00 FL	*- FL
31	1		*BONNET STAND CLIP	Not Necessary	231.00 FL	*- FL
32	1		*WIPER PANEL	Repair	628.60 FL	*- FL
33	1		*WIPER GARNISH	Serviceable	750.00 FL	*- FL
34	2		*WIPER PANEL SIDE GARNISHES LH & RH	Dented / Cut	141.60 FL	*141.60 FL
35	1		*WIPER PANEL MOTOR	Serviceable	758.50 FL	*- FL
36	1		*FRONT WINDSCREEN GLASS	Cracked	1,460.40 FL	*1,460.40 FL
37	1		*FRONT WINDSCREEN MOULDING	Necessary	176.20 FL	*176.20 FL
38	2		*FRONT FENDERS RH & LH	Bent	1,340.60 FL	*1,340.60 FL
39	2		*FRONT FENDER INNER SHIELDS RH & LH	Cracked	319.60 FL	*319.60 FL
40	1		*FRONT FENDER INNER PANELS RH & LH	O/S Bent / N/S *Check	2,100.00 FL	*1,050.00 FL
41	1		*FRONT RH FENDER STAY UPPER (NPA)	Not Necessary	0.00 FL	*- FL
42	1		*FRONT LH FENDER STAY (NPA)	Not Necessary	0.00 FL	*- FL
43	2		*FRONT CHASSIS FRAMES RH& LH (NPA)	Not Necessary	0.00 FL	*- FL
44	2		*FRONT DOORS RH& LH	Repair	2,448.20 FL	*- FL
45	1		*RH FRONT PILLAR OUTER GARNISH	*Check	65.00 FL	*- FL
46	2		*RH FRONT DOOR HINGES	Repair	164.80 FL	*- FL
47	1		*RH FRONT DOOR CHECKER	Serviceable	153.50 FL	*- FL
48	1		*ROCKER PANEL RH	Repair	530.60 FL	*- FL
49	1		*AIRCON CONDENSER GUIDE	Cracked	210.50 FL	*210.50 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
50	1		*AIRCON CONDENSOR	Bent	1,317.70 FL	*1,317.70 FL
51	1		*AIRCON FAN BLADE	*Check	205.40 FL	*- FL
52	1		*SET AIRCON LIQUID PIPE (2 PIPES)	*Check	980.00 FL	*- FL
53	1		*AIRCON DISCHARGE PIPE	*Check	380.00 FL	*- FL
54	1		*AIRCON FAN MOTOR ASSY	Jammed	544.70 FL	*544.70 FL
55	1		*AIRCON FAN COWLING	Cracked	224.30 FL	*224.30 FL
56	1		*AIRCON SUCTION HOSE	*Check	519.70 FL	*- FL
57	1		*RADIATOR	Bent	1,680.90 FL	*1,680.90 FL
58	1		*RADIATOR TOP HOSE	*Check	51.20 FL	*- FL
59	4		*RADIATOR STOPPERS	*Check	42.00 FL	*- FL
60	2		*RADIATOR SIDE AIR DUCTS RH & LH	*Check	79.40 FL	*- FL
61	1		*ENGINE MOUNTING RH	*Check	198.50 FL	*- FL
62	1		*ALTERNATOR	*Check	2,550.10 FL	*- FL
63	1		*ALTERNATOR BELT	*Check	110.20 FL	*- FL
64	1		*ENGINE TOP COVER	Serviceable	327.70 FL	*- FL
65	1		*INTAKE MANIFOLD	Serviceable	934.80 FL	*- FL
66	1		*FRONT WHEEL RH APRON	*Check	563.30 FL	*- FL
67	1		*STARTER MOTOR	*Check	1,549.10 FL	*- FL
68	1		*AIRCLEANER BOX	Repeated	911.10 FL	*- FL
69	1		*BATTERY TRAY	*Check	210.00 FL	*- FL
70	1		*ENGINE LOWER COVER -TOP	*Check	262.21 FL	*- FL
71	1		*ENGINE LOWER COVER -BOTTOM	*Check	253.90 FL	*- FL
72	1		*FRONT SHOCK ABSORBER RH	*Check	417.90 FL	*- FL
73	1		*FRONT SHOCK ABSORBER STOPPER	*Check	78.10 FL	*- FL
74	1		*FRONT SHOCK ABSORBER DUCT COVER	Serviceable	50.30 FL	*- FL
75	1		*FRONT LOWER ARM RH	*Check	979.80 FL	*- FL
76	1		*FRONT KNUCKLE ARM	*Check	497.90 FL	*- FL
77	1		*FRONT KNUCKLE ARM BEARING	*Check	153.50 FL	*- FL
78	1		*FRONT WHEEL HUB	Serviceable	175.80 FL	*- FL
79	1		*STEERING RACK & PINION	*Check	802.65 FL	*- FL
80	2		*STEERING TIE ROD ENDS RH & LH	Serviceable	311.80 FL	*- FL
81	1		*STABILIZER BAR	*Check	1,850.00 FL	*- FL
82	1		*STABILIZER BAR LINKAGE RH	*Check	181.10 FL	*- FL
83	1		*STABILIZER LINKAGE BUSH RH	*Check	27.20 FL	*- FL
84	1		*FRONT CROSS MEMBER	*Check	1,863.20 FL	*- FL
85	1		*DRIVE SHAFT ASSY	*Check	1,650.00 FL	*- FL
86	1		*AIRCON COMPRESSOR	*Check	2,091.40 FL	*- FL
87	2		*AIR BAG SENSORS RH&LH	Serviceable	780.00 FL	*- FL
88	1		*AIRCON CONDENSER GUIDE	*Check	210.50 FL	*- FL
89	1		*FRONT NUMBER PLATE WITH HOLDER	Missing	55.00 FS	*45.00 FS
90	1		*SET FRONT BUMPER CLIPS	Necessary	45.00 FS	*45.00 FS
91	1		*FRONT TYRE RH	Serviceable	450.00 FS	*- FS
92	1		*BATTERY	Serviceable	280.00 FS	*- FS
93	1		*ERP BRACKET	Necessary	28.00 FS	*26.00 FS
94	1		*ERP UNIT	Serviceable	128.00 FS	*- FS
95	1		*RADIATOR COOLANT	Necessary	60.00 FS	*25.00 FS
96	1		*SET FRONT FENDER INNER SHIELD CLIPS	Necessary	45.00 FS	*45.00 FS
97	1		*SET SUPPORT PANEL TOP GARNISH CLIPS	Necessary	45.00 FS	*45.00 FS
98	1		*FRONT WINDSCREEN SEALANT	Necessary	80.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) **48,872.06** **17,868.30**
- List Item Discount on L Items 25.00/25.00% (\$\$) 11,914.02 4,399.33

Total Parts (\$\$) **36,958.04** **13,468.97**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	SPRAY PAINTING ON ALL AFFECTED AREA	New	1,800.00	1,600.00
2	LABOUR REMOVE/REFIT ACCIDENT DAMAGES PARTS TO STRAIGHTEN UP	New	2,000.00	1,800.00
3	TO CHECK WIRING SYSTEM & LIGHT REMOVE /REFIT WIREHARNES	New	200.00	100.00
4	TO REMOVE & REFIT AIRCON CONDENSOR & REFILL GAS	New	150.00	100.00
5	TO REMOVE & REFIT RADIATOR ,PIPING ,HOSES & ETC	New	150.00	50.00
6	TO REMOVE & REFIT UNDERCARRIAGE AFFECTED AREAS	New	380.00	240.00
7	TO REMOVE & REFIT FRONT WINDSCREEN GLASS	New	150.00	120.00
8	WHEEL ALIGNMENT	New	100.00	60.00
9	TO REMOVE & REFIT FRONT DOORS MECHANISM	New	360.00	0.00
10	TO CHECK ,REMOVE ,REPLACE /REFIT AIRBAG CONTROL UNIT DUE TO SAFET (*Check)	New	350.00	0.00
11	TO REMOVE,REPLACE ,REFIT ENGINE & GEAR BOX TO REPAIR FRT CHASSIS	New	500.00	280.00
12	TO REMOVE/REPLACE ENGINE & GEAR BOX MOUNTING SET (*Check)	New	300.00	0.00
13	CALIBRATION AND REPROGRAMME	New	350.00	180.00
14	RUST PROOFING	New	180.00	150.00
Gross Labour Cost (\$\$)			6,970.00	4,680.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >