

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG19021914/ADS3Q2

Date: 27/08/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No:

Claimant
Vehicle No : SLT2897T **Insured Vehicle No :** SMD6803K

Date of Loss: 11/12/2019 Nature of Claim: TP Claim No: 5129650006SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLT2897T	Engine No:	2ZR8181041
Make & Model:	TOYOTA C-HR, 1.8 HYBRID S/G (A)	Chassis No:	ZYX102069992
Reg. Date:	25/10/2017 (Man. Year: 2017)	Odometer:	206997 km
Colour:	White		
Engine Capacity:	1797 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/55 R17	Rear Tyre Size:	215/55 R17
Front Left Side:	CST 6 mm	Rear Left Side:	CST 6 mm
Front Right Side:	CST 6 mm	Rear Right Side:	CST 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	7,099.62	5,215.52	1,884.10	26.54
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,540.00	2,050.00	1,490.00	42.09
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	10,639.62	7,265.52	3,374.10	31.71
Approved Total (Overridden) (S\$)		5,800.00		
(S\$)	10,639.62	5,800.00	4,839.62	45.49
+ GST 7.00/7.00% (S\$)	744.77	406.00	338.77	45.49
Nett Amount (S\$)	11,384.39	6,206.00	5,178.39	45.49
+ Loss of Use (7.0 x S\$100.00/day) (S\$)		700.00		
+ Doc/Search Fee (S\$)		7.45		
Nett Liability (S\$)		6,913.45		

INSPECTION

Date of Assignment: 11/12/2019

Date Inspected: 11/12/2019 Inspected At:

MG Solution Pte Ltd (HQ)
23 Kaki Bukit Avenue 4 #02-03B,
VICOM Inspection Centre
Singapore 415933

Estimated Period of Repair: 6.0 days

Adjuster: ADRIAN LING

Manager: CHAN JIA LE

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BOOT LID	Dented	1,366.90 FL	*1,258.00 FL
2	1		*BOOT LID LOGO	Not Necessary	80.00 FL	*- FL
3	1		*BOOT LID EMBLEM CH-R	Not Necessary	72.00 FL	*- FL
4	1		*BOOT LID EMBLEM HYBRID SYNERGY DRIVE	Not Necessary	95.30 FL	*- FL
5	1		*BOOTLID WEATHERSTRIP	Cut	240.30 FL	*240.30 FL
6	1		*BOOTLID LOCK	Damaged	320.00 FL	*320.00 FL
7	1		*BOOTLID DETECTOR	Cracked	180.30 FL	*180.30 FL
8	1		*BOOTLID WINDSCREEN MOULDING	Necessary	211.30 FL	*211.30 FL
9	1		*REAR BUMPER	Deformed	850.00 FL	*850.00 FL
10	1		*REAR BUMPER LOWER LID	Deformed	580.00 FL	*580.00 FL
11	2		*REAR BUMPER SIDE RETAINER	Necessary	124.80 FL	*124.80 FL
12	1		*REAR BUMPER REINFORCEMENT	Bent	555.00 FL	*398.00 FL
13	1		*REAR BUMPER TOWING COVER	Missing	66.50 FL	*66.50 FL
14	1		*REAR BUMPER REFLECTOR	N/S Cracked	180.00 FL	*90.00 FL
15	2		*REAR BUMPER REFLECTOR HOUSING	Cut	364.60 FL	*182.30 FL
16	1		*REAR BUMPER BRAKE LIGHT COVER	Cracked	103.00 FL	*103.00 FL
17	1		*REAR TAILLAMP	N/S Cracked	1,040.00 FL	*520.00 FL
18	1		*REAR FENDER INNER TRIM	N/S Cracked	1,240.00 FL	*422.00 FL
19	1		*REAR END PANEL	Dented	860.30 FL	*725.00 FL
20	1		*REAR END PANEL TOP GARNISH	Cracked	189.20 FL	*189.20 FL
21	1		*BOOTLID WINDSCREEN SEALANT	Necessary	100.00 FS	*30.00 FS
22	1		*BOOTLID WINDSCREEN INNER SEAL	Necessary	80.00 FS	*30.00 FS
23	1		*SET REAR BUMPER CLIP	Necessary	20.00 FS	*20.00 FS
24	1		*SET REAR FENDER INNER TRIM CLIPS	Necessary	20.00 FS	*20.00 FS
25	1		*REAR END PANEL SEALANT	Necessary	100.00 FS	*60.00 FS
26	1		*SET REAR END PANEL TOP GARNISH CLIPS	Necessary	20.00 FS	*10.00 FS
27	1		*REVERSE SENSOR	Damaged	220.00 FS	*200.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	9,279.50	6,830.70
- List Item Discount on L Items 25.00/25.00% (\$\$)	2,179.88	1,615.18
Total Parts (\$\$)	7,099.62	5,215.52

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING ,REMOVAL AND REPLACING PARTS	New	1,200.00	800.00
2	TO SPRAY PAINT AFFECTED AREA	New	1,200.00	800.00
3	TUFF COAT	New	250.00	60.00
4	WIRING CHECK	New	160.00	30.00
5	UPHOLSTERY AND ROOF LINING TO FACILITATE REPAIR	New	250.00	60.00
6	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING	New	120.00	50.00
7	REMOVE AND REFIX REVERSE CAMERA AND DISTANCE SETTING	New	120.00	50.00
8	TRANSFER BOOT LID MECHANISM	New	80.00	80.00
9	TO REMOVE AND REFIX REAR WINDSCREEN	New	160.00	120.00
Gross Labour Cost (S\$)			3,540.00	2,050.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >