

**LKK Auto Consultants**  
**#01-25 Paya Ubi Industrial Park, 51**  
**Ubi Avenue 1**  
**408933**

**Insurer Reference:**  
**Repairer Reference: GBH1712G-OD CHINA**  
**Date calculated: 27/04/2020 2:49 PM**

**Full Report**  
**Registration: GBH1712G**  
**Printed: 27/04/2020 2:49 PM**

### Summary Information

---

**Claim**

Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	KK LAU	Currency:	SGD
Claim Reference:		Date of Incident:	09/12/19
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

### Vehicle Details

---

**Vehicle**

Manufacturer:	TOYOTA
Model:	DYNA
Sub Model:	BASE MODEL
Model Sheet Number:	70 1C 01
Registration:	GBH1712G
VIN number:	
Odometer:	

**Model Specs**

AIR CONDITIONING	PLATFORM	WHEELBASE 2525MM	STANDARD CAB
TWO COAT METALLIC	PREPARE OFF VEHICLE		

### Vehicle Condition


---

**Vehicle Status**

Pre-Accident Damage:  
Date of Inspection:

**Damage Areas**

**All** ☐  
**Underbody** ☐

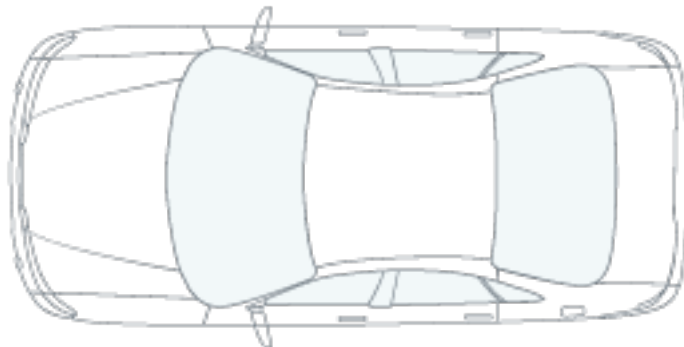

## Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
520011	RENEW FRONT BUMPER INCLUDES: R + R BUMPER AND NECESSARY ATTACHED PARTS	10.0		42.00
751011	R + R RADIATOR GRILLE	3.0		12.60
810051)	R + R R/HEADLAMP (RADIATOR GRILLE REMOVED) DOES NOT INCLUDE: ADJUST HEADLAMP	1.0		4.20
810151A	ADJUST HEADLAMPS	3.0		12.60
NO NUMBER	REMOVE AND REFIT R/END MOULDING	1.0		4.20
670051	RENEW R/F DOOR INCLUDES: R + R DOOR, CONVERT ALL ATTACHED PARTS, ADJUST DOOR	14.0		58.80
0413	ENGINE FIREWALL REPAIR	10.0*		42.00
0912	R/OUTER A-PILLAR REPAIR	15.0*		63.00
<b>Labour Cost</b>		<b>Hrs</b>	<b>WU</b>	
<b>Panel / Mechanical Labour</b>		<b>5.70</b>	<b>57.0</b>	<b>239.40</b>
<b>Total of Labour</b>				<b>239.40</b>

## Paint

Paint Work		Time Basis 10 WU/h		
Code	Description - TWO COAT METALLIC		WU	Price SGD
LE 0281	FRONT BUMPER NEW PART PAINT ST 1		12.0	50.40
LE 0888	R/END MOULDING NEW PART PAINT ST 1		6.0	25.20
LE 1482	RIGHT FRONT DOOR NEW PART PAINT ST 1		16.0	67.20
LE 2206	R/F STEP NEW PART PAINT ST 1		6.0	25.20
LS 0912	R/OUTER A-PILLAR REPAIR PAINT ST IV		15.0	63.00
L 0413	ENGINE FIREWALL SURFACE PAINT ST 2		7.0	29.40
L 0418	OUTER ENG FIREWALL SURFACE PAINT ST 2		5.0	21.00
NO NUMBER	PREPARE FOR PAINTING		21.0	88.20
NO NUMBER	PAINT PREPARATION FOR PLASTIC PARTS (COMPOSITE WORK)		5.0	21.00
<b>Total Paint</b>		<b>Hrs</b>	<b>WU</b>	<b>Price SGD</b>
		<b>9.30</b>	<b>93.0</b>	<b>390.60</b>

## Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number		Price SGD
0281	FRONT BUMPER	52111 37301	Original	230.00
1002	FRONT CORNER PANEL	BRACKET RH	Original	38.00
0410	GRILLE	53111 37891	Original	200.00
1510	R/DOOR SEAL	67861 37021	Original	25.00
0888	R/END MOULDING	53813 37100A0	Original	85.00
1482	RIGHT FRONT DOOR	67001 37292	Original	560.00

Code	Description	Part Number	Price SGD
0562	RIGHT HEADLAMP ASSY	81110	256.00
		37120(\$320-2	
f: OEM Parts	<b>Savings</b>		<b>0.00</b>
n: Non-OEM Parts	<b>Subtotal</b>		<b>1,394.00</b>
u: Used parts	<b>Fixed Sundry Parts Price</b>		<b>100.00</b>
	<b>Total</b>		<b>1,494.00</b>

### Extras

Code	Description	Price SGD
1000	TO CHECK WIRING	30.00*
1001	FRT DOOR ROC STICKER	20.00*
	<b>Total Extras</b>	<b>50.00</b>

### Final Calculation

	SGD	SGD
<b>Parts</b>	1,394.00	
Fixed Sundry Parts Price	100.00	
<b>Total Parts</b>		<b>1,494.00</b>
<b>Labour Time Base 10 WU/h</b>		
Total 57.0 WU X 42.00 SGD/h	239.40	
<b>Total of Labour</b>		<b>239.40</b>
<b>Total Of Extras</b>		<b>50.00</b>
<b>Paint Work Time Base 10 WU/h</b>		
Labour Cost 93.0 WU X 42.00 SGD/h	390.60	
<b>Total Paint Including Material</b>		<b>390.60</b>
<b>Repair Cost Excludes GST</b>		<b>2,174.00</b>
GST (+7.0%)		<b>152.18</b>
<b>Repair Cost Included GST</b>		<b>2,326.18</b>

### Comments

\* - USER SUPPLIED DATA  
 NN - NO MANUFACTURERS CODE EXISTS  
 ) - WU PARTIAL INCL IN OTHER POSITIONS

### Assessment Note

No assessment notes entered.