



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2104845

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 09/07/2021
Reference CC3/CTI19021997/Nga3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHD 1859S
Insured Veh. YN 4541J
Claim No. SNM19D205974
Policy No. DMCVSN1836961901
Accident Date 12/12/2019
Inspection Date 13/12/2019

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC3/CTI19021997/Nga3q2 Date: 09/07/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	YN 4541J	Veh. Inspected	SHD 1859S
	Policy No.	DMCVSN1836961901	Coverage (\$)	0.00
	Claim No.	SNM19D205974	Excess (\$)	0.00
	Assign From		Assign Date	13/12/2019
2. Vehicle Particulars & Condition				
	Make & Model	KIA OPTIMA	c.c	1685
	Engine No.	HIDDEN	Year of Reg.	2014
	Chassis No.	KNAGM414MF5561706	Colour	SILVER
	Odometer	475503 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	POOR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	205/65 R16	HANKOOK	5 mm
	L/H Front Tyre	205/65 R16	HANKOOK	5 mm
	R/H Rear Tyre	205/65 R16	HANKOOK	5 mm
	L/H Rear Tyre	205/65 R16	HANKOOK	5 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT & REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	12/12/2019	Inspection Date	13/12/2019
	Survey held at	PREMIER AUTOMOTIVE SERVICES PTE LTD 23 CHANGI SOUTH AVENUE 2 #01-02 SINGAPORE 486443		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		8 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 1859S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	DENTED	979.00	979.00
1	BONNET LOCK	DEFORMED	36.00	36.00
1	BONNET LIFTER	SERVICEABLE	70.00	-
1	BONNET LOCK BASE	SERVICEABLE	13.00	-
2	BONNET HINGE O/S & N/S @\$23.00	SERVICEABLE	46.00	-
1	BONNET GRILLE	CRACKED	385.00	385.00
1	SUPPORT PANEL	DEFORMED	645.00	645.00
1	FRONT BUMPER	CRACKED	531.00	531.00
1	FRONT BUMPER EMBLEM	NECESSARY	44.00	44.00
1	FRONT BUMPER CENTRE GRILLE	SERVICEABLE	174.00	-
1	FRONT BUMPER LOWER STIFFER	SERVICEABLE	134.00	-
1	FRONT BUMPER TOW HOOK COVER	CRACKED	14.00	14.00
1	FRONT BUMPER LIP	SERVICEABLE	52.00	-
1	FRONT BUMPER INNER SPONGE	DEFORMED	110.00	110.00
1	FRONT BUMPER REINFORCEMENT	BENT	328.00	328.00
2	FRONT BUMPER O/S & N/S SIDE RETAINER @\$16.00	SERVICEABLE	32.00	-
2	FRONT BUMPER O/S & N/S UPPER BRACKET @\$16.00	SERVICEABLE	32.00	-
2	FRONT BUMPER O/S & N/S SUPPORT BRACKET @\$16.00	SERVICEABLE	32.00	-
2	N/S & O/S HEADLAMP @\$1028.00	CRACKED	2,056.00	2,056.00
2	FRONT BUMPER O/S & N/S PROTECTOR @\$51.00	SERVICEABLE	102.00	-
2	FRONT BUMPER O/S & N/S FOG LAMP COVER @\$66.00	SERVICEABLE	132.00	-
1	AIR CON CONDENSER	DEFORMED	805.00	805.00
1	RADIATOR	SERVICEABLE	669.00	-
1	AIR DUCT	SERVICEABLE	210.00	-
1	INTERCOOLER	SERVICEABLE	800.00	-
1	BLOWER ASSY	SERVICEABLE	596.00	-
1	BOOT LID	DEFORMED	1,119.00	1,119.00
1	BOOT LID LOCK	JAMMED	99.00	99.00
1	BOOTLID LOCK CABLE	SERVICEABLE	35.00	-
1	BOOTLID STRIKER	DEFORMED	21.00	21.00
1	BOOTLID EMBLEM	NECESSARY	27.00	27.00

Report Ref No. CC3/CTI19021997/Nga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOTLID CRDI	NECESSARY	29.00	29.00
1	BOOT LID RUBBER WEATHERSTRIP	TORN	96.00	96.00
1	BOOT LID LOWER GARNISH	DEFORMED	290.00	290.00
2	BOOTLID HINGES @\$66.00	DEFORMED	132.00	132.00
2	REAR LICENSE PLATE LAMP @\$30.00	BROKEN	60.00	60.00
2	BOOTLID HINGE TORSION BAR @\$33.00	SERVICEABLE	66.00	-
1	HANDLE TRUNK LID HOOK	SERVICEABLE	5.00	-
1	BOOTLID INNER TRIM	DEFORMED	190.00	190.00
1	END PANEL	DEFORMED	250.00	250.00
1	END PANEL INNER GARNISH	DEFORMED	74.00	74.00
1	REAR N/S FENDER	BENT	1,205.00	1,205.00
1	REAR N/S FENDER INNER SHIELD	TORN	120.00	120.00
1	REAR WINDSCREEN MOULDING	NECESSARY	87.00	87.00
1	REAR BUMPER	CRACKED	696.00	696.00
1	REAR O/S FENDER TOP CHROME MOULDING	SERVICEABLE	97.00	-
1	REAR N/S FENDER TOP CHROME MOULDING	SERVICEABLE	97.00	-
1	REAR BUMPER LOWER COVER	CRACKED	206.00	206.00
2	REAR BUMPER SIDE BRACKET O/S & N/S @\$29.00	DEFORMED	58.00	58.00
1	REAR BUMPER INNER SPONGE	CRACKED	114.00	114.00
1	REAR BUMPER REINFORCEMENT	BROKEN	607.00	607.00
2	REAR BUMPER STAY O/S & N/S @\$54.00	BENT	108.00	108.00
2	REAR BUMPER REINFORCEMENT LOWER BRACKET @ \$18.00	DEFORMED	36.00	36.00
2	REAR BUMPER REINFORCEMENT UPPER BRACKET @ \$18.00	SERVICEABLE	36.00	-
2	REAR BUMPER REFLECTOR N/S & O/S @\$46.00	CRACKED	92.00	92.00
2	N/S & O/S TAIL LAMP @\$421.00	CRACKED	842.00	842.00
2	N/S & O/S REFLECTOR @\$350.00	CRACKED	700.00	700.00
1	N/S & TAIL LAMP PANEL	DEFORMED	215.00	215.00
1	O/S & TAIL LAMP PANEL	DEFORMED	215.00	215.00
1	SPARE TYRE CLAMP	BROKEN	6.00	6.00
1	EXHAUST PIPE	BENT	1,009.00	1,009.00
1	EXHAUST PIPE HANGER	MISSING	40.00	40.00
1	FLOORBOARD PANEL	DEFORMED	625.00	625.00

Report Ref No. CC3/CTI19021997/Nga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FLOORBOARD PANEL TRIM	SERVICEABLE	205.00	-
	LESS 10% DISCOUNT		-1,893.60	-1,530.10
			17,042.40	13,770.90
	<u>SPECIAL NETT ITEMS</u>			
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	48.00	48.00
1	SET END PANEL INNER GARNISH CLIPS (SN)	NECESSARY	30.00	30.00
1	SET BOOTLID INNER TRIM CLIPS (SN)	NECESSARY	52.00	52.00
1	SET BOOTLID LOWER GARNISH CLIPS (SN)	NECESSARY	60.00	60.00
1	SET BOOTLID STICKERS (SN)	NECESSARY	100.00	100.00
1	SET REVERSE SENSOR (SN)	MISSING	280.00	280.00
1	REAR BUMPER TOP PROTECTOR (SN)	NECESSARY	80.00	80.00
1	SET FLOORBOARD COMPARTMENT INSULATING PADDINGS (SN)	NOT NECESSARY	120.00	-
1	REAR NO.PLATE WITH CASING (SN)	SERVICEABLE	50.00	-
1	COOLANT 6L (SN)	NOT NECESSARY	40.00	-
1	FRONT NO PLATE WITH CASING (SN)	SERVICEABLE	50.00	-
1	FRONT BUMPER CLIPS (SN)	NECESSARY	48.00	48.00
2	FRONT N/S & O/S HEAD LAMP LOWER CLIP @\$6.00 (SN)	NECESSARY	12.00	12.00
2	FRONT N/S & O/S HEAD LAMP SIDE CLIP @\$60.00 (SN)	NECESSARY	6.00	6.00
2	FRONT N/S & O/S FENDER STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
2	REAR N/S & O/S FENDER STICKER @\$60.00 (SN)	NECESSARY	120.00	120.00
1	SUNDRY (SN)	NOT NECESSARY	50.00	-
			1,266.00	956.00
	<u>LABOUR</u>			
	TOWING FEE.	NOT NECESSARY	50.00	-
	TO CHECK FOR WIRING AND TO FOCUS HEAD LAMPS .		80.00	30.00
	TO TOP UP AIRCON GAS .		120.00	60.00
	TO DISMANTLE /REPLACE REVERSE SENSOR TO NEW BUMPER AND RESET TO THE SAME.		120.00	30.00
	TO DISMANTLE AND REFIT THE REAR WINDSCREEN .		120.00	100.00
	TO DISMANTLE /REPLACE EXHAUST PIPE .		120.00	50.00
	TO DISMANTLE /REFIT THE INNER GARNISHES ,INNER LININGS ,INNER TRIMS ,CUSHION SEAT ,CARPET ,ETC TO FACILITATE REPAIRS .		180.00	80.00

Report Ref No. CC3/CTI19021997/Nga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO LABOUR CHARGE FOR DISMANTLE AND RENEW THE ACCIDENT DAMAGED PARTS .TO HEAT/WELD ,CUT-OFF THE THE END PANEL,FLOORBOARD PANEL ,REAR N/S FENDER .INCLUDING KNOCK -OUT,STRAIGHTEN ,REPAIR ,RESHAPE AND ADJUST OF THE REAR N/S & O/S CHASSIS .		3,000.00	1,260.00
	TO PUTTY AND SPRAY PAINTING ON BOOTLID ,BOOTLID LOWER GARNISH ,REAR BUMPER ,FLOORBOARD COMPARTMENT ,END PANEL ,REAR N/S FENDER ,REAR N/S TAILLAMP PANEL ,FRONT BUMPER ,BONNET ,REAR N/S & O/S CHASSIS MEMBER ,FRONT O/S FENDER ,FRONT N/S FENDER,REAR O/S FENDER ,REAR O/S TAILLAMP PANEL .		3,000.00	1,260.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.		300.00	150.00
			7,090.00	3,020.00
GRAND TOTAL			25,398.40	17,746.90
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				14,200.00

Report Ref No. CC3/CTI19021997/Nga3q2

MUHAMMAD NAZRIL BIN ABDULLAH

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1859S

INSPECTION

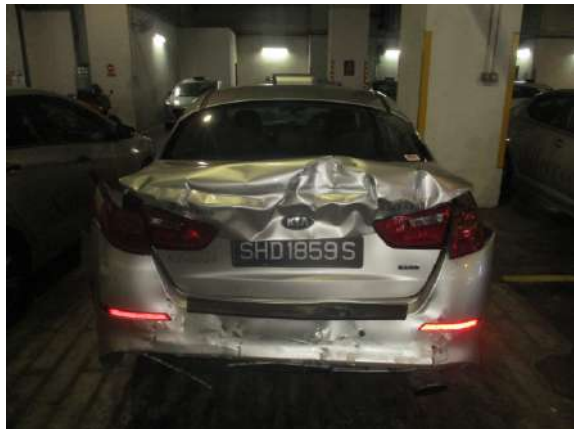



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

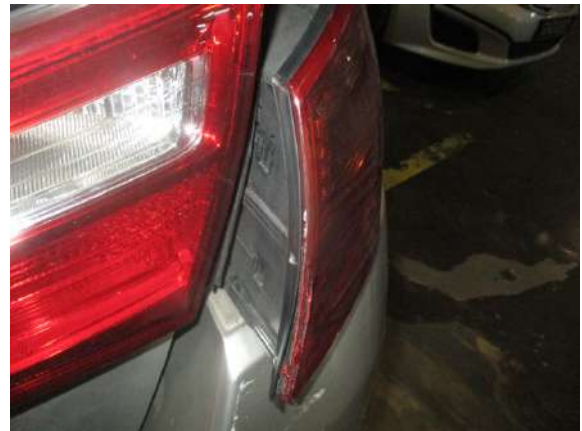



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1859S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1859S

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 1859S

RE-INSPECTION

