

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC4/AIG19022091/UKA3Q2

**Date:** 14/09/2020

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100430575

**Claimant**  
**Vehicle No :** SKZ7685K **Insured Vehicle No :** SKV6712T

Date of Loss: 02/10/2019 Nature of Claim: TP Claim No: 9740429037SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SKZ7685K</b>	Engine No:	71403949N52B25AF
Make & Model:	BMW 325I, 2.5 (A)	Chassis No:	WBAWB32050PV50799
Reg. Date:	26/04/2007 (Man. Year: 2007)	Odometer:	230942 km
Colour:	Red		
Engine Capacity:	2497 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	235/35 R19	Rear Tyre Size:	235/35 R19
Front Left Side:	Yokohama 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Yokohama 6 mm	Rear Right Side:	Yokohama 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,030.00	0.00	1,030.00	100.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	550.00	250.00	300.00	54.55
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (S\$)</b>	<b>1,580.00</b>	<b>250.00</b>	<b>1,330.00</b>	<b>84.18</b>
<b>+ GST 7.00/7.00% (S\$)</b>	110.60	17.50	93.10	84.18
<b>Nett Amount (S\$)</b>	<b>1,690.60</b>	<b>267.50</b>	<b>1,423.10</b>	<b>84.18</b>
<b>+ Loss of Use (2.0 x S\$100.00/day) (S\$)</b>		200.00		
<b>Nett Liability (S\$)</b>		<b>467.50</b>		

### INSPECTION

Date of Assignment: 13/12/2019

Date Inspected: 27/12/2019 Inspected At:

Automobile Integrated Management  
Pte Ltd (HQ)  
23 Kaki Bukit Ave 4 #04-01, Kaki Bukit  
(South Wing)  
Singapore 415933

Estimated Period of Repair: 2.0 days

**Adjuster:** MARCUS CHUA

**Manager:** Khanchna Pothuraj

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER Q	Repair	1,030.00 F	*- F
F=Franchise part.						
					<b>Total Parts (S\$)</b>	<b>1,030.00</b>
						<b>0.00</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO CHECK WIRING }	New	50.00	250.00
2	LABOUR CHARGE }	New	200.00	0.00
3	TO PUTTY AND SPRAY PAINTING }	New	300.00	0.00
<b>Gross Labour Cost (\$\$)</b>			<b>550.00</b>	<b>250.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >