

**Conclusion**

13. Basing on our physical inspection of the Bicycle, it appears that the steering system and braking system of the Bicycle were all in serviceable condition. We did not find any evidence(s) to suggest that there was possible mechanical failure to the Bicycle that may have caused and/or contributed to the accident.

14. The 2 tyres of the Bicycle were found to be in serviceable condition. There was no tear, cut or burst mark(s) on the outer and the inner sidewalls as well as across the tread of the 2 tyres. The 2 tyres were observed to be deflated at the time of our inspection.

**Muhd Nazril***Senior Technical Investigator***Ang Bryan Tani***AMSOE, AMIRTE, AFF SAE, M.MATAI, AFF.Inst.AEA**Senior Technical Investigator**Technical Investigation & Reconstructionist (SAE-A)*

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability or responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.