

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/AIG19022526/EBA3N2

Date: 22/05/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No:

Claimant
Vehicle No : SGG9082J **Insured Vehicle No :** SLU7866U

Date of Loss: 19/12/2019 Nature of Claim: TP Claim No: 8124480995SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SGG9082J**
 Make & Model: BMW 520I, 2.0 L AT D/AB 2WD 4DR GAS/D NAV (A) Engine No: A3180144N20B20B
 Reg. Date: 30/03/2012 (Man. Year: 2012) Chassis No: WBAXG12010DX48257
 Colour: Brown Odometer: 30958 km
 Engine Capacity: 1997 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/55 R17 Rear Tyre Size: 225/55 R17
 Front Left Side: Continental 5 mm Rear Left Side: Continental 5 mm
 Front Right Side: Continental 5 mm Rear Right Side: Continental 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,355.85	4,135.40	1,220.45	22.79
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,276.00	3,713.00	2,563.00	40.84
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	11,631.85	7,848.40	3,783.45	32.53
+ GST 7.00/7.00% (S\$)	814.23	549.39	264.84	32.53
Nett Amount (S\$)	12,446.08	8,397.79	4,048.29	32.53
+ Loss of Use (3.0 x S\$110.00/day) (S\$)		330.00		
Nett Liability (S\$)		8,727.79		

INSPECTION

Date of Assignment: 24/12/2019

Date Inspected: 24/12/2019 Inspected At:

PERFORMANCE MOTORS LIMITED
 303 ALEXANDRA ROAD
 SIME DARBY PERFORMANCE
 CENTRE
 SINGAPORE 159941

Estimated Period of Repair: 5.0 days

Adjuster: CHEN TSUE YEE**Manager:** CHUA ZHEN LI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SUNDRIES	Necessary	150.00 FS	*80.00 FS
2	1		*FRT LH 2 SIDE PANEL BRACKET	Not Necessary	35.10 FS	* - FS
3	1		*FRT LH FENDER	Repair	888.85 FS	* - FS
4	1		*FRT BUMPER LH SPACER	Not Necessary	30.05 FS	* - FS
5	1		*FRT BUMPER TRIM PRIMED (PDC)	Deformed	1,351.15 FS	*1,351.15 FS
6	1		*LH HEADLAMP SUPPORT	Not Necessary	196.45 FS	* - FS
7	1		*SET HEADLIGHT GASKET	Necessary	34.85 FS	*34.85 FS
8	1		*LH BI-XENON HEADLIGHT	Broken	2,662.90 FS	*2,662.90 FS
9	1		*LH LEVER	Broken	6.50 FS	*6.50 FS
F=Franchise part. S=SpcNett.						
Total Parts (S\$)					5,355.85	4,135.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REPLACE FRONT BUMPER ,FENDER LEFT ,SUPPORT LEFT AND ATTACHMENTS	New	3,400.00	1,275.00
2	PAINTING FRONT BUMPER AND FENDER LEFT	New	1,923.00	1,730.00
3	TO CHECK ELECTRICAL WIRING SYSTEMS AT THE FRONT SECTION FOR PROPER FUNCTION INCLUDING ADJUSTMENTS OF HEADLIGHTS	New	177.00	150.00
4	TO REMOVE OLD PDC ASSEMBLY ,REPLACE DAMAGED PARTS AND RECONNECT TO NEW BUMPER INCLUDING CONDUCT CHECKS FOR PROPER FUNCTION	New	177.00	150.00
5	TO REPLACE LEFT OR RIGHT HEADLIGHT	New	481.00	408.00
6	TO CARRY OUT BODY CAVITY PRESERVATION (PER PANEL)	New	118.00	0.00
Gross Labour Cost (\$\$)			6,276.00	3,713.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >