

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC6/AIG20000775/UES3Q2

**Date:** 19/04/2021

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2100432313-04

**Claimant**  
**Vehicle No :** FBN1513H **Insured Vehicle No :** SKV9157B

**Date of Loss:** 04/01/2020 **Nature of Claim:** TP **Claim No:** 5572222581SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>FBN1513H</b>		
Make & Model:	YAMAHA NMAX155, 155cc	Engine No:	G3H6E0009677
Reg. Date:	26/07/2018 (Man. Year: 2018)	Chassis No:	MH3SG431000007473
Colour:	White	Odometer:	28600 km
Engine Capacity:	155 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	110/70-13	Rear Tyre Size:	130/70-13
Front Left Side:	Metzeler 7 mm	Rear Left Side:	Metzeler 7 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	70.00	30.00	40.00	57.14
Miscellaneous Items	0.00	0.00	0.00	
Labour	182.00	110.00	72.00	39.56
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (S\$)</b>	<b>252.00</b>	<b>140.00</b>	<b>112.00</b>	<b>44.44</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>17.64</b>	<b>9.80</b>	<b>7.84</b>	<b>44.44</b>
<b>Nett Amount (S\$)</b>	<b>269.64</b>	<b>149.80</b>	<b>119.84</b>	<b>44.44</b>
<b>Global Sum Settlement (S\$)</b>		<b>0.00</b>		

### INSPECTION

Date of Assignment: 13/01/2020

Date Inspected: 13/01/2021 Inspected At: Ban Hock Hin Co. Pte Ltd (HQ)  
No. 6 Defu Lane 4  
Singapore 539410

Estimated Period of Repair: 2.0 days

**Adjuster:** MARCUS CHUA

**Manager:** Asher Sng Rong Yi

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*COVER SIDE REAR RH (WHITE)	Repair	40.00 F	*- FL
2	1		*STICKER (CISCO) COVER REAR RH	Necessary	30.00 FS	*30.00 FS
					<b>Sub Total (\$\$)</b>	<b>70.00 30.00</b>
					<b>- List Item Discount on L Items 0.00/10.00% (\$\$)</b>	<b>0.00 0.00</b>
					<b>Total Parts (\$\$)</b>	<b>70.00 30.00</b>

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	LABOUR-FOR DISMANTLING AND ASSEMBLING OF PARTS QUOTED	New	63.00	50.00
2	TRANSPORT CHARGES -DELIVERY/COLLECTION	New	56.00	0.00
3	SPRAY PAINT	New	63.00	60.00
<b>Gross Labour Cost (S\$)</b>			<b>182.00</b>	<b>110.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >