



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2005162
INV Date 23/07/2020
Reference CC4/LPC20000787/Ada3n2
Code LPC2



PROFESSIONAL SERVICE FEE

Vehicle No. SGW 3518A
Insured Veh. SMD 240Z
Claim No. 19/20/20/VP05/022898
Policy No. Z/19/VP05/024929-001
Accident Date 10/01/2020
Inspection Date 13/01/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

Ref : CC4/LPC20000787/Ada3n2

300 BEACH ROAD
#17-04/07 THE CONCOURSESINGAPORE 199555

Date : 23-07-2020



Code : LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SMD 240Z	Veh. Inspected	SGW 3518A
Policy No.	Z/19/VP05/024929-001	Coverage (\$)	0.00
Claim No.	19/20/20/VP05/022898	Excess (\$)	0.00
Assign From		Assign Date	13/01/2020

2. Vehicle Particulars & Condition

Make & Model	HONDA STREAM	c.c	1799
Engine No.	HIDDEN	Year of Reg.	2007
Chassis No.	RN61039637	Colour	BLACK
Odometer	243620	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/65 R15	MICHELIN	6 mm
L/H Front Tyre	205/65 R15	MICHELIN	6 mm
R/H Rear Tyre	205/65 R15	MICHELIN	6 mm
L/H Rear Tyre	205/65 R15	MICHELIN	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY AND UNDERCARRIAGE DAMAGES SEE DETAILS.

5. General Information

Accident Date	10/01/2020	Inspection Date	13/01/2020
Survey held at	ZERO GRAVITY 2 KAKI BUKIT AVE 2 #01-25 KAKI BUKIT AUTOHUB SINGAPORE 417921		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	9 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGW 3518A

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	WHEEL BEARING (L/H/F)	BENT	156.90	156.90
1	STEERING KNUCKLE (FRONT)(L/H)	DAMAGED	294.20	294.20
1	BRAKE HOSE (L/H/F)	CUT	103.60	103.60
1	SHOCK ABSORBER (L/H/F)	BENT	427.30	427.30
1	SHOCK ABSORBER MOUNTING (L/H/F)	NOT NECESSARY	78.00	-
1	LOWER ARM (L/H/F)	BENT	361.30	361.30
1	STABILIZER LINKAGE (L/H)	BENT	75.00	75.00
1	POWER STEERING RACK	NOT NECESSARY	1,779.10	-
1	STEERING LINKAGE (L/H/F)	NOT NECESSARY	97.80	-
1	STEERING BALL JOINT (L/H)	NOT NECESSARY	68.00	-
1	DRIVE SHAFT (L/H/F)	NOT NECESSARY	1,146.60	-
1	WHEEL HUB (L/H/R)	DAMAGED	274.70	274.70
1	WIPER GARNISH (L/H)	NOT NECESSARY	88.90	-
1	FRONT WHEEL HOUSING PANEL (L/H/F)	TO REPAIR SEE LABOUR	530.70	-
1	FENDER (L/H/F)	DISTORTED	482.20	482.20
1	FENDER SIGNAL LAMP (L/H)	CRACKED	21.50	21.50
1	FENDER INNER GARNISH (L/H/F)	NOT NECESSARY	88.20	-
1	SET HEADLIGHT (L/H)	SMASHED	654.40	654.40
1	HEADLIGHT LOWER BRACKET (L/H)	NOT NECESSARY	33.70	-
1	FRONT BUMPER	DISTORTED	699.60	699.60
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	240.70	-
12	BUMPER CLIP @\$4.50	NECESSARY	54.00	30.00
1	FOG LIGHT COVER (L/H)	NOT NECESSARY	25.60	-
1	BUMPER SIDE RETAINER (L/H/F)	DAMAGED	18.50	18.50
1	FRONT GRILLE	NOT NECESSARY	256.00	-
1	SUPPORT PANEL	NOT NECESSARY	514.50	-
1	SUPPORT PANEL GARNISH (TOP)	NOT NECESSARY	125.40	-
1	AIR RESONATE BOX	NOT NECESSARY	203.90	-
1	DOOR (L/H/R)	DENTED	1,014.10	1,014.10
1	DOOR HINGE (L/H/F UPPER)	NOT NECESSARY	40.60	-

Report Ref No. CC4/LPC20000787/Ada3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	DOOR HINGE (L/H/F LOWER)	NOT NECESSARY	57.20	-
1	DOOR (L/H/F)	DENTED	860.00	860.00
1	ROCKER PANEL (L/H)	TO REPAIR SEE LABOUR	249.30	-
1	REAR BUMPER	TO REPAIR SEE LABOUR	960.00	-
1	BUMPER SIDE RETAINER (L/H/R)	NOT NECESSARY	32.00	-
	LESS 20% DISCOUNT		-2,422.70	-1,094.66
			9,690.80	4,378.64
	<u>SPECIAL NETT ITEMS</u>			
1	SPORT RIM (L/H/R) (SN)	CUT	300.00	300.00
1	SPORT RIM (L/H/F) (SN)	CRACKED	300.00	300.00
1	TYRE (L/H/R)(SN)	NOT NECESSARY	220.00	-
1	TYRE (L/H/F) (SN)	DEFORMED	220.00	180.00
			1,040.00	780.00
	<u>LABOUR</u>			
	TOWING CHARGES.		120.00	60.00
	TO COMPUTERISE ADJUST WHEEL ALIGNMENT.		100.00	80.00
	TO CHECK UNDERCARRIAGE AND REPLACE DAMAGED PARTS.		350.00	220.00
	TO PROVIDE UNDER TURCOAT.		150.00	60.00
	PANEL BEATING & REPLACING OF THE ABOVE .INCLUSIVE OF THE REPAIR OF FRONT WHEEL HOUSING PANEL (L/H/F),ROCKER PANEL (L/H) AND REAR BUMPER.		1,500.00	800.00
	TO PUTTY AND RE-SPRAY AFFECTED PORTION .		1,750.00	1,200.00
	TO CHECK WIRING SYSTEM ,FOCUS LIGHTINGS.		50.00	30.00
	TO REMOVE AND REFIT SIDE WINDSCREEN GLASS (L/H).	NOT NECESSARY	150.00	-
	TO REMOVE,TRANSFER & INSTALL RELATED COMPONENT.		240.00	160.00
	PRESS BEARING.	NOT NECESSARY	50.00	-
	TO REMOVE AND REFIT COMPONENTS /FACILITATE THE REPAIR.	NOT NECESSARY	180.00	-
			4,640.00	2,610.00

Report Ref No. CC4/LPC20000787/Ada3n2



GRAND TOTAL		15,370.80	7,768.64
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			5,500.00

Report Ref No. CC4/LPC20000787/Ada3n2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGW 3518A

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

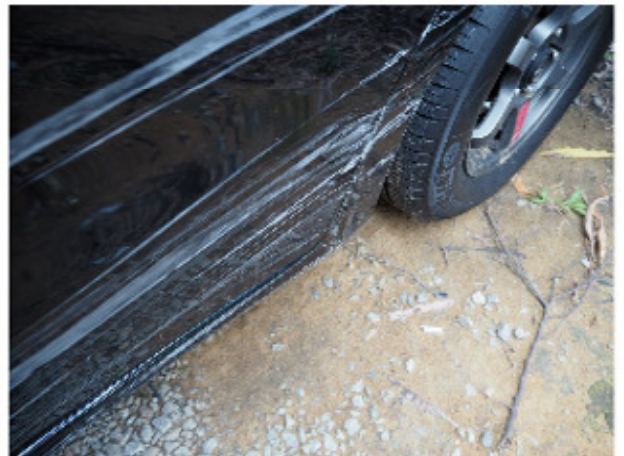



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SGW 3518A

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

